

FANNIN • LEHNER


PRESERVATION CONSULTANTS

OLD BURIAL GROUND STURBRIDGE MA

GRAVESTONE/MONUMENT CONSERVATION REPORTS

AUGUST 2021

PREPARED FOR TOWN OF STURBRIDGE

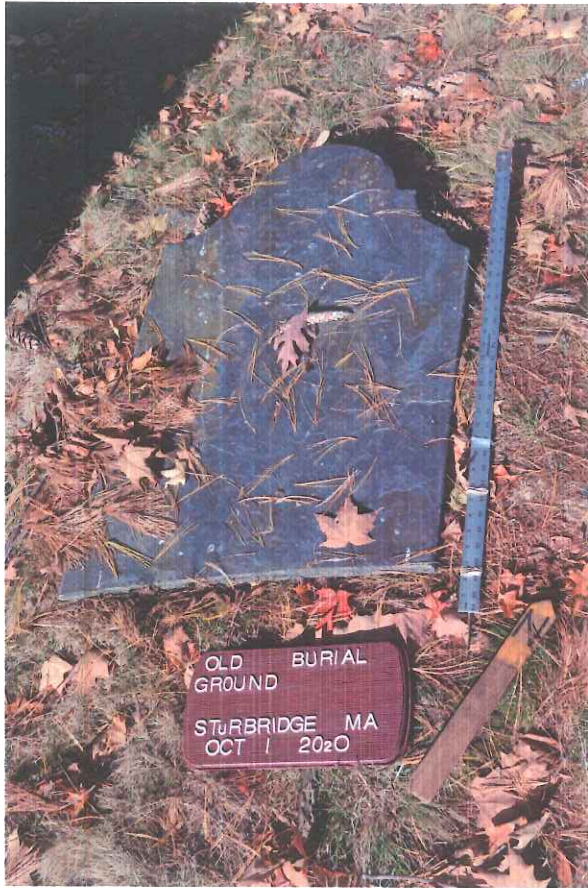

BEFORE

**MR. SILAS PLIMPTON/
INFANT BABE**
SILAS - d. Dec. 25, 1812
BABE - d. Feb. 23.1813



AFTER

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
1•2	PLIMPTON	HANNAH L.	JULY 30, 1878	HEAD	MARBLE/ SANDSTONE	TILTED/ ADDED TO PROJECT 2013/ 2014	EXCAVATE. CLEAN. RESET.	2014
1•5	PLIMPTON	OLIVER L.	APR. 17, 1838	HEAD	MARBLE		CLEAN,RESET	1997
1•6	PLIMPTON	CORDELIA M.	JAN. 6,1860	HEAD	MARBLE		CLEAN,RESET LEVEL IN BASE	1997
1•6	PLIMPTON	CORDELIA M.	JAN. 6,1860	FOOT	MARBLE		CLEAN,EXCAVATE FOR BASE FRAG.,AD REP,RESET,INFILL	1997
1•8	SHAW	OLIVER M.	APR. 20, 1795	HEAD	SCHIST		EXTRACT FROM TREE AND WALL,CLEAN,RESET	2004
2•2	SHUMWAY	SAMUEL	OCT. 2,1842	HEAD	MARBLE		CLEAN,RESET LEVEL IN BASE	1997
2•3	SHUMWAY	MARY	APR. 19, 1821	FOOT	MARBLE		CLEAN,REMOVE OLD CONCRETE RESET	2004
2•4	LYON	ABNER M.	JAN. 31,1828	HEAD	MARBLE		CLEAN,RESET	1997
2•4	LYON	ABNER M.	JAN. 31,1828	FOOT	MARBLE	FALLEN/ADDED TO PROJECT 2013/4	CLEAN,RESET CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE.	2004 2014
2•5	LYON	BETSEY/ MARIAN	DEC. 24,1802 DEC. 25,1802	HEAD	SLATE		CLEAN,AD REP,RESET,INFILL	1997
3•1	CUTTING	EBENEZER/ ELIZABETH	MAR. 20,1825 JULY 14,1841	HEAD	MARBLE		CLEAN,RESET LEVEL IN BASE	1997

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
3•7	SMITH	ABIJAH	JUNE 12,1790	HEAD	SLATE		CLEAN,RESET	1997
3•10	HOBBS	MARYANN	OCT. 12, 1820	HEAD	SLATE		CLEAN,RESET	2000
3•12	HOBBS	JOSIAH	APR. 25,1845	HEAD	MARBLE	S.W. CONE, WARE FOUND BROKEN 2013	CLEAN,RESET BASE & BASE FRAG.,AD REP,INFILL CLEAN. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL.	1997 2013
3•13	UPHAM	THOMAS	1822-1831	MON	SANDSTONE	CARVER: H. NEWELL	DISASSEMBLE,NEW SAND AND PEASTONE FOUNDATION, CLEAN,REASSEMBLE,BACKFILL CLEAN. FRAGMENT RE-ATTACHMENT. INFILL.	2004 2020
4•3	DUNTEN	LOVICE	FEB. 10,1786	HEAD	SANDSTONE	EZRA STEBBINS, LONGMEADOW SHOP	CLEAN,RESET	1997
4•15	H.	D.	N/A	HEAD	FIELDSTONE		CLEAN,RESET	1997
5•1	DUNTEN	MR. JOHN	SEPT. 11, 1841	HEAD	SLATE	IMPACTED BY ROOTS	EXCAVATE. EXTRACT FROM ROOTS. CLEAN. RESET.	2021
6•1	PLIMPTON	MRS. ESTHER	SEPT. 16, 1812	HEAD	SLATE	IMPACTED BY ROOTS	EXCAVATE. EXTRACT FROM ROOTS. CLEAN. RESET.	2021
6•4	PLIMPTON	MR. SILAS INFANT BABE	DEC. 25, 1812 FEB. 23, 1813	HEAD	SLATE	PROBABLY FELLED BY TREE BRANCH	NEW BASE REQUIRED. SET BASE. CLEAN STONE. MORTAR INTO BASE.	2021

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
6•8	DUNTON	SALLY	OCT. 14,1857	HEAD	MARBLE		CLEAN,NEW BASE,MORTAR INTO BASE	1997
6•9	GEROULD	AMANDA	FEB. 24,1885	HEAD	MARBLE		CLEAN,RESET BASE,MORTAR INTO BASE	1997
6•11	GOODELL	MR. BENJAMIN	FEB. 19,1801	HEAD	MARBLE		CLEAN,AD REP,RESET	1997
6•14	STACY	RHODA	JUNE 27,1844	HEAD	MARBLE		CLEAN,NEW BASE,PIN,INFILL	1997
6•15	BLOOD	MARTHA SARAH/ OTIS H.	MAR. 25,1839 MAR. 14,1832	HEAD	MARBLE		CLEAN,RESET	1997
6•16	BOND	WM. CYRUS	SEPT. 25,1826	HEAD	MARBLE		CLEAN,RESET	1997
7•1	PLIMPTON	CYLENDA	MAR. 6,1807	HEAD	SLATE		CLEAN,RESET	1999
7•5	PLIMPTON	MARY	SEPT. 9,1841	HEAD	SLATE		CLEAN,NEW BASE,MORTAR INTO BASE	1997

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
7•8	PLIMPTON	HARRIET	SEPT. 5,1842	HEAD	SLATE		CLEAN,AD REP,NEW BASE, MORTAR INTO BASE 2008: FOUND FALLEN. CLEAN. "BACKER," AD REP. INFILL	1998 2008
						FOUND BROKEN-2018	EXCAVATE OLD BASE, FORM AND POUR NEW BASE AND SET IN GROUND. NEW 16"X18" SLATE "BACKER" ADDED TO SUPPORT STONE, MORTAR STRENGTHENED STONE INTO BASE, INFILL.	2019
7•9	SMITH	MARCUS	NOV. 16,1854	HEAD	MARBLE		CLEAN,PIN,AD REP,RESET BASE,MORTAR INTO BASE,INFILL	1998
7•11	ALLEN	MRS. MERCY	JULY 8, 1802	HEAD	SLATE	TILTED/ ADDED TO PROJECT 2019	EXCAVATE. REMOVE CONCRETE COLLAR. CLEAN. RESET.	2020
7•13	GIBBS	MRS. LUCINDA	JULY 12,1843	HEAD	MARBLE		CLEAN,RESET,REMOVE OLD REPAIR,AD REP,INFILL 2008: DRILLED & PINNED	1998 2008
7•14	STEDMAN	DANIEL T.	AUG. 29,1822	HEAD	SLATE	TILTED/ADDED TO PROJECT 2013/2014	CLEAN,RESET CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE.	1998 2014
7•15	WHEELOCK	HIRAM	SEPT. 11,1822	HEAD	SLATE		CLEAN,RESET	1998

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
7•16	WHEELLOCK	HENRY ELI	APR. 6,1827	HEAD	SLATE		CLEAN,RESET EXCAVATE. CLEAN. RESET.	1998 2020
7•17	WHEELLOCK	JULAYAN	SEPT. 25,1804	HEAD	SLATE		CLEAN,RESET 2008: AGAIN CLEANED AND RESET	1998 2008
7•18	BOYD	JULIAN	OCT. 8,1818	HEAD	SLATE		CLEAN,RESET,CAP	1998
8•1	PLIMPTON	LIEUT. JOHN	AUG. 20,1817	HEAD	MARBLE/ SANDSTONE		CLEAN,RESET	1998
8•7	TURNER	MRS. AME	MAY 8, 1807	HEAD	SLATE		REMOVE IRON BOLTS, CLEAN, NEW BASE,MORTAR INTO BASE	2000
8•10	ALLEN	MRS.EXPERIENCE	MAR. 22,1836	HEAD	SLATE		CLEAN,RESET	1998
8•12	ALLEN	ADALINE A.	MAY 5,1894	HEAD	MARBLE/ SANDSTONE		CLEAN,RESET	1998
9•11	TARBELL	SUSANAH	MAY 1,1839	HEAD	SLATE		CLEAN,NEW BASE,MORTAR INTO BASE	1998
9•12	MARSH	MR. SILAS	JUNE 3,1836	HEAD	SLATE		CLEAN,RESET	1998
9•13	MARSH	DELIVERANCE FISKE	1842	MON	GRANITE	"BARRE GUILD"	CLEAN	2000

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
9•15	BELKNAP	DELIVERANCE FISKE	DEC. 31,1877	HEAD	MARBLE		CLEAN,REMOVE OLD REPAIR, NEW BASE,MORTAR INTO BASE CLEAN	1998 2000
9•16	BELKNAP	PANUEL	MAR. 5, 1847	HEAD	MARBLE	TILTED/ADDED TO PROJECT 2013/2014	EXCAVATE. CLEAN. RESET.	2014
9•19	BELKNAP	LYNDON F.	DEC. 9,1834	HEAD	SLATE		CLEAN,RESET	1998
9•21	CROSSETT	MR. DAVID	NOV. 17,1804	HEAD	SLATE		EXTRACT FROM TREE ROOTS. CLEAN. RESET. CLEAN. AD REP. NEW BASE. MORTAR INTO BASE. INFILL.	1998 1999
10•1	BRACKETT	MR. AARON	MAY 4, 1833	HEAD	SLATE	TILTED/ADDED TO PROJECT 2013/2014	EXCAVATE. CLEAN. RESET.	2014
10•4	HOWARD	MRS. SIBBELL	JULY 13,1800	HEAD	SLATE		CLEAN,RESET,AD REP	1998
11•4	HOBBS	MRS. LUCY	AUG. 9,1812	HEAD	SLATE		EXTRACT FROM TREE ROOTS, CLEAN,RESET	1999
11•5	HOBBS	MR. SAMUEL	MAY 11,1823	HEAD	SLATE		EXTRACT FROM TREE ROOTS, CLEAN,AD REP,RESET	1999
11•6	HOBBS	MR. CHARLES	MAR. 17,1813	HEAD	SLATE		CLEAN,RESET	1999
11•7	HOBBS	ELECTA	AUG. 19,1869	HEAD	MARBLE		CLEAN,RESET	1998

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
11•9	ALLEN	SAYBEL	JAN. 30,1768	HEAD	SLATE		CLEAN,RESET	1998
12•7	BABBIT	MOSES, 2nd	APR. 12,1773	HEAD	SLATE		CLEAN,RESET	1998
12•8	BABBIT	MOSES	NOV. 29,1767	HEAD	SLATE		CLEAN,RESET	1998
12•9	RIMINGTON	LUCRETIA	NOV. 1758	HEAD	SLATE		CLEAN,RESET	1998
12•11	NICHOLS	MR. EDMUND, JR	OCT. 19,1820	HEAD	SLATE		CLEAN,RESET	1998
12•12	NICHOLS	MR. JOSHUA/ MRS. TAMAR	JAN. 30,1823 JULY 22,1836	HEAD	MARBLE		CLEAN,RESET,PIN,AD REP, INFILL	1998
12•13	NICHOLS	MR. EDMUND/ MRS.ELIZABETH	JULY 2,1818 JAN. 5,1831	DOUBLE HEAD	SLATE		CLEAN,RESET	1998
13•1	CHENEY	(COL) THOMAS	APR. 30,1777	HEAD	SCHIST		CLEAN,AD REP,INFILL	1998
13•2	CHEANEY	MRS. SARAH	FEB. 1,1798	HEAD	SCHIST	FREDRICK MANNING, WINDHAM, CT	CLEAN	1998
14•2	WATKINS	LIEUT. GEORGE	FEB. 28,1773	HEAD	SLATE	H.C. GEYER	CLEAN,NEW BASE,MORTAR INTO BASE	1998
14•4	FAULKNER	LIEUT. DANIEL	OCT. 2,1805	HEAD	SLATE		CLEAN,RESET	1998
14•5	FAULKNER	MRS. SARAH	OCT. 3,1821	HEAD	SLATE		CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE.	1998

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
14•6	ALLEN	CAPT. ELISHA/ CAROLINE	JAN. 30,1818 JAN. 12,1810	HEAD	SLATE	SAM. OR CALEB CHAPIN, BERNARDSTON, MA	CLEAN,RESET	1998
14•7	ALLEN	MRS. CYLENDIA	SEPT. 27, 1830	HEAD	SLATE	TILTED	EXCAVATE. CLEAN. RESET.	1998
14•8	ALLEN	DOCT. OREN	JAN. 31,1814	HEAD	SLATE		CLEAN,RESET	1998
14•10	WHEELLOCK	MISS PRESCILA	DEC. 25,1797	HEAD	BROWNSTONE	FREDRICK MANNING, WINDHAM, CT	CLEAN,RESET	1998
15•8	BOND	LIEUT.NATHANIEL JR.	MAY 14,1771	HEAD	SLATE	H.C. GEYER PROBABLY FELLED BY TREE BRANCH	CLEAN,REMOVE OLD REPAIR, RESET,AD REP CLEAN. REMOVE OLD REPAIR. RESET. AD REP.	1998 2021
15•12	LUMBARD	MRS. LOIS	MARCH 2, 1832	HEAD	SLATE	TILTED	EXCAVATE. CLEAN. RESET.	2013
15•14	DENESON	MR. JAMES	MAY 22,1785	HEAD	RED SANDSTONE	EZRA STEBBINS, II	CLEAN	1998
15•15	DENESON	MRS.EXPERIENCE	MAR. 17,1780	HEAD	RED SANDSTONE	EZRA STEBBINS, II	CLEAN,RESET	1998
15•17	MORS	MR. SAMUEL(?)	APRIL 27, 1807	HEAD	SLATE	TILTED/ ADDED TO PROJECT 2020	CLEAN. INFILL.	2020

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
16•6	WIGHT	RADDAI	JAN. 28,1786	HEAD	SLATE		CLEAN,REMOVE OLD REPAIR, AD REP,RESET,INFILL	1998
16•6	WIGHT	RADDAI	JAN. 28,1786	FOOT	SLATE		CLEAN,NEW CONCRETE BASE, MORTAR INTO BASE	2004
16•7	WIGHT	FAMILY VAULT	1813-1829	VAULT	MARBLE/SLATE BRICK		PARTIALLY DISASSEMBLE OLD BRICK,REBUILD,PARGE, CLEAN MARBLE,PIN TO TOMB FACE WITH STAINLESS STEEL PINS	2004
16•13A	M	A	N/A	HEAD	SCHIST		CLEAN,RESET IN TEMPORARY LOCATION	2000
16•13B	ROBBINS	BENONI	1750	HEAD	SCHIST		CLEAN,RESET IN TEMPORARY LOCATION	2000
16•14	MASEN	MR. NOAH	MAY 2, 1753	HEAD	SLATE	TILTED	EXCAVATE. CLEAN. RESET.	2013
16•21	BATCHELLER	ORREN D./ LUCY	JUNE 17,1833 OCT. 29,1814	HEAD	MARBLE		CLEAN,RESET	1998
16-TRE	A.M	N/A	N/A	FOOT	SCHIST		FIND PROPER LOCATION. CLEAN. RESET. 2008: MISSING	
17•1	NEWELL	SUBMIT	JUNE 13, 1771	HEAD	SLATE	TILTED	EXCAVATE. CLEAN. RESET.	2021

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
17•3	REYNOLDS	MRS. REBEKAH	SEPT. 13,1819	FOOT	MARBLE		CLEAN,AD REP,RESET CLEAN,DRILL AND PIN VANDALISM? CLEAN,RE-PIN, RESET	1998 2001 2002
17•7	NEWELL	HON. TIMOTHY, ESQ.	FEB. 5,1819	HEAD	MARBLE		RESET BASE,CLEAN,AD REP, MORTAR INTO BASE,INFILL	1999
17•9	MASON	MR. JONATHAN	OCT. 29,1773	HEAD	SLATE		CLEAN,RESET,AD REP	1998
17•10	N/A	N/A	N/A	HEAD FRAG	SCHIST		INVESTIGATE FOR BOTTOM FRAGMENT. 2008: NO OTHER FRAGMENTS FOUND	2008
17•11	MORSE	MR. DAVID/ MRS. HANNAH	AUG. 7,1821 JULY 18,1832	HEAD	MARBLE		CLEAN,NEW BASE,SET BASE, MORTAR INTO BASE	1999
17•18a	CLARK	NATHAN	MAR. 27,1792	FOOT	RED SANDSTONE		CLEAN,RESET	1998
17•21	CURTIS	MR. SILVANUS	JUNE 23,1800	HEAD	SCHIST	FREDRICK MANNING, WINDHAM, CT	CLEAN,NEW BASE,MORTAR INTO BASE	1998
17•22	CURTIS	MRS. SUSANAH	AUG. 9,1798	HEAD	SCHIST		CLEAN,RESET	1999
17•22A	CURTIS	MRS. SUSANAH	AUG. 9,1798	FOOT	SCHIST		CLEAN,NEW BASE,MORTAR INTO BASE	1999
17•24	CURTIS	MARY	AUG. 10,1795	HEAD	SCHIST	MANNING	CLEAN,RESET	1999
17•25	CURTIS	MRS. MARY	OCT. 7,1796	HEAD	SCHIST		CLEAN	1999

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
18•2	LANE	MRS. ABIGAIL PARTRIDGE	MAR. 15, 1803	HEAD	SLATE		EXCAVATE. REMOVE PREVIOUS REPAIRS. NEW IN-GROUND BASE. CLEAN. MORTAR INTO BASE. AD REP. INFILL.	2008
18•4	LANE	MRS. ELIZABETH	FEB. 7, 1844	HEAD	MARBLE		REMOVE FROM BASE, CLEAN STONE AND BASE, RESET BASE, MORTAR STONE INTO BASE	1999
18•5	FREEMAN	MR. SAMUEL, JR.	SEPT. 26, 1772	HEAD	SLATE		CLEAN, RESET	1999
18•6	FREEMAN	MRS. ELIZABETH	AUG. 30, 1772	HEAD	SLATE	HENRY C. GEYER	CLEAN, NEW BASE, MORTAR INTO BASE	1999
19•3	FREEMAN	CAPT. COMFORT	DEC. 1, 1806	HEAD	SLATE		CLEAN, RESET	1999
19•4	FREEMAN	LT. SAMUEL	DEC. 31, 1772	HEAD	SLATE	HENRY C. GEYER	CLEAN, RESET	1999
19•5A	ATWOOD	POLLY	JAN. 14, 1822	FOOT	SLATE		CLEAN, NEW BASE, MORTAR INTO BASE	1999
19•8	PHILLIPS	DEA. JONATHAN	JUNE 25, 1798	HEAD	SLATE		CLEAN, CAP	2000
19•9	PHILLIPS	HANNAH	SEPT. 1, 1767	HEAD	SLATE		EXCAVATE. CUT OFF AT MAJOR TREE ROOT. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. LANDSCAPE.	2016
19•10	PHILLIPS	JONATHAN	SEPT. 8, 1767	HEAD	SLATE		REMOVED FROM TREE ROOTS. CLEAN. RESET.	2016

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
19•11	PHILLIPS	DANIEL	JUNE 26,1775	HEAD	SLATE		CLEAN,AD REP,RESET NEW SLOTTED BASE. SET BASE. MORTAR INTO BASE.	1999 2008
19•12	PHILLIPS	DANIEL	JAN. 31, 1796	HEAD	SLATE	TILTED/ IMPACTED BY TREE ROOTS	EXCAVATE. CLEAN. RESET.	2014
19•17	WELD	JOHN	DEC. 30,1857	HEAD	MARBLE		CLEAN,RESET	1999
19•18	MASON	JOSHUA/ CHLOE	JULY 26, 1846 JULY 18, 1830	HEAD	MARBLE/ SANDSTONE		CLEAN,RESET	2001
19•20	CURTIS	MRS. LUCY	NOV. 5, 1860	HEAD	MARBLE		REMOVE IRON STRAPS, CLEAN,DRILL & PIN,INFILL	2000
19•21	CURTIS	SILVANUS	AUG. 14, 1828	HEAD	SLATE	ADDED TO PROJECT 2008	EXCAVATE. CLEAN. NEW BASE. MORTAR INTO BASE	2008
20•7	ALLEN	SUSANNAH	AUG. 15,1853	HEAD	MARBLE		CLEAN,NEW BASE,MORTAR INTO BASE	1999
20•13	FOSTER	SARAH/ INFANT	JULY 22, 1799 MAY 8, 1796	HEAD	SLATE		CLEAN,RESET	2001
20•14	UPHAM	MR. NATHANIEL	MAY 10, 1826	HEAD	SLATE		EXCAVATE. REMOVE PREVIOUS REPAIRS. CLEAN. DOUBLE AD REP. INFILL	2008
20•24	SEARLE	AGUSTA	JULY 23,1798	HEAD	SCHIST		CLEAN,RESET	1999

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
20•27	STREETER	MISS KEZIA	AUG. 19,1796	HEAD	SCHIST		CLEAN,CAP	1999
21•5	WELD	LT. AARON	JULY 18,1794	HEAD	RED SANDSTONE		CLEAN,AD REP,INFILL DRILL AND PIN MIDDLE FRAGMENT TO BOTTOM. PIN TWO TOP FRAGMENTS TO MIDDLE. ATTACH SLATE BACKER. PIN BACKER TO STONE. INFILL OF LOSS AREAS WITH SPECIALLY COLORED JAHN MORTAR. INSERT BACKER RODS AND INFILL. INFILL REPAIR SEAMS. CONSOLIDATION OF SANDSTONE.	1999 2016
21•7	JOHNSON	TIMOTHY	UNKNOWN	HEAD	SLATE		CLEAN,NEW BASE,MORTAR INTO BASE,CAP	1999
21•12	JOHNSON	MRS. HANNAH	AUG. 29,1814	HEAD	SLATE		CLEAN,NEW BASE,MORTAR INTO BASE	1999
21•13	JOHNSON	JAMES, JR	SEPT. 26,1776	HEAD	SLATE		CLEAN,RESET VANDALISM. CLEAN,RESET	1999 2002
21•14	JOHNSON	ISAAC	SEPT. 4,1775	HEAD	SLATE		CLEAN,AD REP,RESET	1999
21•15	JOHNSON	SUSANNA	SEPT. 12,1775	HEAD	SLATE		CLEAN,NEW BASE,MORTAR INTO BASE	1999
21•16	JOHNSON	LYDIA	SEPT. 3,1776	HEAD	SLATE		CLEAN,RESET	1999

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
21•20	MASON	THANKFUL	JUNE 9, 1801	HEAD	SANDSTONE		CLEAN	2000
21•21	JOHNSON	JAMES	MAR. 27, 1862	HEAD	MARBLE		CLEAN,NEW BASE, MORTAR INTO BASE	2000
22•4	CHILD	ABIGAIL	NOV. 10,1745	HEAD	SCHIST		CLEAN	1999
22•5	CHILD	MEHETABEL	SEPT 28,1747	HEAD	SCHIST		CLEAN	1999
22•6	CHILD	ANNA	OCT. 5,1747	HEAD	SCHIST		CLEAN	1999
22•7	CHILD	CALEB	OCT. 16,1747	HEAD	SCHIST		CLEAN	1999
(22•8)	ROBBINS	BENONI	1750	FOOT?	SCHIST		FIND PROPER LOCATION. CLEAN. RESET 2008: MISSING	2008
22•11	WELD	MISS DEBORAH	NOV. 20,1795	HEAD	SLATE		CLEAN,RESET	1999
22•15	JOHNSON	MR. DANFORD	_____ 1,1795	HEAD	SLATE	FOUND BROKEN IN 2013	CLEAN,REMOVE OLD REPAIR, RESET,AD REP,INFILL CLEAN. AD REP. INFILL.	1999 2013
22•16	JOHNSON	MRS. EUNICE	MARCH 11, 1810	HEAD	SLATE	BROKEN (BASE IN GROUND)	EXCAVATE BASE. NEW BASE. CLEAN. SET BASE. MORTAR INTO BASE.	2013
23•1	DRAPER	JACOB	MAY 18, 1848	HEAD	SLATE	ADDED TO PROJECT 2008	EXCAVATE. REMOVE PAINT. CLEAN. NEW BASE MORTAR INTO BASE	2008

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
23•4	DRAPER	OLIVE	AUG. 27,1834	HEAD	SLATE		CLEAN,RESET	1999
23•8	HC + EC	N/A	N/A	HEAD	FIELDSTONE		CLEAN	1999
23•9	D.	R.	N/A	HEAD	FIELDSTONE		CLEAN,CAP	1999
23•11	UPHAM	CAPT. EZEKIEL	APRIL 21, 1783	HEAD	SLATE	DELAMINATING/ ADDED TO PROJECT	CLEAN. CAP.	2020
24•1	PROUTY	MRS. ELIJAH	OCT. 2?,1841(?)	HEAD	MARBLE		CLEAN,RESET	2000
24•2	PROUTY	LOUISA	JUNE 6, 1883	HEAD	MARBLE	M. D. MORRILL, SO'BRIDGE	NEW BASE,REMOVE OLD REPAIRS,MORTAR BASE FRAGMENT INTO NEW BASE, DRILL & PIN TOP THREE FRAGMENTS, INFILL	2002
24•3	FISKE	CAPT. SIMEON	FEB. 28, 1840	HEAD	MARBLE		EXCAVATE BASE FRAGMENT, CLEAN,NEW BASE,SET BASE, MORTAR INTO BASE	2001
24•4	FISKE	LYDIA	APR. 18, 1830	HEAD	MARBLE		CLEAN	2000
24•5	FISK	MRS. MARY	SEPT. 10, 1813	HEAD	SLATE		CLEAN	2000
24•6	FISKE	SUBMIT	FEB. 14, 1781	HEAD	SLATE		CLEAN	2000

**OLD BURIAL GROUND
STURBRIDGE, MA**

**FANNIN•LEHNER
CONSERVATION LIST**

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
24•10	A	M	N/A	HEAD	FIELDSTONE		CLEAN,CAP	2000
24•11	TAYLOR	SALINA	DEC. 30, 1817	HEAD	SLAE	ADDED TO PROJECT 2008	EXCAVATE. CLEAN. RESET	2008
24•13	TAYLOR	MRS. BETSY P.	JAN. 20, 1842	HEAD	SLATE	ADDED TO	EXCAVATE. CLEAN STONE AND BASE. RESET BASE. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL	2008
24•18	CHILD	MRS. LOIS	MAY 1, 1821	HEAD	MARBLE		CLEAN,NEW BASE,DRILL AND PIN,MORTAR INTO BASE, INFILL	2001
25•1	B	M	N/A	HEAD	FIELDSTONE		CLEAN	2000
25•2	B	A	SEPT. 17(?)3	HEAD	FIELDSTONE		CLEAN,RESET	2000
25•3	FISK	ANNA	AUG. 1746	HEAD	SLATE		CLEAN	2000
25•4	FISK	MRS. DELIVERANCE	JULY 1758	HEAD	SLATE		CLEAN	2000
25•5	FISK	NATHAN	AUG. 1756	HEAD	SLATE		CLEAN	2000
25•6	FISK	DEA. DANIEL	MARCH 1778	HEAD	SLATE		CLEAN	2000
25•7	BACON	MRS. LOIS	OCT. 21, 1797	HEAD	SLATE		CLEAN	2000
25•8	GREEN	MRS. JEMIMA	JULY 2, 1810	HEAD	SLATE		CLEAN	2000
25•9	FAY	CALEB	SEPT. 16, 1777	HEAD	SLATE		CLEAN	2000

**OLD BURIAL GROUND
STURBRIDGE, MA**

**FANNIN•LEHNER
CONSERVATION LIST**

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
25•10	FIK	ARMILLE/ MOSES/ ICHABOD	FEB. 22, 1779 MAR. 15, 1777 AUG. 14, 1779	HEAD	SLATE		CLEAN	2000
25•11	UPHAM	MR. ISAAC/ MRS. HEPZIBAH	MAR. 18, ???? JAN. ??, 1808	DOUBLE HEAD	SLATE		CLEAN, RESET, REMOVE OLD REPAIRS, AD REP, INFILL	2000
26•1	FIK	DANIEL	JAN. 1740	HEAD	SLATE		CLEAN	2000
26•2	FIK	HENRY	NOV. 1740	HEAD	SLATE		CLEAN	2000
26•3	FIK	ARMILLA	SEPT. 1754	HEAD	SLATE		CLEAN	2000
26•4	FIK	SAMUEL	SEPT. 1754	HEAD	SLATE		CLEAN	2000
26•5	FIK	THOMAS	SEPT. 1744	HEAD	SLATE		CLEAN	2000
26•6	FIK	RUTH	SEPT. 1754	HEAD	SLATE		CLEAN	2000
26•7	FIK	LIEUT. HENRY/ MRS. MARY	MAR. 1, 1790 JUNE 2, 1805	HEAD	SLATE		CLEAN	2000
26•8	FIK FIK	DEA. HENRY/ SARAH	DEC. 10, 1815 DEC. 11, 1815	HEAD	SLATE		CLEAN	2000
26•10	HAMANT	DEA. JOB MRS. JEMIMA	AUG. 16, 1810 FEB. 11, 1795	HEAD	SLATE	TILTED/BROKEN	EXCAVATE. CLEAN. RESET. RE-ATTACH FRAGMENT. INFILL.	2013
26•15	UPHAM	DAMARIS	NOV. 4, 1795	HEAD	SLATE		CLEAN, RESET	2001
26•16	UPHAM	RUTH P.	JAN. 18, 1812	HEAD	SLATE		CLEAN, RESET	2001

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
26•17	UPHAM	MR. JESSE, JR.	DEC. 7, 1835	HEAD	MARBLE		EXCAVATE. CLEAN. RESET.	2014
27•1	FIK	DAVID ESQ.	AUG. 19, 1817	HEAD	MARBLE		CLEAN,RESET	2001
27•2	FISKE	FAMILY	1812-1875	HEAD	MARBLE		CLEAN,RESET	2001
27•3	BAKER	MARA	JULY 16, 1745	HEAD	FIELDSTONE		CLEAN	2001
27•8	BAKER	DEACON JOSEPH	DEC. 6, 1783	HEAD	SANDSTONE		BROKEN. REMOVE PREVIOUS REPAIR. CLEAN. DRILL AND PIN. INFILL.	2013
28•2	HAMANT	ICHABOD	DEC. 24, 1763	HEAD	FIELDSTONE		CLEAN,RESET	2000
28•3	HAMANT	MISS KEZIA	SEPT. 22, 1781	HEAD	RED SANDSTONE	STEBBINS SHOP	REMOVE OLD REPAIR,CLEAN, RESET,DRILL & PIN,AD REP, INFILL	2001
28•4	HAMANT	JOHN	SEPT. 21, 1787	HEAD	RED SANDSTONE		REMOVE OLD REPAIR,CLEAN, RESET,DRILL & PIN,AD REP, INFILL	2001
28•5	HAMANT	MR. SAMUEL	APR. 22, 1790	HEAD	RED SANDSTONE	ADDED TO PROJECT 2007	CLEAN. REMOVE PREVIOUS REPAIR. DRILL & PIN TOP TO BOTTOM FRAGMENT. INFILL	2008
28•8	HAMANT	MR. PETER	DEC. 17, 1803	HEAD	SLATE		CLEAN,REMOVE OLD REPAIR, AD REP,INFILL	2000
28•9	CHENEY	CAP'T JOSEPH	OCT. 3, 1779	FOOT	SCHIST		CLEAN,REVERSE DIRECTION, RESET	2001

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
28•11	HAMANT	MR. JOB	NOV. 22, 1836	HEAD	SLATE		REMOVE TREE,CLEAN,RESET	2001
28•12	HAMANT	MISS LUCY	SEPT. 2, 1830	HEAD	SLATE		CLEAN,RESET	2001
28•13	CHAPIN	PRUDENCE M.	JULY 27, 1823	HEAD	SLATE		CLEAN,RESET	2000
28•15	CHAPIN	MR. LORING	JUNE 15, 1823	HEAD	SLATE	SAM OR CALEB CHAPIN, BERNARDSTON, MA	CLEAN,RESET	2000
28•17	CHAPIN	JOSEPHINE LLOYD	MAY 7, 1856	HEAD	MARBLE		CLEAN. RESET BASE. MORTAR INTO BASE.	2000
28•17	CHAPIN	JOSEPHINE LLOYD	MAY 7, 1856	FOOT	MARBLE		CLEAN,AD REP,RESET,INFILL VANDALISM. CLEAN,RESET	2000 2002
28•18	CHAPIN	JOSEPH LLOYD	NOV. 16, 1855	FOOT	MARBLE		CLEAN,RESET FACING EAST VANDALISM. CLEAN,RESET	2000 2002
29•2	BAKER	ELISABETH	NOV. 13, 1790	HEAD	RED SANDSTONE	EZRA STEBBINS II	CLEAN,RESET	2001
29•5	WALKER	OBED	MAY 9, 1850	HEAD	MARBLE/ SANDSTONE		CLEAN. RESET BASE & STONE	2008
29•7	ALLEN	LORENZO	AUG. 3, 1823	HEAD	SLATE		CLEAN,RESET	2000
29•11	LUMBARD	SARAH	DEC. 14, 1839	HEAD	SLATE		CLEAN,NEW BASE,SET BASE, MORTAR INTO BASE	2002

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
29•18	WHITTEMORE	MRS. CHARLOTTE	NOV.13, 1835	HEAD	SLATE	BROKEN	EXCAVATE. CLEAN. RESET BOTTOM FRAGMENT. ADREP. INFILL. CAP.	2014
30•1	RICE	MRS. RHODA	JAN. 22, 1749	HEAD	RED SANDSTONE	THOMAS JOHNSON II OR ASSOCIATE	CLEAN,RESET	2001
30•3	WHITTEMORE	DWIGHT T.	JUNE 21, 1864	HEAD	MARBLE/ SANDSTONE		CLEAN,RESET BASE AND STONE TOGETHER	2002
30•7	WHITTEMORE	AUSTIN	APR. 4, 1857	HEAD	MARBLE/ SANDSTONE		CLEAN,RESET BASE AND STONE TOGETHER	2002
31•1	NEWELL	JANE E.	FEB. 25, 1836	HEAD	MARBLE		INVESTIGATE. REMOVE OLD REPAIR. NEW BASE. SET BASE. MORTAR INTO BASE	2008
31•2	NEWELL	MR. STEPHEN	APR. 11, 1847	HEAD	MARBLE		CLEAN. RESET BASE. MORTAR INTO BASE.	
31•5A	NEWELL	WILLIAM W.	N/A	HEAD FRAG	MARBLE		PHOTOGRAPH. PLACE BEHIND #31•5 NO BASE FRAGMENT FOUND	IN PROC 2002 2008
31•6	NEWELL	ALMEDA	JUNE 5, 1836	HEAD	MARBLE	ADDED TO PROJECT 2007	EXCAVATE. CLEAN. NEW BASE. MORTAR INTO BASE	2008
31•7	HOLBROOK	MRS. PATIENCE	APRIL 12, 1811	HEAD	SLATE		CLEAN,RESET	2001
31•8	HOLBROOK	MR. AMARIAH	JULY 5, 1799	HEAD	SLATE		CLEAN,RESET	2001

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
31•11	HOLBROOK	MRS. LUCRETIA	OCT. 11, 1831	HEAD	SLATE	TILTED	EXCAVATE,CLEAN,RESET,CAP	2014
31•13	HEBARD	MRS. MARY	MAY 26, 1806	FOOT	SLATE		CLEAN,RESET BEHIND HEAD VANDALISM. CLEAN, RESET	2000 2002
31•15	HOLBROOK	SYLVESTER	FEB. 22, 1815	HEAD	SLATE		CLEAN, NEW BASE, SET BASE MORTAR INTO BASE	2002
32•8	WALKER	MRS. SUBMIT	NOV. 22, 1790	HEAD	SLATE		CLEAN,TACK,CAP	2002
33•1	HOOKER	MAJOR SAMUEL	1822	MON	MARBLE		DISASSEMBLE,CLEAN,SAND AND PEASTONE FOUNDATION, REASSEMBLE	2004
33•2	CARPENTER	MR. ELIJAH/ SAMUEL	MAY 12, 1808 MAY 14, 1813	HEAD	MARBLE		CLEAN,NEW MARBLE BASE, NEW CONCRETE FOUNDATION, MORTAR INTO BASE,AD REP, INFILL COMPLETE CLEANING OF STONE AND BASE	2004 2019
33•10	WILLARD	SETH	JULY 26, 1843	HEAD	MARBLE/ SANDSTONE		CLEAN,RESET STONE AND BASE	2004
33•12	WILLARD	SUSAN F.	1885	HEAD	MARBLE		ATTEMPT TO REMOVE CONCRETE PUDDLE-FAILED, CLEAN,RESET	2000
33•14	POND	MRS. POLLY	OCT. 12, 1826	HEAD	MARBLE		CLEAN,RESET BASE FRAGMENT DRILL AND PIN TOP FRAGMENT,INFILL	2004

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
33•17	BENSON	MRS. ZILLAH	JAN. 18, 1817	HEAD	SLATE		CLEAN,NEW BASE,MORTAR INTO BASE	2000
33•19	HOWARD	MR. ELEAZER	JUNE 3, 1808	HEAD	SLATE		INVESTIGATE. REMOVE OLD REPAIRS. CLEAN. NEW BASE. MORTAR INTO BASE. AD REP, INFILL	2008
34•3	WALKER	MISS BASMATH	JAN. 14, 1843	HEAD	MARBLE		REMOVE OLD REPAIR, CLEAN,RESET BASE FRAGMENT, DRILL & PIN,AD REP,INFILL	2002
34•5	WALKER	LOIS	MAY 17, 1812	HEAD	SLATE		REMOVE PREVIOUS REPAIR, CLEAN,RESET	2002
34•7	BELKNAP	CYNTHIA C.	APRIL 3, 1841	HEAD	MARBLE	TILTED/ IMPACTED BY TREE/ADDED TO PROJECT 2013/ 2014	EXCAVATE. CLEAN. RESET.	2014
34•10	BELKNAP	PLINEY	OCT. 15, 1805	HEAD	SLATE		CLEAN,RESET	2002
35•5	HEBARD	CYLENDA	JUNE 3, 1813	HEAD	SLATE		CLEAN,RESET	2002
35•6	HEBARD	MERIEL L.	DEC. 24, 1833	HEAD	MARBLE	STONE FOUND BROKEN 2008	CLEAN. RESET STONE & BASE. DRILL & PIN	2008
35•9	HEBARD	MRS. ELIZEBETH	MAY 4, 1825	HEAD	SLATE		CLEAN,RESET	2002

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u>	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
36•5	COPELAND	MRS. NABBY	MAR. 26, 1810	HEAD	MARBLE		REMOVE PREVIOUS REPAIR, CLEAN,NEW BASE,MORTAR INTO BASE,DRILL & PIN, AD REP,INFILL	2002
36•9	BULLARD	ABNER	MAR. 14, 1833	HEAD	SLATE	IMPACTED BY TREE	EXTRACT FROM TREE. CLEAN. RESET.	2015
37•2	NICHOLS	MR. CALEB	MAR. 17, 1813	HEAD	SLATE	ADDITIONAL FRAGMENT FOUND 2008	EXCAVATE,CLEAN,AD REP, NEW BASE,MORTAR INTO BASE,INFILL 2008: CLEAN STONE AND FRAGMENT. AD REP. INFILL	2002 2008
37•6	NICHOLS	CALEB	NOV. 17, 1843	HEAD	MARBLE		CLEAN. RESET.	2014
38•2	BOWEN	LT. WILLIAM	MAR. 9, 1813	HEAD	SLATE		REMOVE OLD REPAIR. CLEAN. RESET BASE FRAGMENT. AD REP, TACK,CAP	2008
39•1	CLARK	LUCY A.	MAY 15, 1891	MON	MARBLE	C. A. RISLEY CO.	EXCAVATE,DISASSEMBLE, CLEAN,RESET BASE, REASSEMBLE AND RE-PIN	2002
39•5	CLARK	ERASMUS	APR. 1, 1839?	HEAD	SLATE		REMOVE PAINT. CLEAN. RESET. (NO OTHER FRAGMENTS FOUND)	2008
40•1	SCOTT	DINAH	JULY 19, 1892	HEAD	MARBLE		EXCAVATE. CLEAN. RESET	2008
40•2	SCOTT	HORATIO F.	FEB. 1, 1907	HEAD	MARBLE/		CLEAN,RESET STONE AND BASE	2002

OLD BURIAL GROUND
STURBRIDGE, MA

FANNIN•LEHNER
CONSERVATION LIST

8/3/21

<u>ROW</u>	<u>LAST NAME</u>	<u>FIRST NAME</u>	<u>D. OF DEATH</u>	<u>TYPE</u>	<u>MATERIAL</u> SANDSTONE	<u>NOTES/CARVER</u>	<u>TREATMENT</u>	<u>YEAR</u>
------------	------------------	-------------------	--------------------	-------------	------------------------------	---------------------	------------------	-------------

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: Oct. 2, 2020

Name: Upham, Thomas (etc.)

Date of Death: 1822-1831

Marker Type: Monument Detail: _____

Stone Carver: H. Newell

Material: Sandstone Other: _____

Carved Surfaces: Front/Back

Motif: None Detail:

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Ref / Sec: 3-13

Orientation: W

No. of People Commemorated: 5

Dimensions: (In) W 14 (Shaft) H 79 1/2 (Total height) D 14 (Shaft)

Digital: Before Set: 2 Photo: DSC4-1193/4

Digital: After Set: 3 Photo: DSC4-0045/46/56

CONDITIONS

Sound: Yes

Broken: "Point" of top element

Tilted Details:

Previous Repair: Other

Detail: 2004: Monument completely disassembled. Base elements brought to level. Cleaned. 2020: Monument still level.

Chipped: Several corners of monument, proper left rear top edges top element

Cracked:

Biological Activity: Heavy lichen, algae, moss

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Erosion of back corner of base due to moss

Flaking: Detail:

Fragments: One: from top element

Losses: Proper left rear corner of capping element of shaft

NOTES:

Before Photo

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Upham, Thomas (etc.)

Date of Death: 1822-1831

Ref/Sec: 3-13

Conservation Notes: 10/2/2020- Refer to conservation notes of 2004. The monument is still completely level. 2) Entire monument thoroughly (but gently) scraped to remove at least part of an abundant coating of lichen. 3) Monument carefully brushed. 4) Monument treated with D2 Biological Solution to help loosen remaining lichen and lichen stains and hopefully retard future biological growth. The monument then scrubbed, then rinsed with water. These procedures repeated until the monument was as clean as possible. 5) The monument is in remarkably good condition with the exception of the proper left back corner of the base which has experienced significant deterioration due to presence of heavy moss. 10/3/2020- 6) Top element drilled to receive a 1/4" fiberglass rod. 7) Top element and fragment pinned, the repair strengthened by setting the rod in Akepox 2010 Stone Epoxy. 10/25/2020- 8) Infill around repaired top element using Limeworks St. Astier Lithomex Repair Mortar: "Dark Brown Sandstone."

After Photo:

Inscription:

After Photo:

Inscription:

EAST FACE

THOMAS UPHAM
Esq.
died Oct. 27, 1827
Aged 61
CLEMENTINA
daughter of
Thomas &
Mehitabel Upham
died Dec. 15, 1828
Aged 34.

NORTH FACE

To the
Memory of
GEORGE UPHAM
who died
March 10, 1822
in the 21st year
of his age.
The memory of
the just is blessed.


H. Newell

WEST FACE

Also to the
Memory of
TRENCH UPHAM
who died
at New-Orleans
Oct. 12th. 1822
in the 27th years
of his age.
Son of
Maj. THOMAS &
MEHITABEL
UPHAM.
"Be ye also ready"

SOUTH FACE

MEHITABEL
UPHAM
Relict of
Thomas Upham
Esq.
died Feb. 22. 1831

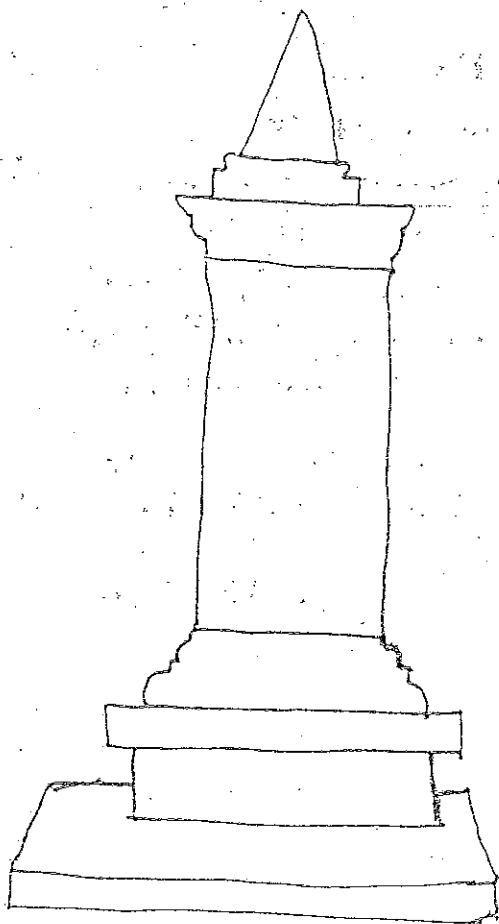

} 28" x 12" x 12"

3.5" x 15" x 15"

} 45" x 19.5" x 19.5"

} 27" x 14" x 14"


} 4.5" x 20" x 20"

2.5" x 22" x 22"

} 6.5" x 20" x 20"

} 7.5" x 40" x 40"

Total Height - 79.5"

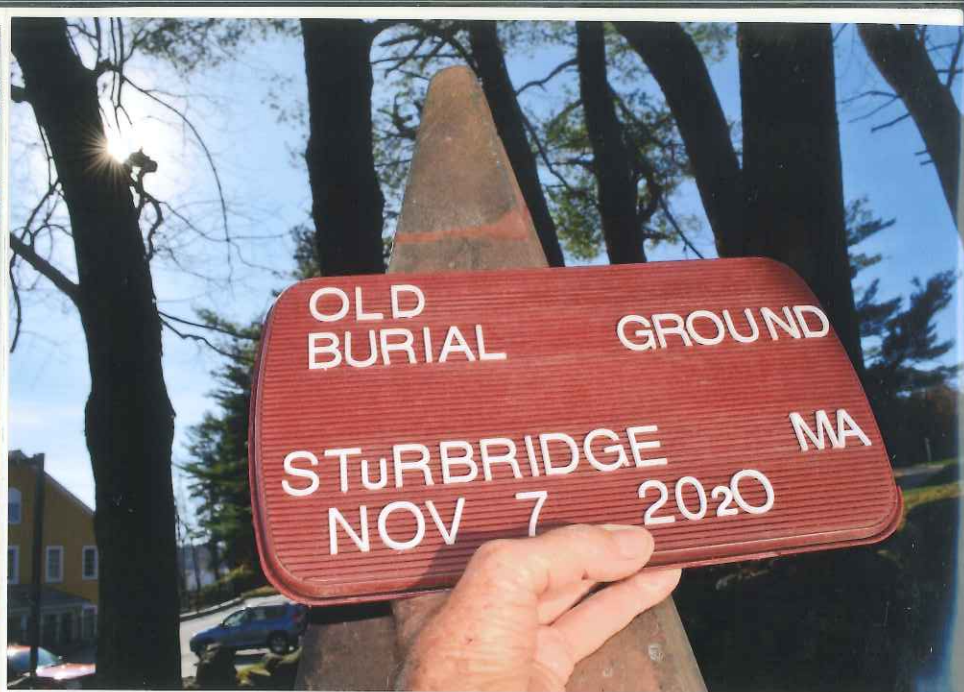

Fannin•Lehner
271 Lexington Road d. 1822-1831
Concord MA 01742 3-13
Old Burial Ground
Sturbridge MA Nov. 7, 2020 (Detail of repaired
"after" =
Set: 3 Photo: DSC4-0045 top element)

11-11-2020

Fannin•Lehner
271 Lexington Road
Concord MA 01742
Old Burial Ground
Sturbridge MA October 1, 2020 (top element)
Set: 2 Photo: DSC4-1194

Thomas Upham, etc.
d. 1822-1831
3-13
"before" =

11-11-2020

Fannin•Lehner
271 Lexington Road
Concord MA 01742
Old Burial Ground
Sturbridge MA October 1, 2020 "before" =
Set: 2 Photo: DSC4-1193

Thomas Upham, etc.
d. 1822-1831
3-13

11-11-2020

Fannin•Lehner
271 Lexington Road
Concord MA 01742
Old Burial Ground
Sturbridge MA Nov. 7, 2020 (Detail of partial south
side and repaired
top element)
Set: 3 Photo: DSC4-0046

Thomas Upham
d. 1822-1831
3-13 "after" =

11-11-2020

Fannin•Lehner
271 Lexington Road
Concord MA 01742
Old Burial Ground
Sturbridge MA Nov. 7, 2020
Set: 3 Photo: DSC4-0056

Thomas Upham
d. 1822-1831
3-13 "after" =

11-11-2020

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: July 20, 2021

Name: Dunten, Mr. John

Date of Death: Sept. 11, 1841

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Urn/Willow Detail: Inscription set within a columned entablature

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 5-1

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 24 H 38 D 1 1/2

Digital: Before Set: 1 Photo: DSC5-0093

Digital: After Set: 2 Photo: DSC5-0332

CONDITIONS

Sound:

Broken:

Tilted: Details: Backward and sunken

Previous Repair: None Evident

Detail:

Chipped: Slightly chipped along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES: Gripped tightly by a large tree root

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Dunten, Mr. John

Date of Death: Sept. 11, 1841

Ref/Sec: 5-1

Conservation Notes: 7/20/2020- 1) This large tilted, sunken headstone was excavated with much difficulty as it was tightly gripped by a large pine tree root. By digging out in back and some in the front, it was finally wrestled away from the tree. The stone, in fact, has a large tail and plenty of length to reset. Because of its large size, it was decided to raise and level the stone in the excavation. 2) Headstone reset higher, in back of the offending root, level and plumb, in well-compacted sand and peastone, facing east. 3) Headstone is hugely impacted with lichen and algae, especially on its rough-ridged back. A difficult cleaning proposition. 4) Stone thoroughly brushed and treated with D2 Biological Solution to lift lichen and algae and retard future biological growth. It was then scrubbed and rinsed with water. These procedures repeated. Face and bottom one third of back are now as clean as possible. 7/28/2021- 5) The rest of the headstone cleaned- the upper 2/3 of the back and all edges. It was then repeatedly treated with D2, then scrubbed and rinsed with water. 6) Area around headstone landscaped.

After Photo:



Inscription:

IN Memory of
MR. JOHN DUNTEN,
who died Sept. 11, 1811
in the 77 year
of his age.

Children, friends as you pass by,
As you are now, so once was I,
As I am now, so you must be
Prepare for death and follow me.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: July 19, 2021

Name: Plimpton, Mrs. Esther

Date of Death: Sept. 16, 1812

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Urn Detail: Draped urn

Border: Elaborate Detail: Ball-topped columns

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 6-3

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 21 H 34 D 1 3/4

Digital: Before Set: 1 Photo: DSC5-0094

Digital: After Set: 2 Photo: DSC5-0331/0333

CONDITIONS

Sound: Yes

Broken:

Tilted: Details: Severely forward by a large root

Previous Repair: None Evident

Detail:

Chipped: Slightly along edges

Cracked: Faint diagonal crack ending on tympanum

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological, some ferrous

Delamination: On face- some small delaminations, many more larger but thin delaminations below grade

Sugar Decay: Detail:

Flaking: Detail: Areas of delaminations

Fragments:

Losses:

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Plimpton, Mrs. Esther

Date of Death: Sept. 16, 1812

Ref/Sec: 6-3

Conservation Notes: 6/19/2020- 1) Tilting stone excavated with much difficulty due to large, impacting pine roots. When finally extracted, it was found to be intact with more than sufficient length to reset. 7/20/2021- 2) Headstone thoroughly brushed then treated with D2 Biological Solution. The stone was then scrubbed and rinsed. These procedures repeated until the stone was as clean as possible. The stone appears to have some sort of black staining/coating, much of which was removed- but some of the black staining remains. 3) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 4) Area landscaped around headstone. Note: Total length of stone out-of-ground: 62.”

After Photo:

Inscription:



Mrs. Esther, Relict
of
Mr. James Plimpton
died
16 Sep. 1812, AEt. 68.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: July 19, 2021

Name: Plimpton, Mr. Silas/ Infant Babe

Date of Death: SP: 12/25/1812 IB: 2/23/1813

Marker Type: Headstone Detail:

Stone Carver:

Material: Slate Other:

Carved Surfaces: Front

Motif: Urn Detail: Draped urn

Border: Elaborate Detail: Ball-topped columns

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 6-4

Orientation: W

No. of People Commemorated: 2

Dimensions: (In) W 22 H 31 D 3/4

Digital: Before Set: 2 Photo: DSC4-1198

Digital: In Process Set: 3 Photo: DSC5-0356

Digital: After Set: 3 Photo: DSC5-0357

CONDITIONS

Sound:

Broken: Yes

Fallen: Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Slightly along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological, ferrous

Delamination: Thin delaminations on back, probably caused by ferrous

Sugar Decay: Detail:


Flaking: Detail: Both face and back, especially at areas of ferrous

Fragments: Two face fragments

Losses: Use of bottom fragment

NOTES: The large ferrous component of the stone causing loss and delaminations

Before Photo

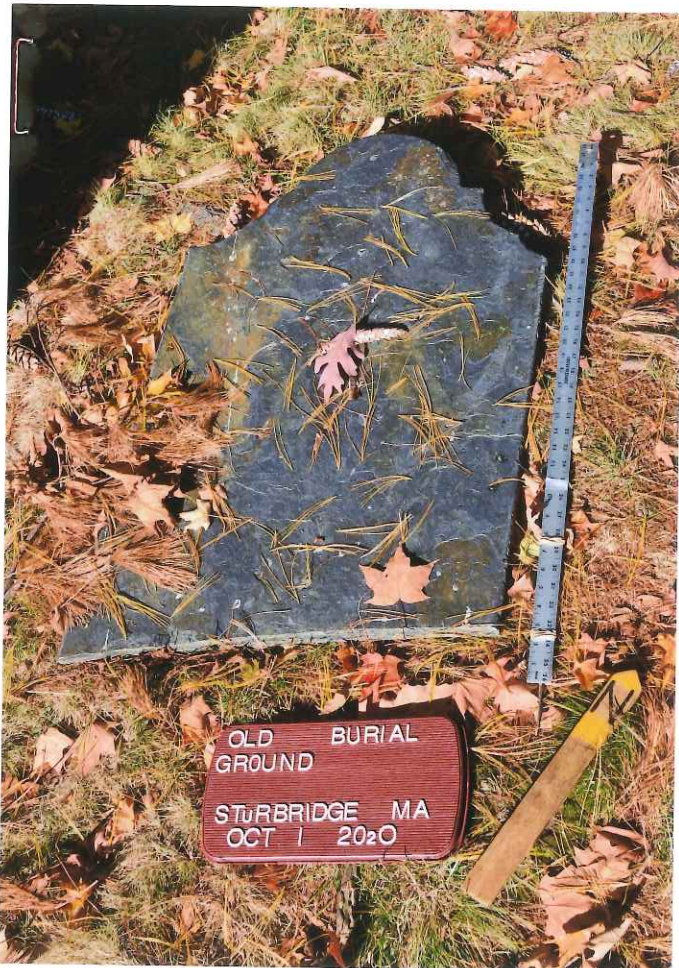

Fannin-Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Plimpton, Mr. Silas/ Infant Babe
Ref/Sec: 6-4



Date of Death: SP: 12/25/1812 IB: 2/23/1813

Conservation Notes: 4/24/2020- 1) At the Burial Ground found stone propped against its neighboring stone. Found two shoulder fragments on ground and removed them to this book for safe keeping. 7/19/2021- 2) Stone evaluated and bottom fragment (at grade) examined. As the stone is quite thin, it was decided not to attempt an at-grade adhesive repair. Decision made to make a new base. It was decided to leave the large at-grade bottom fragment in situ. This means the new base and stone will be set at least 12" to the west- to avoid not only the bottom fragment but huge, old supporting roots. 3) Headstone thoroughly brushed and then treated with D2 Biological Solution. It was then scrubbed and rinsed with water. These procedures repeated until the headstone was as clean as possible. 7/21/2021- 4) New concrete slotted base formed and poured. 7/29/2021- 5) A new concrete base transported to site. It was set level and plumb, in well-compacted sand and peastone, just below grade. As planned, it is set about 12" west of the unuseable original bottom fragment, and also to avoid interfering roots. 6) Headstone was slightly reduced at the bottom so it would sit level and plumb in its new base. 7) Headstone mortared into its new base with Limeworks Ecologic Mortar. 7/30/2021- 8) Adhesive repair of the two shoulder fragments to the headstone using Akemi Akepox 2020 Stone Epoxy. 9) Infill of adhesive repair with Limeworks St. Astier Repair Mortar "Slate." 10) Area around headstone landscaped.

After Photo:

Inscription:

Mr. Silas Plimpton
died
25 Dec. 1812, AE. 37.
And his Infant Babe died
23 Feb. 1813.

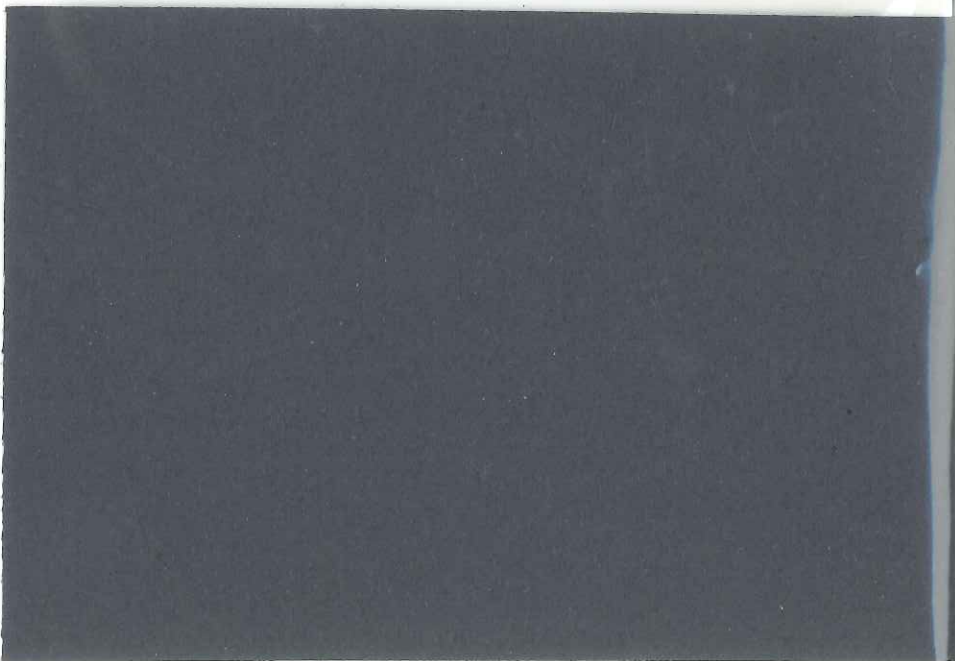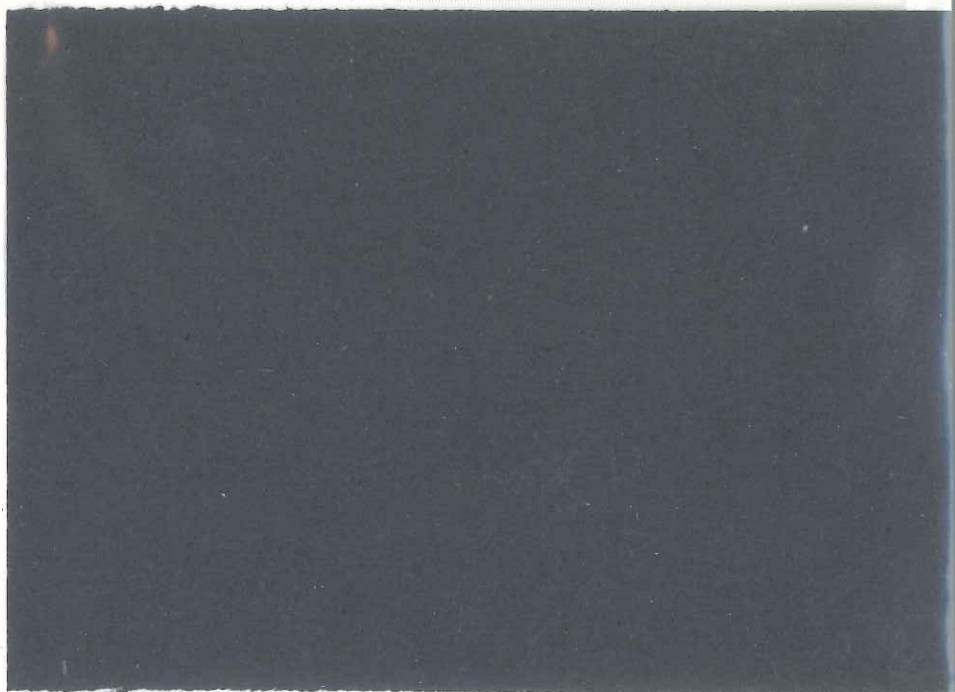

Fannin•Lehner
271 Lexington Road
Concord MA 01742
Old Burial Ground
Sturbridge MA July 30, 2021
Set: 3 Photo: DSC5-0357

Mr. Silas Plimpton
d. 12/25/1812
Infant Babe
d. 2/23/1813
6-4
-after-

Fannin•Lehner
271 Lexington Road
Concord MA 01742
Old Burial Ground
Sturbridge MA July 30, 2021
Set: 3 Photo: DSC5-0356

Mr. Silas Plimpton
d. 12/25/1812
Infant Babe
d. 2/23/1813
6-4
-in process-

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: Oct. 2, 2020

Name: Allen, Mrs. Mercy

Date of Death: July 8, 1802

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Urn/Willow Detail:

Border: Elaborate Detail: Vines

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 7-11

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 H 24 1/2 D 1 1/2

Digital: Before Set: 2 Photo: DSC4-1196

Digital: After Set: 2 Photo: DSC4-1212

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Tilted backward

Previous Repair: Replacement Bases

Detail: Concrete collar- failed

Chipped: Slightly along edges

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Allen, Mrs. Mary

Date of Death: July 8, 1802

Ref/Sec: 7-11

Conservation Notes: 10/2/2020- 1) When headstone excavated, a failed concrete collar was discovered. It was removed. Fortunately the stone has sufficient length to reset. 2) Headstone treated with D2 Biological Solution to help lift lichen and algae and hopefully retard future biological growth. The headstone was then scrubbed, then rinsed with water. These procedures repeated until the headstone was as clean as possible. 3) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 4) Area landscaped around stone.

After Photo:



Inscription:

In memory of
Mrs. Mercy Allen
wife of
Mr. Abner Allen,
who died July 8th 1802.
In her 51st Year.

The sweet remembrance of the just
Will flourish 'tho they sleep in dust.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: Oct. 2, 2020

Name: Wheelock, Henry Eli

Date of Death: April 6, 1827

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Other Detail: Sunburst

Border: Simple Detail: Single line with incised quarter circle at shoulders

Carving: Clear but worn

Bases: None Other: _____

Before Photo



Ref / Sec: 7-16

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 14 H 18 D 1 1/4

Digital: Before Set: 2 Photo: DSC4-1197

Digital: After Set: 2 Photo: DSC4-1211

CONDITIONS

Sound: Yes

Broken:

Tilted Details: Tilted backward

Previous Repair: Other

Detail: Headstone had been reset by Fannin/Lehner in 1998

Chipped: Slightly along edges

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses: Portion of bottom of stone

NOTES: Back is very uneven which is probably original

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Wheelock, Henry Eli

Date of Death: April 6, 1827

Ref/Sec: 7-16

Conservation Notes: 10/2/2020- 1) Refer to 1998 Form Conservation notes. After twenty-two years, the headstone is tilting once again. 2) Headstone excavated. As it is missing part of its lower bottom, it was decided to reset it lower for more stability. 3) Headstone treated with D2 Biological Solution to help lift lichen and algae and hopefully retard future biological growth. The headstone was then scrubbed, then rinsed with water. These procedures repeated until the headstone was as clean as possible. 4) Headstone reset level and plumb, in well-compacted sand and peastone. 5) Area landscaped around stone.

After Photo:



Inscription:

Henry Eli
son of
Hiram &
Fanny Wheelock
died
April 6, 1827
AE. 8 ms. 10 ds.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: July 19, 2021

Name: Bond, Lieut. Nathaniel, Junr.

Date of Death: May 14, 1771

Marker Type: Headstone Detail: _____

Stone Carver: H. C. Geyer

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Winged Face Detail:

Border: Elaborate Detail: Stylized foliage

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 15-8

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 23 H 36 D 1 1/2

Digital: Before Set: 1 Photo: DSC5-0091

Digital: After Set: 2 Photo: DSC5-0334/5/6

CONDITIONS

Sound:

Broken: Yes

Fallen: Details: Yes

Previous Repair: Other

Detail: 1998: Fannin/Lehner removed an old repair, cleaned, reset base fragment, and adhesively repaired the headstone

Chipped: Heavily all edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological, ferrous

Delamination: Thin delaminations on back

Sugar Decay: Detail:

Flaking: Detail: On face

Fragments:

Losses: Along break

NOTES: Appeared to be felled by a tree branch during winter 2020/2021

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Bond, Lieut. Nathaniel, Junr.

Date of Death: May 14, 1771

Ref/Sec: 15-8

Conservation Notes: 7/19/2020- 1) The fallen, broken headstone examined. It was last repaired by Fannin/Lehner in 1998! At that time, the previous repair material was removed and the headstone was then cleaned, reset, and adhesively repaired. 2) The previous repair material was removed and a test fit performed. The fit was still excellent and the stone seems thick enough and stable enough to do another adhesive repair. 3) Top and bottom fragment thoroughly brushed and treated with D2 Biological Solution. They were then scrubbed and rinsed with water. These procedures repeated until the fragments were as clean as possible. 4) Bottom fragment reset level and plumb, in well-compacted sand and peastone. 7/20/2021- 5) Adhesive repair of top to bottom fragment using Akemi Akepox 2010 Stone Epoxy. Repair clamped. 6) Infill along break using Limeworks St. Astier Lithomex Repair Mortar: "Slate." 7) Area landscaped around stone.

After Photo:



Inscription:

Here lies buried ye Body
of Lieut. NATHANIEL BOND
Junr. he Died May 14th 1771
in the 45th Year of his
Age.

Step here, my friend, and cast an Eye
As you are now so once was I
As I am now, so you must be,
Prepare for Death, and follow me.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: Oct. 2, 2020

Name: Mors, Mr. Samuel(?)

Date of Death: April 27, 1807

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Schist Other: _____

Carved Surfaces: Front

Motif: Winged Face Detail: Whorls on either side of face

Border: Elaborate Detail: Vines and vestigial flowers

Carving: Mostly Deciph.

Bases: None Other:

Before Photo



Ref / Sec: 15-17

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 22 H 42 1/2 D 3

Digital: Before Set: 2 Photo: DSC4-1195

Digital: After Set: 3 Photo: DSC4-0044

CONDITIONS

Sound: Yes

Broken:

Tilted Details: Tilted backward

Previous Repair: Adhesive Repair

Detail: Adhesive repair of face fragments, one fragment missing at unknown period and unknown material

Chipped: Slightly along edges

Cracked:

Biological Activity: Extremely heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Erosion: Detail: Some general eroding of surface

Flaking: Detail:

Fragments:

Losses: One previously attached fragment missing

NOTES:

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Mors, Mr. Samuel(?)

Date of Death: April 7, 1807

Ref/Sec: 15-17

Conservation Notes: 10/2/2020- 1) This fragile, tilting headstone excavated. The hope was to come across the missing face fragment which also may have disintegrated after falling. This fragment, if it exists, not found. 2) Headstone reset level and plumb, in well-compacted sand and peastone. The headstone was reset about 4" lower for stability. 10/3/2020- 3) Headstone gently scraped to remove any loose lichen, then thoroughly brushed. 4) Headstone treated with D2 Biological Solution to help loosen persistent lichen and algae and hopefully retard future biological growth. The headstone was then gingerly scrubbed, then rinsed with water. These procedures repeated until the headstone was as clean as possible. 5) With the stone clean, the missing fragment is very obvious with clumps of failed adhesive remaining. Those were not removed to avoid further damage to the stone. 10/25/2020- 6) Infill around fragments on face using Limeworks Lithomex Repair Mortar composed of "Dark Limestone" and "Slate." 7) Area landscaped around stone.

After Photo:

Inscription:



In memory of
Mr. (Samuel?) Mors,
who (died) April 27,
1807 Aged 63 Yrs.

My flesh shall slum
ber in the ground,
'Till the last trumpets
joyful sound.
Then burst the chains
with sweet surprise
And in my Saviours
image rise.

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: July 20, 2021

Name: Newell, Submit

Date of Death: June 13, 1771

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Winged Skull Detail:

Border: Simple Detail: Double lines

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 17-1

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 15 1/2 H 15 D 1 1/4

Digital: Before Set: 1 Photo: DSC5-0090

Digital: After Set: 2 Photo: DSC5-0330

CONDITIONS

Sound: Yes

Broken:

Tilted: Details: Severely backward

Previous Repair: None Evident

Detail:

Chipped: Edges, especially proper left edge

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination: Thin delaminations below grade

Sugar Decay: Detail:

Flaking: Detail: Face- below grade

Fragments:

Losses: Large chip off proper left edge

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA

Name: Newell, Submit

Date of Death: June 13, 1771

Ref/Sec: 17-1

Conservation Notes: 7/20/2020- 1) This severely tilting stone excavated. It has sufficient length to reset. 2) Headstone thoroughly brushed then treated with D2 Biological Solution. The stone was then scrubbed and rinsed. These procedures repeated until the stone was as clean as possible. 3) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 4) Area landscaped around headstone.

After Photo:

Inscription:



Here lies Buried ye Body
of SUBMIT NEWELL,
Daughter of Mr. TIMOTHY
& Mrs. MIRIAM NEWELL,
she died June ye 13 1771.
in infancy.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: Old Burial Ground, Sturbridge, MA

Record Date: Sept. 12, 2020

Name: Upham, Capt. Ezekiel

Date of Death: April 21, 1783

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Winged Face Detail:

Border: Elaborate Detail: Vines and flowers

Carving: Clear but worn

Bases: None Other:

Before Photo



Ref / Sec: 23-11

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 31 3/4 H 39 D 2 1/4

Digital: Before Set: 1 Photo: DSC4-1142

Digital: After Set: 2 Photo: DSC4-1214

CONDITIONS

Sound: Yes

Broken:

Tilted Details: Tilted slightly

Previous Repair: None Evident

Detail:

Chipped: Large chip off proper left edge and lower proper right

Cracked: Some light diagonal cracking on face

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination: Across top edge of tympanum

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses: Large chips off edges

NOTES: Has Rev. War flag

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: Old Burial Ground, Sturbridge, MA


Name: Upham, Capt. Ezekiel

Date of Death: April 21, 1783

Ref/Sec: 23-11

Conservation Notes: 10/2/2020- 1) Headstone gently scraped and thoroughly brushed. 2) Headstone treated with D2 Biological Solution to help lift lichen and algae and hopefully retard future biological growth. The headstone was then scrubbed, then rinsed with water. These procedures repeated until the headstone was as clean as possible. 3) Headstone capped across the delamination over tympanum and shoulders and down both edges. The material used was Limeworks St. Astier Lithomex Repair Mortar: "Slate."

After Photo:

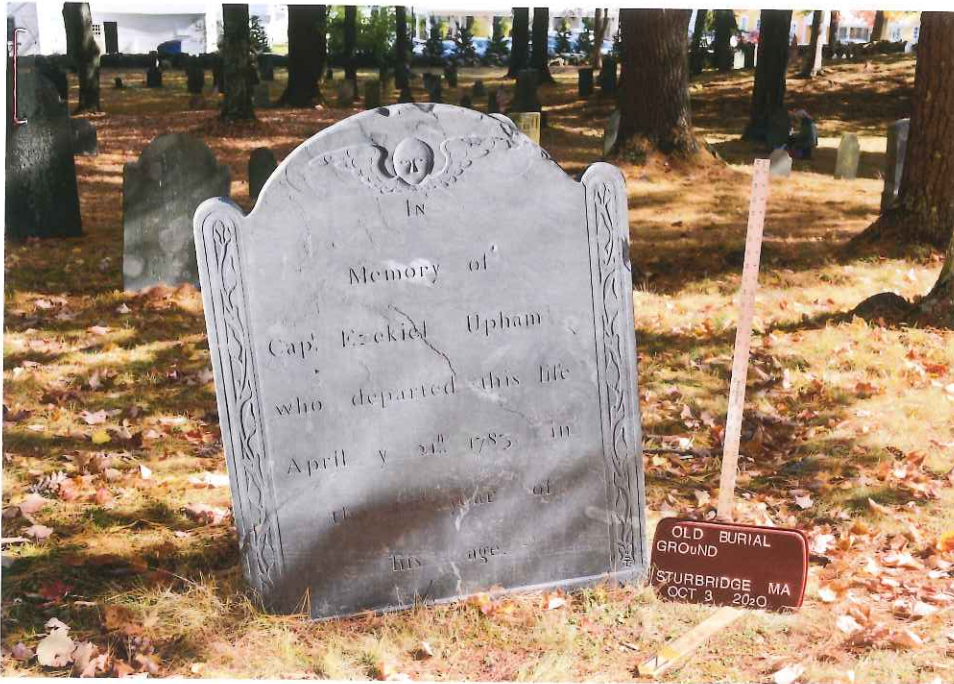

Inscription:

IN
Memory of
Capt. Ezekiel Upham
who departed this life
April ye 21st. 1783. in
the 83d year of
his age.