

FANNIN • LEHNER

PRESERVATION CONSULTANTS

NORTH CEMETERY

STURBRIDGE, MASSACHUSETTS

GRAVESTONE/MONUMENT CONSERVATION REPORTS

August 2021


**PREPARED FOR
THE TOWN OF STURBRIDGE**

MARY E. SHELDON
d. Feb. 6, 1858



NORTH
CEMETERY
STURBRIDGE MA
JULY 29 2020

BEFORE

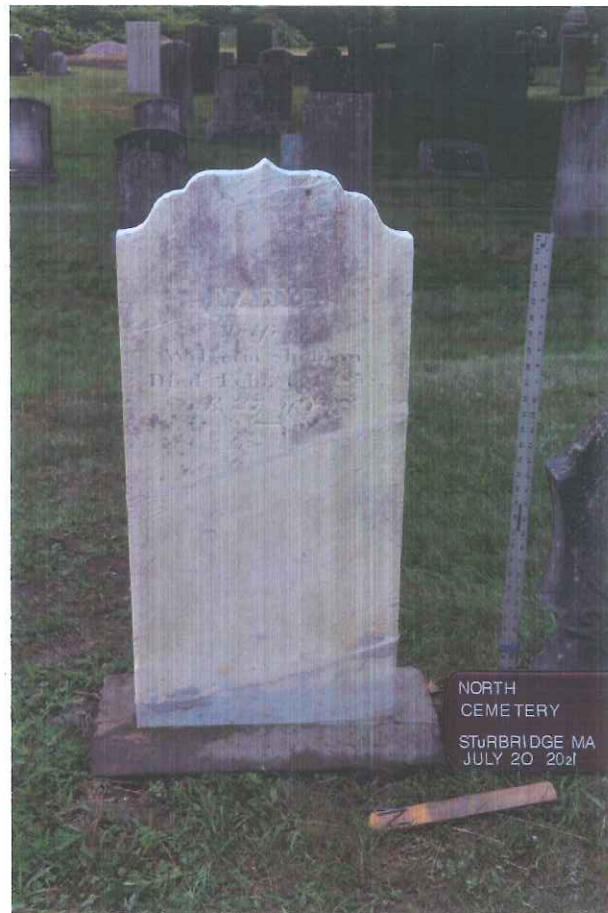

NORTH
CEMETERY
STURBRIDGE MA
JULY 20 2021

AFTER

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|------------------------|----------------|--------|----------------------|--|--|---------|
| 3? | N/A/ | ETHEL | N/A | MARKER | MARBLE/ SANDSTONE | SUNKEN/TILED/ OUT OF BASE | EXCAVATE. CLEAN. RESET BASE HIGHER. MORTAR INTO BASE. | 1 |
| 3? | N/A/ | LUCY | N/A | MARKER | MARBLE/ SANDSTONE | SUNKEN/TILTED/ OUT OF BASE. | EXCAVATE. CLEAN. RESET BASE HIGHER. MORTAR INTO BASE. | 1 |
| 15 | SLAYTON | EDITH A. | 1943 | MARKER | GRANITE | SUNKEN | EXCAVATE. CLEAN. RESET HIGHER. | 1 |
| 26 | RICE | MARY A. | JAN. 10, 1893 | MARKER | GRANITE/ GRANITE | TILTED/ DIE FACING WRONG DIRECTION | DISASSEMBLE. EXCAVATE. CLEAN. LEVEL FOUNDATION. SET BASE. REVERSE DIE AND PLACE ON BASE. | 1 |
| 26 | RICE | ARTHUR W. | JULY 2, 1920 | MARKER | GRANITE/ GRANITE | TILTED/ SUNKEN/ DIE FACING WRONG DIRECTION | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REVERSE DIE AND PLACE ON BASE. | 1 |
| 26 | RICE | EDWIN A. | NOV. 8, 1928 | MARKER | GRANITE/ GRANITE | TILTED/ SUNKEN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PLACE DIE ON BASE. | 1 |
| 27 | BUMP | ALBERT H. | JAN. 31, 1926 | MARKER | MARBLE/ GRANITE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 28 | UNDERWOOD | CHARLES L. | OCT. 4, 1929 | MARKER | GRANITE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 28 | UNDERWOOD | CLARENCE | AUG. 25, 1947 | MARKER | GRANITE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 28 | PUTNAM | CLARENCE S. | FEB. 12, 1925 | MARKER | GRANITE | SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |
| 41 | JAYNES | HARRIET M. "HATTIE" | SEPT. 30, 1885 | MARKER | MARBLE/ MARBLE | LOOSE ON PINS | DISASSEMBLE. CLEAN. REPIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|---------------------|----------------|--------|-------------------|---|--|---------|
| 42 | WHITTEMORE | REED AUSTIN | MAR. 18, 1908 | MON | MARBLE/ MARBLE | TILTED/ MIDDLE BASE BROKEN | EXCAVATE. RESET LEVEL. CLEAN. DRILL AND PIN BASE FRAGMENT TO MIDDLE BASE. INFILL. | 1 |
| 44 | FARQUHAR | JANET "MOTHER" | DEC. 19, 1904 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 44 | FARQUHAR | WILLIAM R. | APR. 17, 1881 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 44 | FARQUHAR | JANE | SEPT. 20, 1887 | MARKER | MARBLE/ MARBLE | TILTED/PINS MISSING | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 44 | JARVIS | ISABELLA F. | APR. 4, 1933 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 44 | DAVIS | MABEL B. | AUG. 10, 1887 | HEAD | MARBLE/ MARBLE | SUNKEN/TILTED | EXCAVATE. INVESTIGATE BASE (ETC)? CLEAN. RESET HIGHER. | 1 |
| 46 | DAVIS | CPL. CLARENCE D. | OCT. 5, 1918 | HEAD | MARBLE/ MARBLE | TILTED/ LOOSE IN GROUND | DISASSEMBLE. EXCAVATE. EVALUATE FOUNDATION OF BASE. RESET FOUNDATION AND BASE. REPIN? MORTAR INTO BASE. | 1 |
| 47 | NICHOLS | EMELINE "MOTHER" | FEB. 12, 1901 | HEAD | MARBLE | TILTED/ LOOSE ON PIN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 52 | BRAMAN | ELLEN W. | APRIL 6, 1937 | HEAD | MARBLE | TILTED (MATCHES HUSBAND'S VETERAN STONE) | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|---------------------------------------|--|-------------------------|----------------------|---|---|---------|
| 62 | HAYER | WILLIAM D. | SEPT. 2, 1922 | DOUBLE | MARBLE/ | TILTED | SET ASIDE. LEVEL FOUNDATION. | 1 |
| | | IDA E. | NOV. 4, 1897 | MON | MARBLE/ | | RESET ON FOUNDATION. CLEAN. | |
| 68 | BURKE | ALEXANDER (ETC.) | JUNE 19, 1950 | MON | GRANITE | TILTED | EXCAVATE AROUND BASE. BRING TO LEVEL. CLEAN. | 1 |
| 69 | AVERY | MARY | DEC. 18, 1908 | MARKER | MARBLE/ MARBLE | SUNKEN/ SLIGHTLY LOOSE/BROKEN FRAGMENT DETACHED. | EXCAVATE. CLEAN. RESET. ADREP. INFILL. | 1 |
| 69 | AVERY | HERBERT | JAN. 26, 1893 | MARKER | MARBLE/ MARBLE | FALLEN | EXCAVATE. CLEAN. RESET BASE. PIN. MORTAR FILL. | 1 |
| 69 | AVERY | HERBERT MARY | JAN. 26, 1893 DEC. 18, 1908 | MON | MARBLE | TILTED | BRING TO LEVEL. CLEAN. | 1 |
| 71 | WELD | FLORA M. EVERETT A. CLARENCE E. | MAY 10, 1870 MAY 13, 1870 JULY 3, 1875 | MON | MARBLE/ SANDSTONE | LOOSE ON BASE/ PINS MISSING. BASE IS DETERIORATING. | DISASSEMBLE. EXCAVATE BASE. CLEAN. RESET BASE. REPIN. INFILL CRACKS. | 1 |
| 72 | HARRINGTON | SAMUEL | APR. 27, 1880 | URN TOPPED COLUMN | MARBLE/ MARBLE | TURNING ON RUBBLE FOUNDATION (HEAVY) | DISASSEMBLE. REMOVE LOOSE STONE FOUNDATION. NEW CON- CRETE FOUNDATION. CLEAN. RE- ASSEMBLE. (NEEDS LIFTING EQUIPMENT) | 1 |
| 72 | PROUTY | ELLEN F. HARRINGTON | APR. 22, 1915 | MARKER | MARBLE | TILTED/ LOOSE ON PINS/ SUNKEN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|------------|----------------|--------------|----------------------|---|---|---------|
| 74 | WIGHT | CARRIE L. | APR. 1, 1863 | SMALL MON | MARBLE/ SANDSTONE | LOOSE ON LOWEST BASE/ SUNKEN (LAMB ON TOP) | DISASSEMBLE. EXCAVATE. CLEAN. RESET SANDSTONE BASE HIGHER. PIN DIE AND MARBLE BASE TO SANDSTONE BASE. | 1 |
| 74 | WIGHT | EMMA L. | DEC. 26, 1870 | SMALL MON | MARBLE/ SANDSTONE | SUNKEN/ DIE CRACKED FROM IRON PIN (LAMB ON TOP) | DISASSEMBLE. EXCAVATE. REMOVE AS MUCH OF IRON PIN AS POSSIBLE. CLEAN. RESET SANDSTONE BASE HIGHER. PIN DIE TO MARBLE BASE. PIN MARBLE BASE TO SANDSTONE BASE. INFILL. | 1 |
| 74 | WIGHT | CHARLES A. | SEPT. 25, 1873 | SMALL MON | MARBLE/ SANDSTONE | SUNKEN/ LOOSE ON BROKEN PINS/ TILTED (LAMB ON TOP) | DISASSEMBLE. EXCAVATE. CLEAN. RESET SANDSTONE BASE. ATTEMPT TO REMOVE BROKEN PINS. PIN DIE TO MARBLE BASE AND MARBLE BASE TO SANDSTONE BASE. | 1 |
| 74 | WIGHT | FANNY L. | 1930 | MARBLE | MARBLE | TILTED/LOOSE ON PINS/ SUNKEN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 78 | BRIDGES | ABBY | JULY 10, 1928 | HEAD | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS/ FACING WRONG DIRECTION | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE REVERSE DIRECTION. PIN DIE TO BASE. | 1 |
| 82 | STONE | HENRY J. | MAR. 10, 1925 | MARKER | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 82 | STONE | FRANK L. | DEC. 31, 1909 | MARKER | MARBLE/ MARBLE/ | SUNKEN/TILTED LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-------------|-------------------|------------------------------|--------------|--------------------|-----------------------------------|--|---------|
| 92 | ANDREWS | WILLIAM W. | OCT. 18, 1875 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. | 1 |
| 92 | ANDREWS | GEORGE W. | JAN. 17, 1844 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 92 | ANDREWS | WILLIAM HENRY | JUNE 20, 1848 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 94 | CARPENTER | EDWARD | APRIL 17, 1892 | HEAD | MARBLE/ MARBLE | BROKEN/SHATTERED (MIDDLE) BASE | EXCAVATE. DISASSEMBLE. CLEAN. RESET LOWEST BASE. DRILL AND PIN MIDDLE BASE TO LOWEST BASE. WITH DIE: DRILL AND PIN LOWER FRAGMENT AND DRILL AND PIN TO LOWEST BASE. INFILL. | 1 |
| 95 | RANSOM | HIRAM | MAY 28, 1882 | MON | MARBLE/ MARBLE | DIE LOOSE ON BASE | SET ASIDE DIE. REMOVE CONCRETE FROM BOTTOM OF DIE AND TOP OF MIDDLE BASE. CLEAN. DRILL AND PIN DIE TO MIDDLE BASE. | 1 |
| 95 | RANSOM | HIRAM H. LAURA | MAY 27, 1900 JULY 3, 1895 | HEAD | MARBLE | TILTED (VETERAN'S STONE) | EXCAVATE. CLEAN. RESET. | 1 |
| 99 | STONE | LOTTIE | JAN. 29, 1884 | MARKER | MARBLE | BROKEN/TILTED/ SUNKEN | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. MORTAR BOTTOM FRAGMENT INTO BASE. INFILL. | 1 |
| 103 | CHAMBERLAIN | CARL H. | APRIL 24, 1885 | SMALL MON | MARBLE/ MARBLE | SUNKEN/TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET LOWER BASE. REPIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-------------|------------------|---------------|--------------|--------------------|--------------------------|--|---------|
| 105 | CHAMBERLAIN | JOHN N. | FEB. 21, 1880 | URN- | MARBLE/ | URN AND PLINTH | REMOVE URN AND PLINTH. CLEAN. | 1 |
| | | PERSIS | APR. 8, 1882 | TOPPED | MARBLE | LOOSE | REPIN URN AND PLINTH. | |
| | | PLIMPTON | | MON | | | | |
| 105 | BAKER | REBECCA | MAR. 7, 1917 | MARKER | MARBLE/ | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| | | CHAMBERLAIN | | | MARBLE | | | |
| 105 | CHAMBERLAIN | JOHN N. | FEB. 21, 1880 | MARKER | MARBLE/ | TILTED/ LOOSE ON | DISASSEMBLE. EXCAVATE. CLEAN. | 1 |
| | | "FATHER" | | | MARBLE | PIN | RESET BASE. REPIN. | |
| 105 | CHAMBERLAIN | EVA | JULY 8, 1880 | SMALL MON | MARBLE/ MARBLE/ | TILTED/ LOOSE ON BASE | REMOVE DIE AND MARBLE BASE. EXCAVATE. CLEAN. RESET LOWEST BASE. PIN MIDDLE BASE TO LOWEST BASE. | 1 |
| 105 | CHAMBERLAIN | CLARA WALLACE | JULY 2, 1933 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 105G | CHAMBERLAIN | HELENA M. | JUNE 2, 1956 | MARKER | MARBLE/ MARBLE/ | TILTED/ PINS BROKEN | DISASSEMBLE. EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. DRILL AND PIN. | 1 |
| 105G | CHAMBERLAIN | ALVIN H. | JULY 5, 1973 | MARKER | MARBLE/ MARBLE | TILTED/ PINS BROKEN | DISASSEMBLE. EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. DRILL AND PIN. | 1 |
| 105G | CHAMBERLAIN | GERTRUDE D. | AUG. 1, 1958 | MARKER | MARBLE/ MARBLE | PINS BROKEN | REMOVE PREVIOUS REPAIR. CLEAN. REPIN | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|--------------------------|--------------------|---------------|----------------------------------|----------------------|---|--|---------|
| 105G | CHAMBERLAIN | JOSEPH E. | 1975 | MARKER | MARBLE/ MARBLE | FALLEN/PIN BROKEN/ SUNKEN/ IMPACTED BY TREE | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 105G | GRANGER | HAROLD | DEC. 28, 1968 | MARKER | MARBLE/ MARBLE | TILTED/ PINS BROKEN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE/ REPIN. | 1 |
| 105G | GRANGER | RUTH | DEC. 24, 1967 | MARKER | MARBLE/ MARBLE | TILTED/ PINS BROKEN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 106 | EDGERTON | ALBERT H. | JULY 29, 1910 | MARKER | MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 108 | ALLEN FAMILY MONUMENT | | 1861-1893 | MON (URN TOPPED COLUMN) | MARBLE/ GRANITE | TILTED | DISASSEMBLE. MAY NEED TO EX- AMINE EXISTING FOUNDATION. NEW CONCRETE FOUNDATION? CLEAN. REASSEMBLE. (VERY HEAVY) NEEDS LIFTING EQUIPMENT. | 1 |
| 108 | ALLEN | SAMUEL E. | APR. 7, 1857 | HEAD | MARBLE/ SANDSTONE | FALLEN/ BOTH DIE AND BASE BROKEN/ PREVIOUS REPAIR OF CAULK | EXCAVATE AND EVALUATE POSSIBILITY OF REPAIR. NEW BASE? CLEAN. SET/RESET BASE. MORTAR INTO BASE. | 1 |
| 108 | ALLEN | MARY | MAY 8, 1876 | HEAD | MARBLE | TILTED/ OUT OF BASE | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. MORTAR INTO BASE. | 1 |
| 110 | LEE | INFANT DAUGHTER | NOV. 19, 1883 | MARKER | MARBLE/ MARBLE | SUNKEN/PINS MISSING | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------------------------|--------------------------------|------------------|--------------------|-------------------------------------|---|---------|
| 110 | LEE | N/A | N/A | MON | MARBLE/ MARBLE | URN LOOSE ON PIN | CLEAN. REPIN URN. | 1 |
| 111 | HAYWARD | JACOB B. | JUNE 28, 1892 | MARKER | MARBLE/ MARBLE | LOOSE ON PINS | CLEAN. REPIN. | 1 |
| 111 | SYKES | EVELYN | 1921 | MARKER | MARBLE/ MARBLE | MISSING ONE PIN | CLEAN. REPIN/PIN | 1 |
| 115 | RUSSELL | HENRY J. | JULY 23, 1935 | MARKER | MARBLE/ MARBLE | LOOSE ON PINS | CLEAN. REPIN. | 1 |
| 116 | CUTTING | WILLIAM E. "FATHER" | JAN. 28, 1918 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. REMOVE PREVIOUS REPAIR (CONCRETE). CLEAN. RESET BASE. REPIN. | 1 |
| 116 | KATHAN | VINTON W. ADELAIDE M. CUTTING | JUNE 22, 1935 JUNE 22, 1935 | DOUBLE MARKER | MARBLE/ MARBLE/ | TILTED (MARKERS SHARE SAME BASE) | EXCAVATE. CLEAN. RESET. | 2 |
| 116 | CUTTING | EBENEZER "FATHER" | OCT. 5, 1896 | MARKER | MARBLE/ MARBLE/ | SUNKEN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 116 | CUTTING | ABBIE C. "MOTHER" | MAY 6, 1919 | MARKER | MARBLE/ MARBLE | SUNKEN/SLIGHTLY TILTED | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. DRILL AND PIN. | 1 |
| 116 | CLAIR | IDA R. CUTTING | 1968 | MARKER | MARBLE/ MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 116 | CLAIR | JAMES E. | 1964 | MARKER | MARBLE/ MARBLE | TILTED/LOOSE ON BASE | EXCAVATE. CLEAN. RESET BASE. DRILL AND PIN DIE TO BASE. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|--------------------|-------------------------------------|--|-----------------------|--------------------|---|--|---------|
| 119 | RICE | EDNA BELLE | JULY 7, 1891 | MON | GRANITE | TILTED | SET ASIDE MON. EXCAVATE. CLEAN RESET. | 1 |
| 121 | DAY | JOHN | APR. 21, 1916 | MARKER | GRANITE | SUNKEN/ LOOSE ON BASE | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 123 | CONVERSE (ETC.) | PORTER M. LOUISA MARSH IDA F. | FEB. 6, 1891 SEPT. 13, 1867 NOV. 2, 1863 | URN- TOPPED MON | MARBLE | URN IS LOOSE | DISASSEMBLE PLINTH AND URN. CLEAN. REPIN URN AND PLINTH. | 1 |
| 123 | TIDD | HOMER A. | SEPT. 6, 1909 | MARKER | MARBLE | TILTED | DISASSEMBLE. EXCAVATE. CLEAN. RESET. | 1 |
| 123 | CONVERSE | IDA FLORENCE | NOV. 2, 1863 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 124 | WHITE | EUNICE A. | JULY 21, 1909 | SMALL MON | MARBLE/ MARBLE | TILTED/LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 124 | WHITE | RUTH E. | MAR. 16, 1900 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 124 | WHITE | CHARLES H. | AUG. 8, 1922 | SMALL HEAD | MARBLE/ MARBLE | TILTED/LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 130 | STEADMAN | NELSON R. | 1944 | MARKER | MARBLE/ MARBLE | TILTED/SUNKEN/ MISSING PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 130 | STEADMAN | CARRIE RICHARDS | FEB. 19, 1901 | MARKER | MARBLE/ MARBLE | TILTED/SLIGHTLY SUNKEN/BROKEN PINS/ LOSS AT PROPER LEFT BACK | EXCAVATE. CLEAN. RESET BASE. DRILL AND PIN. INFILL LOSS AT PROPER LEFT BACK. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|---------------------------|----------------|-------------------|--------------------|---------------------------|---|---------|
| 130 | RICHARDS | ELMA A. BIGGS "MOTHER" | 1914 | MARKER | MARBLE/ MARBLE/ | TILTED/LOOSE ON PINS | DIASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 130 | RICHARDS | BEULAH L. FITTS | MAR. 16, 1943 | MARKER | MARBLE/ MARBLE | TILTED/ PINS BROKEN | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 130 | RICHARDS | WILBUR L. "FATHER" | DEC. 14, 1945 | MARKER | MARBLE/ MARBLE | FALLEN/ BROKEN/ TILTED | EXCAVATE. CLEAN. RESET BASE AND FRAGMENT. PIN DIE TO BASE. ADHESIVE REPAIR OF DIE TO FRAGMENT. | 1 |
| 130 | RICHARDS | LORINDA BRAMAN | SEPT. 15, 1928 | MARBLE/ MARBLE | TILTED | MARBLE/ MARBLE | EXCAVATE. CLEAN. RESET. | 1 |
| 131 | MOORE | | | | | | REMOVE YUCCA!! (BY OTHERS) | |
| 132 | WEEKS | H.G. | FEB. 20, 1892 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 1 |
| 132 | EGAN | EDWARDS D. | SEPT. 30, 1901 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 1 |
| 132 | CHICKERING | HENRY E. | MAY 25, 1909 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 1 |
| 132 | WEBBER | W.H. | N/A | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 1 |
| 132 | REMINGTON | EZRA L. | JUNE 12, 1915 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-------------|-------------------------|------------------------------|---------------|--------------------|--|--|---------|
| 132 | SCARBOROUGH | SERGT. JAMES M. | APR. 18, 1908 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 2 |
| 132 | HILL | BARNEY | SEPT. 27, 1902 | MARKER | MARBLE | SUNKEN/TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET HIGHER. | 2 |
| 132 | DOUGLAS | DANIEL M. | MAY 16, 1912 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 2 |
| 137 | DOUTY | IDA | 1941 | MARKER | GRANITE | TILTED/ SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 140 | WEBBER | ALFRED B. MARY AGNES | MAY 7, 1928 OCT. 26, 1875 | DOUBLE MON | MARBLE/ MARBLE | LOOSE ON PINS | CLEAN. REPIN. (HEAVY) | 1 |
| 142 | BIRD | ENOCH | JUNE 26, 1878 | MON | MARBLE/ MARBLE/ | BROKEN/TILTED/ BASE ALSO BROKEN/ STRAY SMALL FRAGMENT | EXCAVATE. CLEAN. DRILL AND PIN BASE. MORTAR BOTTOM FRAG- MENT INTO BASE. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 142 | BIRD | EDITH E. | NOV. 5, 1887 | MON | MARBLE/ MARBLE/ | BROKEN/FALLEN/ BASE TILTED | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. MORTAR BOTTOM FRAGMENT INTO BASE. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 143 | STOCKING | RODERICK S. "FATHER" | AUG. 18, 1899 | MON | MARBLE/ MARBLE/ | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-----------------------|---------------|--------|--------------------|---------------------------------|---|---------|
| 143 | RICE | EDGAR E. | OCT. 21, 1887 | MON | MARBLE/ MARBLE/ | TILTED/LOOSE ON BASE | DISASSEMBLE. CLEAN. RESET LOWER BASE. RESET MIDDLE BASE AND DIE ON LOWER BASE WITH SETTING COMPOUND. | 1 |
| 143 | RICE | EMMA E. | AUG. 22, 1914 | MARKER | MARBLE/ MARBLE/ | SUNKEN/TILTED/ LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 145 | WARD | SAMUEL O. | FEB. 12, 1900 | MARKER | MARBLE/ MARBLE | SUNKEN/TILTED LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 151 | COGSWELL | MARY B. | FEB. 1, 1882 | MON | MARBLE | TILTED | DISASSEMBLE. (DIE AND MIDDLE BASE FIRMLY JOINED). CLEAN. RE- ASSEMBLE. | 1 |
| 153 | STOTT | CORNELIA JUDD | MAY 30, 1925 | MARKER | MARBLE | TILTED/ SUNKEN/ LOOSE ON PIN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 153 | STOTT | JENNIE | JAN. 3, 1966 | MARKER | MARBLE | SUNKEN/ NO PIN | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 153 | STOTT | JAMES | JAN. 17, 1898 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 153 | SIMONDS | HAROLD BURTON | JAN. 15, 1899 | MARKER | MARBLE | TILTED/ SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |
| 154 | RICHARDS | MARTHA E. "MOTHER" | MAY 15, 1887 | MARKER | MARBLE/ MARBLE/ | TILTED/SUNKEN/ LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 155 | SHEDDON | HOWARD C. "BABY" | JUNE 24, 1887 | MON | MARBLE/ MARBLE | LOOSE ON PIN | REMOVE DIE. CLEAN. REPIN | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|---------------------------------------|----------------|----------------|------------------------|--------------------|---|---|---------|
| 155 | SHEDDON | CHENEY P. | MAY 31, 1883 | MON | MARBLE/ MARBLE/ | BROKEN/FALLEN/ TILTED/ LOOSE ON PINS/ SMALL LOOSE FRAGMENT | DISASSEMBLE. CLEAN, BRING LOWEST BASE TO LEVEL. REASSEMBLE MIDDLE BASE AND BOTTOM FRAGMENT. DRILL AND PIN TOP TO BOTTOM FRAGMENT INC. SMALL FRAGMENT. INFILL. (HEAVY) | |
| 155 | SHEDDON | JOHN | APR. 26, 1856 | HEAD | MARBLE/ ? | BROKEN/ TILTED | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. DRILL AND PIN TOP TO BOTTOM FRAGMENT. | 1 |
| 156 | LINCOLN | INEZ "BABY" | JULY 8, 1880 | MARKER | MARBLE/ MARBLE | TILTED/LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 157 | PLIMPTON | WILLIE E. | AUG. 25, 1872 | MON | MARBLE/ GRANITE | TILTED/LOOSE ON PINS | DISASSEMBLE. REMOVE PREVIOUS REPAIR. CLEAN. RESET GRANITE AND MIDDLE BASES. REPIN. | 1 |
| 157 | PLIMPTON | WILLIAM | JULY 17, 1871 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |
| 158 | MILLER PLOT (LAST NAME UNCLEAR) | WALTER W. | MAY 5, ? | SMALL MON (LAMB) | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 158 | MILLER | HENRY G. | APRIL 12, 1884 | HEAD | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 1 |
| 159 | BLANCHARD | PRUDENCE R. | JULY 16, 1849 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|-------------------------------|-------------------------------|---------|--------------------|--------------------------------------|---|---------|
| 160 | WILLIAMS | DANIEL BRADFORD | NOV. 9, 1856 | MARKER | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 160 | WILLIAMS | HANNAH J. MANN "MOTHER" | AUG. 9, 1857 | MARKER | MARBLE/ MARBLE | LOOSE ON PIN | CLEAN. REPIN. | 1 |
| 160 | WILLIAMS | JOSEPH JR. | JAN. 13, 1871 | MARKER | MARBLE/ MARBLE/ | LOOSE ON PIN | CLEAN. REPIN. | 1 |
| 165 | BULLOCK | MARY A. (DAUGHTER) | JUNE 18, 1873 | MARKER | GRANITE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 166 | MERRILL | ELLEN E. GAMMON | NOV. 13, 1923 | MARKER | GRANITE | SUNKEN/ TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 168 | WHITTEMORE | JAMES J. "HUSBAND" | MAY 29, 1899 | MARKER | MARBLE/ MARBLE/ | TILTED/LOOSE ON PIN | EXCAVATE. CLEAN. RESET BASE. | 1 |
| 171 | CHILDS | JOHN H. JULIA A. | FEB. 6, 1898 AUG. 27, 1879 | OBELISK | MARBLE/ MARBLE | SHAFT BROKEN AND OUT OF ALIGNMENT | REMOVE SHAFT AND ELEMENT UNDER SHAFT. CLEAN. RESET ELEMENT AND BOTTOM FRAGMENT OF SHAFT. ADHESIVE REPAIR OF TOP TO BOTTOM FRAGMENTS OF OF SHAFT. INFILL. | 1 |
| 171 | CHILDS | JOHN H. | FEB. 6, 1898 | MARKER | MARBLE/ MARBLE/ | BROKEN/SUNKEN | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. PIN BOTTOM FRAGMENT TO BASE. PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|----------------------|-------------|------------------------|----------------|--------|--------------------|--|--|---------|
| 172 | TUCKER | WILLIAM | FEB. 14, 1894 | MON | MARBLE/ MARBLE/ | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 172 | TUCKER | MARY A. | AUG. 17, 1873 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 172 | TUCKER | MARY S. | MAY 6, 1872 | HEAD | MARBLE/ MARBLE/ | TILTED/LOOSE ON PIN | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 172 | TUCKER | BERTHA MAUDE | Apr. 1, 1912 | MON | MARBLE/ MARBLE/ | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 172 | PHETTEPLACE | MARIA E. | NOV. 29, 1911 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 172 | PHETTEPLACE | THOMAS R. | JAN. 25, 1902 | MON | MARBLE/ MARBLE | TILTED/LOOSE ON PINS | EXCAVATE. CLEAN. RESET. REPIN. | 1 |
| 174 (HALF LOT) | EDGERTON | FRANK H. | AUG. 7, 1868 | HEAD | MARBLE | SUNKEN/BASE IS MISSING/ BROKEN/ LOSSES | SEARCH FOR BASE. CLEAN. NEW BASE? SET BASE. PIN DIE TO BASE. INFILL. | 1 |
| 176 | ROYCE | NELSON B. (HUSBAND) | MAY 14, 1876 | MON | MARBLE/ MARBLE | LOOSE ON PINS | DISASSEMBLE. CLEAN. REPIN. | 1 |
| 176 | ROYCE | NELSON L. | SEPT. 23, 1874 | MON | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET LOWER BASE. REPIN DIE AND MIDDLE BASE TO LOWER BASE. | 1 |
| 177 | HEWINS | ISAAC W. | 1888 | MARKER | MARBLE/ MARBLE | SUNKEN/TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE HIGHER. REPIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---------------------------------|------------------------------|--------|-------------------|---|---|---------|
| 177 | CLARKE | ELIZABETH F. HEWINS | AUG. 16, 1950 | MARKER | MARBLE/ MARBLE | TILTED/ SLIGHTLY SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 177 | CLARKE | M. IRVING | 1890 | MARKER | MARBLE/ MARBLE | SUNKEN/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 177 | CLARKE | WILLARD H. ("WILLY") | 1893 | MARKER | MARBLE/ MARBLE | TILTED/ SUNKEN/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 177 | YATES | WILLIAM SPEAKMAN | JUNE 19, 1943 | MARKER | MARBLE/ MARBLE | TILTED/SUNKEN/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 177 | REED | ROBERT T. CLARA M. CLARKE | JUNE 8, 1935 JULY 4, 1874 | MON | MARBLE/ MARBLE | TILTED (MAY HAVE SLID OFF BELOW GROUND FOUNDATION) | SET MON ASIDE. SEARCH FOR FOUNDATION. CLEAN. RESET. | 2 |
| 184 | MCGILPIN | RALPH | FEB. 25, 1899 | MARKER | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 186 | GIFFORD | RALPH | JULY 12, 1893? | HEAD | MARBLE/ MARBLE | TILTED/LOOSE ON PIN/IMPACTED BY BUSHES | CUT BACK BUSHES. EXCAVATE. RESET BASE. REPIN. | 1 |
| 189 | GLEASON | JOSEPH | MAR. 22, 1885 | MARKER | MARBLE/ MARBLE | SUNKEN/ BROKEN/ PIN BROKEN/ LARGE LOSS (SEE FRAG- MENT BY MON- UMENT) | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. PIN DIE TO BASE. INFILL. | 1 |
| 189 | GLEASON | ALICE | FEB. 26, 1902 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|--------------------|------------------------------|---------------|----------------|--------------------|------------------------------------|---|---------|
| 191 | CLARKE | FRANCES EMILY "MOTHER" | JULY 9, 1906 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 193 | BEAUDRY | T. JOSEPH | DEC. 17, 1919 | MARKER | MARBLE/ MARBLE | SUNKEN/ MISSING PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 193 | BEAUDRY | GERTRUDE A. HOBBS | APR. 14, 1905 | MARKER | MARBLE/ MARBLE | SUNKEN/LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 193M | BERNARD/ WIGGIN | | 1848-1976 | MON | GRANITE | HEAVY LICHEN/ ALGAE | CLEAN | 2020 |
| 193M | BERNARD | VICTOR E. | 1948 | FLAT MARKER | GRANITE | HEAVY LICHEN/ ALGAE | CLEAN | 2020 |
| 193M | WIGGIN | MILDRED E. BERNARD | 1976 | FLAT MARKER | GRANITE | HEAVY LICHEN/ ALGAE | CLEAN | 2020 |
| 194 | SHORT | WILLIAM HOSLEY | MAY 18, 1991 | MON | GRANITE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 194 | HOSLEY | ALICE W. SKERRY | MAY 9, 1936 | MARKER | GRANITE | TILTED/ SUNKEN | EXCAVATE. CLEAN. RESET HIGHER | 2 |
| 195 | CHARLES | DWIGHT A. | APR. 28, 1847 | HEAD | MARBLE/ MARBLE | TILTED CARVER: J.B. GRISWOLD | EXCAVATE. CLEAN. RESET. | 2 |
| 197 | FOSKETT | MARY E. | JAN. 6, 1911 | MON | MARBLE/ MARBLE/ | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|-----------------------|---------------|--------------------|--------------------|---------------------------------|---|---------|
| 197 | FOSKETT | ROSWELL W. | MAR. 30, 1896 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 199 | HAZELHURST | EDWARD | N/A | MILITARY MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 203 | UPHAM | BETSEY D. | MAR. 27, 1880 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 205 | CLARKE | MERTIE A. "MOTHER" | APRIL 1, 1899 | MARKER | MARBLE/ MARBLE | SUNKEN | EXCAVATE AND EVALUATE. CLEAN. RESET HIGHER. | 1 |
| 205 | CLARKE | EMILY | DEC. 18, 1896 | MARKER | MARBLE/ MARBLE | SUNKEN/LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 205 | CLARKE | MARION | DEC. 28, 1896 | MARKER | MARBLE/ MARBLE | SUNKEN/TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 209 | HOLLEY | LIDA L. | JUNE 6, 1871 | MARKER | MARBLE/ MARBLE | SUNKEN/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 209 | HOLLEY | GEORGE G. | OCT. 18, 1903 | MARKER | MARBLE/ MARBLE | TILTED/ PINS MISSING | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 211 | CEDATE | PLIMPTON | JUNE 7, 1850 | SMALL MON | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 211 | DORE | JENNIE M. | DEC. 29, 1942 | SMALL MON | MARBLE/ MARBLE/ | TILTED/ LOOSE ON BASE | DISASSEMBLE. CLEAN. DRILL AND REPIN. | 1 |
| | | | | | | | | |
| | | | | | | | | |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---------------------|--------------------------------|--------|--------------------|---|---|---------|
| 212 | STEELE | ERNEST W. | APRIL 13, 1900 | HEAD | MARBLE | FALLEN/ BROKEN/ LOSSES? | EXCAVATE AND INVESTIGATE. MORE FRAGMENTS? NEW BASE? CLEAN. RESET. DRILL AND PIN? INFILL. | 1 |
| 216 | PUTNEY | JOHN ELIZA E. | OCT. 26, 1873 DEC. 22, 1924 | MON | MARBLE/ MARBLE/ | TILTED/BODY OF URN MISSING/ PLINTH BROKEN | BRING MONUMENT TO LEVEL. DISASSEMBLE URN FOOT AND PLINTH. REMOVE PREVIOUS REPAIR. CLEAN. DRILL AND PIN PLINTH AND ATTACH TO MONUMENT. PIN FOOT OF URN TO PLINTH. INFILL. | 1 |
| 216 | PUTNEY | ELIZA E. | DEC. 22, 1924 | MARKER | MARBLE/ MARBLE/ | TILTED/ LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 216 | PUTNEY | JOHN | OCT. 26, 1873 | MARKER | MARBLE/ MARBLE/ | TILTED/ OUT OF BASE | EXCAVATE. CLEAN. RESET BASE. MORTAR DIE INTO BASE. | 1 |
| 217 | PLIMPTON | LORENZO "FATHER" | OCT. 13, 1907 | MARKER | MARBLE/ MARBLE | BROKEN/ TILTED | EXCAVATE. CLEAN. RESET BASE AND BASE FRAGMENT. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 224 | WHITE | CHESTER W. | APR.. 11, 1905 | MON | MARBLE/ MARBLE | TILTED/ LOOSE ON BASE | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 224 | WHITE | SAMUEL C. | APR. 3, 1909 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 224 | WHITE | SAMUEL | AUG. 22, 1904 | MARKER | MARBLE | TILTED VETERAN'S STONE | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---|----------------------|--------------------------|----------------------|---|---|---------|
| 241Q | CLARK | WALTER HARRIET W. | 1979 1968 | MON | GRANITE/ GRANITE | TILTED/ DIE OFFSET ON BASE | DISASSEMBLE. CLEAN. RESET BASE. ALIGN DIE ON BASE. | 1 |
| 241Q | DUKE | HATTIE J. CLARK | 1945 | MON | MARBLE/ MARBLE | LOOSE ON PIN | DISASSEMBLE. CLEAN. REPIN. | 1 |
| 245 | KEOGH | CLARA H. MCCOY | JUNE 3, 1935 | MON | GRANITE | TILTED/ LOOSE ON FOUNDATION | EXCAVATE. CLEAN. RESET BASE ON FOUNDATION. SET DIE ON BASE | 1 |
| 247 | VINTON | BALDWIN J. | JAN. 24, 1924 | MARKER | MARBLE | TILTED/ SUNKEN VETERAN'S STONE | EXCAVATE. CLEAN. RESET HIGHER. | 2 |
| 247 | VINTON | ANN M. | APR. 26, 1929 | MARKER | MARBLE | TILTED/SUNKEN VETERAN'S TYPE STONE | EXCAVATE. CLEAN. RESET HIGHER | 2 |
| 376A | JODREY | WALLACE W. MYRTLE BLANCHARD NANCY A. | 1999 1992 2000 | SLANT FACED MARKER | GRANITE | IMPACTED BY LICHEN, ALGAE | CLEAN | 2000 |
| 532 | TAYLOR | LEIUT. JOHN | JUNE 25, 1841 | HEAD | MARBLE/ ? | TILTED/IMPACTED BY TREE ROOTS/ LOOSE FRAGMENT ON BACK | EXCAVATE. CLEAN. RESET FREE OF TREE ROOTS. REATTACH FRAGMENT. | 1 |
| 532 | TAYLOR | JANE | MAY 20, 1849 | HEAD | MARBLE/ SANDSTONE | CARVER: A. WENTWORTH, BOSTON | NO TREATMENT AT THIS TIME. | |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------|--------------------------------|------|----------------------|---|---|---------|
| 533 | HOOKER | HENRY | JUNE 6, 1823 | HEAD | MARBLE | BROKEN | EXCAVATE. CLEAN. NEW BASE? SET BASE? MORTAR INTO BASE? DRILL/PIN | 1 |
| 533 | HOOKER | HORACE | MAR. 26, 1846 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN,RESET | 2 |
| 533 | HOOKER | MRS. NANCY | JAN. 9, 1863 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET | 1 |
| 533 | STETSON | SAMUEL DEBORAH | MAR. 18, 1800 JUNE 27, 1833 | HEAD | MARBLE | BROKEN/SUNKEN | INVESTIGATE. CLEAN. DRILL AND PIN FRAGMENT? NEW BASE? SET BASE? MORTAR INTO BASE | 1 |
| 534 | EMMONS | FRANCES M. | OCT. 5, 1929 | MON | MARBLE/ MARBLE | TILTED | CLEAN,RESET (HAS CONCRETE? FOUNDATION) | 1 |
| 536 | ALLEN | MARIA | FEB. 28, 1834 | HEAD | MARBLE/ ? | TILTED (NEXT TO HORACE ALLEN D. NOV. 2, 1852) | EXCAVATE. CLEAN. RESET | 1 |
| 536 | ALLEN | CHARLES H. | JAN. 31, 1895 | MON | MARBLE/ MARBLE | DIE LOOSE ON PIN/ BROKEN BASE | REMOVE DIE. EXCAVATE AROUND MARBLE BASE. CLEAN INVEST- IGATE. INFILL CRACK ON BASE. REPIN DIE. | 1 |
| 536 | ALLEN | MARY ETTA O. | NOV. 2, 1927 | MON | MARBLE/ MARBLE/ | SUNKEN/TILTED | EXCAVATE. RESET HIGHER. CLEAN. | 2 |
| 537 | CUTTING | JAMES T. | SEPT. 22, 1849 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------------|----------------|------|----------------------|---|--|---------|
| 537 | CUTTING | HORACE | NOV. 4, 1881 | HEAD | MARBLE/ GRANITE | TILTED/CAUGHT IN LARGE TREE ROOTS | EXTRACT FROM TREE. CLEAN. RESET. HAS BEEN CONCRETED INTO BASE. CONSULT TREE WARDEN. | 1 |
| 537 | CUTTING | HARRIET | SEPT. 28, 1863 | HEAD | MARBLE/ ? | TILTED/BROKEN/ CAUGHT IN LARGE TREE ROOTS | CLEAN. RESET. DRILL AND PIN. INFILL. CONSULT WITH TREE WARDEN. | 1 |
| 537 | CUTTING | HORACE | JUNE 10, 1895 | MON | MARBLE/ MARBLE | TILTED/BURIED AGAINST TREE. | EXCAVATE. CLEAN. RESET, AVOIDING TREE. FOUNDATION UNCLEAR. | 1 |
| 538 | RICHARDS | LORINDA | APR. 19, 1840 | HEAD | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |
| 540 | NEWTON | JOHN LUCY A. ETC. | 1910 1904 | MON | MARBLE/ MARBLE | FALLEN/IMPACTED BY TREE ROOTS | EXCAVATE. REMOVE PREVIOUS REPAIR. NEW CONCRETE FOUND- ATION. CLEAR OF TREE ROOTS. CLEAN. RESET. REPIN BASE. | 1 |
| 541 | JACKSON | GEORGE H. | AUG. 30, 1881 | HEAD | MARBLE/ ? | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |
| 542 | BACHELLOR | CHESTER W. | OCT. 11, 1871 | MON | MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. NEW FOUNDATION. CLEAN. RESET LOWER BASE. PIN DIE AND MIDDLE BASE TO LOWER BASE. | 1 |
| 543 | FISKE | LAURA W. | SEPT. 10, 1866 | MON | MARBLE/ SANDSTONE | TILTED (LARGE PREVIOUS REPAIR) | EXCAVATE. BRING CAREFULLY TO LEVEL. CLEAN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|------------|----------------|--------|-------------------|---------------------------------|---|---------|
| 544 | PORTER | SARAH | MAR. 26, 1838 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 544 | NEWTON | CHARLES A. | JUNE 14, 1898 | HEAD | MARBLE/ MARBLE | TILTED/ OUT OF BASE | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. MORTAR INTO BASE. | 1 |
| 544? | PORTER? | "MOTHER" | N/A | MARKER | MARBLE | FALLEN (MISSING POST) | EXCAVATE AND INVESTIGATE FOR MISSING POST. IF UNSUCCESSFUL, OBTAIN NEW MARBLE POST. SET POST. CLEAN MARKER AND PIN TO POST. | 1 |
| 544? | PORTER? | "FATHER" | N/A | MARKER | MARBLE | FALLEN (POST BELOW GRADE) | EXCAVATE. CLEAN. RESET POST AND MARKER. | 1 |
| 546 | AINSWORTH | DANFORTH | SEPT. 23, 1858 | MARKER | MARBLE | OUT OF BASE | EXCAVATE. CLEAN. RESET BASE. MORTAR INTO BASE. | 1 |
| 547 | PRATT | NATHAN | MAR. 13, 1842 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 548 | PLIMPTON | JOHN | JAN. 18, 1864 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 548 | PLIMPTON | MILLISCENT | JAN. 24, 1871 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 549 | CARPENTER | ANNA L. | OCT. 14, 1860 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 549 | CARPENTER | ALFRED | OCT. 10, 1883 | HEAD | MARBLE | TILTED (MILITARY STONE) | EXCAVATE. CLEAN. RESET. | 2 |
| 549 | MCCOMBER | STEWART A. | JULY 16, 1872 | MON | MARBLE | TILTED | EXCAVATE. CLEAN. BRING TO LEVEL. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|------------|-----------|------------------------|--------------------------------|------|----------------------|------------------------------------|---|---------|
| 549 | LEDOIT | NOAH | NOV, 23, 1842 | HEAD | MARBLE | BROKEN | EXCAVATE. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 1 |
| 551 | TAFT | WILLIAM R. SARAH A. | JAN. 18, 1889 DEC. 13, 1915 | MON | MARBLE | TILTED | EXCAVATE. CLEAN. BRING TO LEVEL. | 1 |
| 551 | TAFT | MARSHALL A. | AUG. 16, 1864 | HEAD | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 551 | ALDRICH | SUSAN S. TAFT | SEPT. 19, 1886 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 551 | TAFT | AGNES S. | JULY 14, 1870 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 552 | PLIMPTON | JABEZ ELIZA BRIDGES | NOV. 16, 1877 OCT. 2, 1884 | MON | MARBLE | TILTED | EXCAVATE. CLEAN. BRING TO LEVEL | 1 |
| 554 | NICHOLS | WILBUR | DEC. 3, 1871 | HEAD | MARBLE | MILITARY MARKER (CIVIL WAR) | EXCAVATE. CLEAN. RESET. | 1 |
| 556 2/3 | SHUMWAY | CHLOE | APR. 29, 1834 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 556 2/3 | SHUMWAY | AMELIA C. | JUNE 5, 1874 | HEAD | MARBLE | TILTED (BASE 4" BELOW GRADE) | EXCAVATE. CLEAN. RESET. | 2 |
| 557 | HAMANT | ADDISON | MAY 13, 1832 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---------------------------|--------------------------------|------|--------------------|---|---|---------|
| 557 | HAMANT | LUTHER VIOLA (ETC.) | MAR. 12, 1878 OCT. 20, 1838 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. BRING TO LEVEL. CENTER SHAFT. | 1 |
| 558 | WALKER | HORATIO | OCT. 4, 1854 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 558 | HYDE | FITZ HENRY | OCT. 29, 1836 | MON | MARBLE/ GRANITE | TILTED/DIE LOOSE ON PINS | DISASSEMBLE. CLEAN. LEVEL BASE. REPIN. REASSEMBLE. | 1 |
| 558 | HYDE | EMERY | OCT. 31, 1835 | MON | MARBLE/ GRANITE | TILTED/DIE LOOSE ON PINS | DISASSEMBLE. CLEAN. LEVEL BASE. REPIN. REASSEMBLE. | 1 |
| 558 | FREEMAN | BETSY H. HYDE | FEB. 28, 1873 | HEAD | MARBLE | FOUND BROKEN IN LOT 678. BASE LOCATED IN LOT 558 | EXCAVATE BASE. CLEAN. RESET BASE. DRILL AND PIN BOTTOM FRAGMENT (IN SLOT) TO MIDDLE FRAGMENT. DRILL AND PIN TOP TO MIDDLE FRAGMENT. INFILL. | 2021 |
| 559 | NICHOLS | MARY ANN | JULY 9, 1830 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 559 | SLY | AZOR | APR. 21, 1845 | HEAD | MARBLE | TILTED/LOOSE IN BASE (BASE BELOW GRADE) | EXCAVATE. CLEAN. RESET BASE. MORTAR INTO BASE. | 1 |
| 559 | SLY | SARAH G. | APR. 1, 1849 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 561 | WILLIAMS | ABIEL H. | OCT. 15, 1848 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 561 | WILLIAMS | ALBERT C. | SEPT. 14, 1846 | HEAD | MARBLE | BROKEN/FALLEN/ DETERIORATING | SEARCH FOR BOTTOM FRAGMENT. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. CONSOLIDATE. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-------------------|--|--|--------|----------------------|---|--|---------|
| 561 | WILLIAMS | THOMAS A. | JUNE 10, 1845 | HEAD | MARBLE | TILTED | CLEAN. EXCAVATE. RESET. | 1 |
| 562 | LEDOIT | MRS. JOANNA | MAY 27, 1834 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 562 | ALLEN | MARY K. (ETC.) | FEB. 9, 1828 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 564 | WHITTEMORE | OLIVER P. | OCT. 28, 1849 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 564 | WHITTEMORE | LORENZO D. | AUG. 28, 1848 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 565 | HEATHCOTE | MARY A. | AUG. 31, 1861 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 565 | SEAGRAVE | ELIAS D. | OCT. 18, 1854 | HEAD | MARBLE/ CONCRETE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 567 | STARKEY | MILTON | APRIL 11, 1876 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 567 | STARKEY | LUCINDA | JUNE 18, 1864 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 568 | BALLOU/ WALKER | BETSEY JOSEPH L. REUBEN MATILDA | AUG. 21, 1922 1923 JUNE 5 DEC. 25, 1869 OCT. 27, 1869 | MON | MARBLE/ MARBLE | URN LOOSE ON MON. CARVER: M.D. MORRILL SOUTHBRIDGE | NO TREATMENT AT THIS TIME | 1 |
| 568 | BALLOU | BETSEY "MOTHER" | AUG. 21, 1922 | MARKER | MARBLE/ MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. (ROCK UNDERNEATH) | 1 |
| 568 | BALLOU | JOSEPH L. "FATHER" | JUNE 5, 1923 | MARKER | MARBLE/ MARBLE | TILTED/RAISED/ DIE LOOSE ON BASE. | CLEAN. RESET BASE. REPIN DIE (RESTING ON ROCKS) | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|------------|-----------|--------------------|---------------|--------|----------|-------------------------------|---|---------|
| 570 | LYONS? | BABY BOY | N/A | MARKER | MARBLE | LOOSE ON PINS | EXCAVATE. CLEAN. RESET. STABILIZE DIE. | 2 |
| 570 | LYON | JENNIE A. MARSH | MAY 26, 1886 | MARKER | MARBLE | SUNKEN/LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE HIGHER. REPIN. | 1 |
| 570 | LYON | SARAH A. EATON | JAN. 3, 1875 | MARKER | MARBLE | SUNKEN/LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE HIGHER. | 1 |
| 571 | NICHOLS | CHARLES P. | FEB. 12, 1834 | HEAD | MARBLE | BROKEN/TILTED | EXCAVATE. CLEAN. NEW BASE? SET BASE. MORTAR INTO BASE. | 1 |
| 571 | NICHOLS | LIBERTY | AUG. 23, 1872 | MON | MARBLE | TILTED/BROKEN/ SUNKEN | DISASSEMBLE. EXCAVATE LOWER BASE. REMOVE PINS. CLEAN. RESET BASES. DRILL AND PIN LOWER BOTTOM CORNER. DRILL AND PIN DIE TO MIDDLE BASE. INFILL. | 1 |
| 571 1/3 | OATLEY | AGNES NELSON | AUG. 31, 1880 | MON | MARBLE | LOOSE ON PINS/ BASE SUNKEN | DISASSEMBLE. EXCAVATE LOWER BASE. CLEAN. RESET THE TWO BASES. REMOVE PREVIOUS REPAIR. REPIN. INFILL. | 1 |
| 574 | WELD | CAPT. CALEB | SEPT. 8, 1850 | HEAD | MARBLE | BROKEN OUT OF BASE | EXCAVATE. CLEAN. NEW BASE. MORTAR INTO BASE. | 1 |
| 574 | WELD | LAURA | OCT. 16, 1834 | HEAD | SLATE | TILTED/ DELAMINATING | EXCAVATE. CLEAN. RESET. CAP. | 2018 |
| 574 | WELD | LEVI | DEC. 27, 1829 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|-------------|----------------|------|------------------------------------|---|--|---------|
| 574 | BUXTON | LENA WELD | FEB. 8, 1932 | MON | GRANITE/ CONCRETE FOUNDATION | TILTED | DISASSEMBLE. MOVE MONUMENT OFF FOUNDATION. LEVEL FOUNDATION. REASSEMBLE. CLEAN | 1 |
| 576 | GIFFORD | EDE ANN F. | APRIL 12, 1843 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 576 | MORSE | HENRY | JULY 11, 1860 | HEAD | MARBLE/ CONCRETE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 576 | MORSE | LUCY | JULY 2, 1840 | HEAD | MARBLE/? | TILTED/BROKEN/ DETERIORATING ALONG BREAK | EXCAVATE. CLEAN. RESET BASE. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 576 | MORSE | FAUSTINA T. | MAR. 5, 1879 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2019 |
| 576 | MORSE | ANDREW J. | SEPT. 2, 1911 | MON | MARBLE | TILTED | EXCAVATE. CLEAN. BRING TO LEVEL. | 1 |
| 576 | MORSE | LINUS E. | OCT. 6, 1853 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 577 | FAY | MRS. AZUBAH | JUNE 29, 1840 | HEAD | MARBLE | TILTED/BROKEN CARVER: TOMLINSON (STURBRIDGE) | EXCAVATE. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 2020 |
| 577 | LIVINGSTON | MARY A. | JUNE 7, 1849 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 578 | BARROWS | NAOMI | NOV. 30, 1888 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 578 | BARROWS | MARIA A. | APRIL 18, 1888 | MON | MARBLE | MIDDLE BASE CRACKED | CLEAN. INFILL. STABILIZE. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|------------|-----------|-------------------|----------------|--------------|----------|------------------------|---|---------|
| 578 | LINCOLN | JULIA E. AVERY | APRIL 29, 1889 | MON | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |
| 578 | LINCOLN | EMMA C. | JULY 25, 1879 | MON | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2020 |
| 578 | FRANCIS | IDA S. LINCOLN | JULY 6, 1831 | MON | GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |
| 579 | DYER | MRS. SYBIEL | DEC. 22, 1841 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 579 1/3 | BARLOW | HATTIE | DEC. 18, 1878 | SMALL MON | MARBLE | TILTED/LOOSE ON PIN | DISASSEMBLE. CLEAN. RESET BASE. IF POSSIBLE, REPLACE PIN. REASSEMBLE. | 1 |
| 579 1/3 | BARLOW | HARRIET | AUG. 10, 1881 | SMALL MON | MARBLE | TILTED/LOOSE ON PIN | DISASSEMBLE. CLEAN. RESET BASE. IF POSSIBLE, REPLACE PIN. REASSEMBLE. | 1 |
| 581 | FISKE | ANN L. | FEB. 17, 1863 | HEAD | MARBLE | FALLEN/BASE MISSING | CLEAN. NEW IN-GROUND BASE. MORTAR INTO BASE. | 1 |
| 581 | FISKE | CATHERINE SHAW | 1892 | MON | GRANITE | TILTED | EXCAVATE. CLEAN. BRING TO LEVEL. | 1 |
| 581 | WOOD | MARY F. | NOV. 21, 1901 | SMALL MON | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET HIGHER | 1 |
| 581 | WOOD | IDA F. | JUNE 10, 1891 | MON | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------|----------------|------------------|----------------------|--------------------------------|--|---------|
| 581 | HEBARD | EUNICE B. FISKE | SEPT. 25, 1855 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 581 | HEBARD | LUCIUS | DEC. 21, 1855 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 584 | MARSH | CANDACE | FEB. 20, 1828 | MARKER | MARBLE/ MARBLE/ | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 584 | MARSH | JOHN E. | AUG. 30, 1869 | MARKER | MARBLE/ MARBLE | BROKEN PINS | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 584 | MARSH | CALISTA B. | MAR. 12, 1887 | MARKER | MARBLE/ MARBLE | LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 584 | MARSH | MOSES "FATHER" | JULY 2, 1839 | MARKER | MARBLE/ MARBLE | BROKEN PINS | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 584 | MARSH | CLARENCE H. | AUG. 14, 1866 | MARKER | MARBLE/ MARBLE | SUNKEN? LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 585 | BULLOCK | ABIGAIL C. | AUG. 10, 1838 | HEAD | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 585 | BULLOCK | LOUISA L. | JAN. 27, 1868 | HEAD | MARBLE/ GRANITE | TILTED/MAY BE LOOSE IN BASE | EXCAVATE. CLEAN. RESET. | 1 |
| 585 | BULLOCK | MARY CECILIA | NOV. 20, 1895 | MON. W. CROSS | MARBLE | TILTED/SUNKEN | EXCAVATE. BRING TO LEVEL HIGHER. CLEAN. | 1 |
| 585 | HUDSON | LOUISA B. | JULY 30, 1847 | HEAD | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|--------------------------|----------------|--------|----------------------|--|---|---------|
| 586 | NICHOLS | CORNELIA | DEC. 22, 1859 | HEAD | MARBLE | TILTED/LOOSE IN BASE (BELOW GRADE) | EXCAVATE. REMOVE STONE FROM SLOT. EXCAVATE BASE. CLEAN. RESET BASE HIGHER. MORTAR INTO BASE. | 1 |
| 587 | HOOKER | CAPT. LEMUEL "FATHER" | JAN. 8, 1855 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET HIGHER. | 1 |
| 587 | HOOKER | ABIGAIL H. "MOTHER" | JULY 21, 1867 | MARKER | MARBLE | SUNKEN | EXCAVATE. CLEAN. RESET HIGHER. | 1 |
| 587 | LAMB | WILLIAM T. "HUSBAND" | DEC. 21, 1891 | MARKER | MARBLE | SUNKEN/LOOSE ON PINS | EXCAVATE. CLEAN. RESET BASE HIGHER. REPIN. | 1 |
| 588 | WIGHT | WINTHROP | AUG. 4, 1873 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 588 | WIGHT | LOUISA B. | AUG. 10, 1874 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 588 | WIGHT | CAROLINE L. | JAN. 2, 1851 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 588 | WIGHT | MARY A. | JULY 1, 1861 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |
| 588 | WIGHT | MARY A. | MAY 10, 1924 | HEAD | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |
| 588 | WIGHT | LEVINS R. | JULY 24, 1876 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |
| 588 | WIGHT | CHARLES P. | APRIL 22, 1856 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET HIGHER. (MAY NEED A NEW BASE). | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|------------|-----------|-------------|----------------|--------|-----------------------|---------------|---|---------|
| 589 | WOODWARD | HENRY J. | AUG. 2, 1900 | MON | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2 |
| 589 | RICHARDS | CAROLINE S. | MAY 30, 1840 | HEAD | MARBLE/ BROWNSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 589 | SMITH | ANDREW B. | APRIL 24, 1917 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 589 | SMITH | HERBERT A. | FEB. 13, 1882 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 590 | STREETER | LUCENA | JULY 16, 1852 | MARKER | MARBLE | TILTED/BROKEN | EXCAVATE. CLEAN. USE ORIGINAL PINS. RESET BASE. DRILL AND PIN DIE. PIN DIE TO BASE. INFILL. | 2018 |
| 590 | STREETER | ALBERT C, | MAR. 1, 1893 | MARKER | MARBLE | TILTED/BROKEN | EXCAVATE. CLEAN. USE ORIGINAL PIN. RESET BASE. DRILL AND PIN DIE. PIN DIE TO BASE. INFILL. | 2018 |
| 590 | STREETER | MERRICK L. | APRIL 12, 1893 | MARKER | MARBLE | TILTED/BROKEN | EXCAVATE. CLEAN. REPLACE PIN. RESET BASE. DRILL AND PIN DIE. PIN DIE TO BASE. INFILL. | 2017 |
| 590 1/3 | PLACE | ANDRUS | MAY 7, 1891 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |
| 591 | FULLER | ADELAIDE | APRIL 27, 1842 | HEAD | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |
| 591 | FULLER | LOUISE GAY | FEB. 5, 1837 | HEAD | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|------------|-----------|---------------------|--------------------------------|--------------|----------|--|--|---------|
| 592 | FAIRBANKS | MARTHA TRUE | JAN. 21, 1929 | HEAD | MARBLE | LOOSE ON PINS/ SUNKEN | EXCAVATE. CLEAN. RESET BASE HIGHER. REPIN. | 1 |
| 592 | FAIRBANKS | JOHN ALBERT | FEB. 21, 1914 | HEAD | MARBLE | TILTED/PINS MISSING | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 592 | FAIRBANKS | SAMUEL | MAY 11, 1891 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 592 | FAIRBANKS | LUCINDA EMILY R. | NOV. 11, 1851 NOV. 30, 1863 | FOOT | MARBLE | TILTED/OUT OF LOCATION | EXCAVATE. CLEAN. RESET NEXT TO HEADSTONE | 1 |
| 593 | PELLET | LUTHER P. | JULY 28, 1839 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 593 1/3 | SMITH | ORLANDO P. | APRIL 25, 1843 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 593 1/3 | RIDGEWAY | NANCY | MAY 25, 1894 | HEAD | MARBLE | BROKEN/ DETERIORATING | REMOVE DIE. EXCAVATE AND DISCARD CONCRETE. CLEAN DIE. NEW BASE. SET BASE. MORTAR INTO BASE. | 1 |
| 593 1/3 | RIDGEWAY | ALBERT E. | SEPT. 5, 1875 | SMALL MON | MARBLE | TILTED/LOOSE ON BASE (RAISED ON PINS) | EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 593 1/3 | RIDGEWAY | GEORGE W. | JAN. 28, 1878 | SMALL MON | MARBLE | TILTED/LOOSE ON PIN | EXCAVATE. CLEAN. RESET BASE. REPIN ONE PIN AND REPLACE OTHER PIN. | 1 |
| 594 | ROPER | CHARLES | AUG. 16, 1898 | MON | MARBLE | TILTED/SUNKEN (DIE AND BASE FIRMLY JOINED) | EXCAVATE BASE AND DIE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|-----------------------|---------------|------|----------------------|---|--|---------|
| 595 | PIERCE | MARY H. | MAY 18, 1844 | HEAD | MARBLE | FALLEN/BROKEN | EXCAVATE AND INVESTIGATE. BASE BELOW GRADE? NEW BASE? REMOVE PREVIOUS REPAIR (CON- CRETE AND ROCKS) CLEAN. SET BASE. MORTAR INTO BASE. | 1 |
| 595 | PIERCE | SERENA E. | MAR. 8, 1854 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 596 | BIGGS, JR. | S. H. | N/A | HEAD | MARBLE | TILTED (MILITARY CO. 14TH R.I. INF.) | EXCAVATE. CLEAN. RESET. | 2 |
| 596 | STONE | SALLY | DEC. 3, 1878 | HEAD | MARBLE | TILTED/BROKEN OUT OF BASE | EXCAVATE DIE AD BASE. CLEAN DIE. NEW BASE. SET BASE. MORTAR INTO BASE. | 1 |
| 596 | STONE | SIMON | NOV. 1, 1876 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 599 | MORSE | C. ALBERTA JARDINE | OCT. 20, 1913 | MON | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 599 | MORSE | DOROTHY F. | MAY 26, 1916 | MON | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 599 | SOUTHWICK | SARAH E. NICHOLS | FEB. 15, 1937 | MON | MARBLE | TILTED/PINS MISSING/SUNKEN | REMOVE DIE. EXCAVATE THE TWO BASES. CLEAN. RESET TWO BASES. PIN. | 1 |
| 599 | SOUTHWICK | FARNUM | MAY 29, 1897 | MON | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 600 | WELD | ELIZABETH B. | NOV. 5, 1876 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|------------|-----------|-------------------------|---------------------------------|--------|----------------------|-----------------------------------|--|---------|
| 600 | WELD | FRANCIS | JULY 14, 1900 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 601 | WELD | BENJAMIN C. "FATHER" | MAR. 23, 1908 | MARKER | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET FURTHER IN FROM ROAD | 1 |
| 601 | WELD | LUCY A. "MOTHER" | MAY 15, 1893 | MARKER | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET FURTHER IN FROM ROAD | 1 |
| 601 | WELD | BENJAMIN D. "FATHER" | MAR. 2, 1879 | MARKER | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 601 | WELD | ISAAC P. "BROTHER" | OCT. 22, 1849 | MARKER | MARBLE/ GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 603 | BULLARD | EDWIN C. | JUNE 24, 1833 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 603 | BULLARD | EMILY | NOV. 28, 1852 | HEAD | MARBLE/ CONCRETE | FALLEN | REMOVE CONCRETE PUDDLE. CLEAN. NEW IN GROUND BASE. MORTAR INTO BASE. | 2016 |
| 603 | WALKER | SARAH CHESTER | MAR. 23, 1889 APRIL 23, 1889 | MON | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2 |
| 604 | PLIMPTON | FRANCES V. | OCT. 23, 1864 | MARKER | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 605 2/3 | HOLMES | DANIEL F. | JAN. 20, 1854 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |
| 605 2/3 | HOLMES | GEORGE | APRIL 29, 1859 | HEAD | MARBLE/ SANDSTONE | SEVERELY TILTED/ LOOSE IN BASE | DISASSEMBLE. EXCAVATE BASE. CLEAN. RESET BASE. MORTAR INTO BASE. | 2018 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------|----------------|------------------|----------------------|--------------|-------------------------------------|---------|
| 605 | ? | ADDISON | N/A | MARKER | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 2/3 | | | | | | | | |
| 606 | DRAKE | HORATIO | JUNE 19, 1855 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 606 | DRAKE | PRUDENCE | AUG. 15, 1848 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 606 | DRAKE | SYLVIA O. | SEPT. 15, 1841 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2020 |
| 606 | DRAKE | MARY EUNICE | SEPT. 21, 1837 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2020 |
| 606 | DRAKE | AMANDA J. | MAY 7, 1886 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 606 | DRAKE | EDMUND O. | SEPT. 15, 1837 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2021 |
| 607 | BROOKS | BENJAMIN | APRIL 22, 1852 | HEAD | MARBLE/ CONCRETE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2020 |
| 607 | BROOKS | ESTHER | JUNE 16, 1863 | HEAD | MARBLE/ GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2020 |
| 607 | BROOKS | DORCUS C. | FEB. 1, 1846 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2020 |
| 607 | BROOKS | GEORGIE (ETC.) | DEC. 22, 1860 | SMALL OBELISK | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2020 |
| 608 | WOOD | GEORGE W. | NOV. 18, 1839 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 608 | WOOD | LOUISA J. | DEC. 7, 1836 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| | | | | | | | | |
| | | | | | | | | |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---------------------|----------------|------|----------|----------------------------------|--|---------|
| 609 | KNIGHT | W.E.L. | APRIL 20, 1876 | MON | MARBLE | BROKEN/LOOSE ON BASE | DISASSEMBLE. (KEEP MIDDLE AND LOWER BASES JOINED) CLEAN. RESET MIDDLE AND LOWER BASES. REMOVE OLD PINS AND PREVIOUS REPAIR. DRILL AND PIN LOWER FRAGMENT OF DIE TO MIDDLE BASE. DRILL TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 609 | HILL | CORA A. | NOV. 11, 1869 | HEAD | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. NEW BASE? SET BASE. MORTAR INTO BASE. | 1 |
| 610 | BENSON | LEWIS H. | SEPT. 5, 1886 | HEAD | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. (AVOID SEPARATING PREVIOUS REPAIR) | 1 |
| 610 | BENSON | MARY M. COMSTOCK | MAR. 1, 1902 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 610 | BENSON | JULIA A. | OCT. 20, 1840 | HEAD | MARBLE | BROKEN | EXCAVATE. RESET BASE WITH BOTTOM FRAGMENT. REMOVE PREVIOUS REPAIR. CLEAN. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 611 | VINTON | GEORGE W. | JULY 12, 1863 | HEAD | MARBLE | TILTED/SLIGHTLY LOOSE IN BASE | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|----------------------|----------------|------|----------------------|--------------------------------|---|---------|
| 611 | VINTON | DOROTHY CONVERSE | JULY 1, 1905 | MON | GRANITE | TILTED | SET MONUMENT ASIDE. NEW FOUNDATION. CLEAN. RESET MONUMENT. (NEEDS LIFTING EQUIPMENT) | 1 |
| 613 | SMITH | MORTON | MAY 30, 1843 | HEAD | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET HIGHER. | 2 |
| 613 | SMITH | ESMOND | SEPT. 22, 1873 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET HIGHER. | 2 |
| 613 | SMITH | ELLEN M. | NOV. 15, 1874 | MON? | MARBLE/ ? | SUNKEN | EXCAVATE AND EVALUATE. CLEAN. RESET? NEW BASE? | 2 |
| 614 | WILCOX | HELEN R. GIFFORD | AUG. 9, 1891 | MON | MARBLE | TILTED/LOOSE ON PIN | REMOVE DIE. EXCAVATE BASE. CLEAN. RESET BASE. REPIN. | 1 |
| 614 | ARNOLD | ANN ELIZA GIFFORD | DEC. 30, 1870 | HEAD | MARBLE | TILTED/LOOSE IN BASE | EXCAVATE. DISASSEMBLE? CLEAN. RESET BASE. MORTAR INTO BASE. | 1 |
| 614 | GIFFORD | MARY A. | MAY 21, 1869 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 616 | TAYLOR | HERBERT | SEPT. 18, 1850 | HEAD | MARBLE/ SANDSTONE | TILTED/LOOSE IN BASE/SUNKEN | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN, RESET BASE. MORTAR INTO BASE. | 2016 |
| 616 | TAYLOR | ELLA | SEPT. 20, 1849 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. MORTAR INTO BASE. | 2016 |
| 616 | HOWARD | SALLY B. | AUG. 14, 1862 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2016 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|------------------------|----------------|--------|----------------------|--|--|---------|
| 616 | HOWARD | EBENEZER | MAY 10, 1854 | HEAD | MARBLE | TILTED/OUT OF BASE | EXCAVATE. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 2016 |
| 617 | WALKER | NATHANIEL | JULY 14, 1857 | HEAD | MARBLE | BROKEN/TILTED | EXCAVATE. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 2016 |
| 617 | WALKER | MRS. ELIZABETH | AUG. 31, 1836 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2016 |
| 617 | PLIMPTON | ROSETTA BACK HARRIS | APRIL 23, 1924 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2017 |
| 617 | PLIMPTON | NATHANIEL W. | JUNE 29, 1869 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2017 |
| 617 | PLIMPTON | CHILDREN | 1864 | OBELSK | MARBLE/ SANDSTONE | TILTED/MIDDLE BASE OFFSET CARVER: SANFORD AND CO., WEBSTER | DISASSEMBLE. CLEAN. NEW DEEP WELL-COMPACTED SAND AND PEASTONE FOUNDATION. RESET BASE. REASSEMBLE. (HEAVY) | 2016 |
| 617 | PLIMPTON | EVELINA W. | APRIL 27, 1869 | MARKER | MARBLE | FOUND BURIED | CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 2016 |
| 617 | PLIMPTON | GEORGIE M. | MAY 6, 1869 | MARKER | MARBLE | FOUND BURIED | CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 2016 |
| 618 | NICHOLS | LIEUT. HENRY W. | MAY 12, 1864 | MON | MARBLE/ GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 2018 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|------------------------|-----------------------|--------------|----------------------|--------------------------------|--|---------|
| 618 | NICHOLS | GRACE M. | DEC. 6, 1949 | MON | GRANITE | TILTED/DIE OFFSET | EXCAVATE. BRING TO LEVEL. CENTER DIE. CLEAN. | 2018 |
| 619 | FREEMAN | CAPT. PLINY | OCT. 10, 1855 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2018 |
| 619 | FREEMAN | MRS. DELIA | MAR. 19, 1839 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 620 | LYON | HANNAH | NOV. 20, 1842 | HEAD | MARBLE | CARVER: F. COOLEY, PROV. | NO TREATMENT AT THIS TIME | |
| 620 | SEVERY | GEORGE W. MARY JANE | APRIL 5, 1911 1910 | SMALL MON | MARBLE | TILTED/DIE LOOSE ON PINS | DISASSEMBLE. CLEAN. RESET BASE. REPIN DIE TO BASE. | 2018 |
| 620 | N/A | N/A | N/A | FOOT FRAG | MARBLE | LOOSE IN GROUND | CLEAN. DRILL AND PIN. RESET. INFILL. | 2018 |
| 621 | AMES | DAVIS | AUG. 14, 1840 | HEAD | MARBLE/ SANDSTONE | TILTING (DUE TO TREE ROOTS) | EXCAVATE. CLEAN. RESET FURTHER FROM TREE ROOTS. | 1 |
| 621 | AMES | HARRIET | MAR. 6, 1856 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 621 | WRIGHT | ALPHEUS | SEPT. 27, 1859 | HEAD | MARBLE/ SANDSTONE | FALLEN | EXCAVATE. CLEAN. RESET BASE. DRILL AND PIN TOP FRAGMENT TO BOTTOM (IN BASE) | 2021 |
| 621 | WRIGHT | ALPHEUS | SEPT. 27, 1859 | FOOT | MARBLE | BROKEN/FALLEN/ SUNKEN | EXCAVATE. CLEAN. RESET BOTTOM FRAGMENT. DRILL AND PIN TWO FRAGMENTS TO TOP OF RESET FRAGMENT. INFILL. | 2021 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|----------------|--------------------------------|------|----------|----------------------------|--|---------|
| 621 | WRIGHT | PHEBE | OCT. 18, 1857 | HEAD | MARBLE | TILTED/ OUT OF BASE | EXCAVATE STONE AND BASE. CLEAN. RESET BASE. MORTAR INTO BASE. | 2021 |
| 621F | WRIGHT | PHEBE | OCT. 18, 1857 | FOOT | MARBLE | FALLEN/BURIED WITH BASE | EXCAVATE. CLEAN. RESET. | 2021 |
| 621 | WRIGHT | LUMAN LYMAN | AUG. 26, 1858 AUG. 26, 1858 | FOOT | MARBLE | FALLEN | CLEAN. RESET BEHIND HEADSTONE. | 2021 |
| 622 | STOCKWELL | HEPSIBAH | AUG. 5, 1856 | HEAD | MARBLE | BROKEN | EXCAVATE BASE AND BOTTOM FRAGMENT. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE AND BOTTOM FRAGMENT. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 622 | STOCKWELL | ANN | JULY 9, 1860 | HEAD | MARBLE | BROKEN (DOUBLE BREAK) | EXCAVATE. CLEAN. EVALUATE. DRILL AND PIN. (MAY NEED A NEW BASE). INFILL. | 1 |
| 622 | STOCKWELL | LUCINA L. | JULY 3, 1871 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 622 | STOCKWELL | DAVID E. | MARCH 3, 1841 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 622 | HOWARD | ARTHUR H. | OCT. 27, 1861 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 626 | GIBBS | HIRAM | MAR. 9, 1843 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 626 | GIBBS | LYMAN | DEC. 1, 1836 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 626 | LOMBARD | ELIZA P. | DEC. 5, 1859 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-----------------------|------------------------------|------------------------|----------------------|--|---|--------------|
| 628 | HOLMES | LEMUEL L. | AUG. 14, 1874 | SMALL MON (LAMB) | MARBLE/ SANDSTONE | BROKEN (MARBLE BASE) | DISASSEMBLE. EXCAVATE SAND- STONE BASE. CLEAN. RESET SAND- STONE BASE. DRILL AND PIN MARBLE BASE. PIN REPAIRED MARBLE BASE TO SANDSTONE BASE. REMOVE IRON PIN FROM DIE. PIN DIE TO MARBLE BASE. INFILL. | 1 |
| 629 | LYON | PAMELA | JUNE 13, 1834 | HEAD | MARBLE | BROKEN | REMOVE TWO ATTEMPTS AT PREVIOUS REPAIR. CLEAN. DRILL AND PIN. INFILL. | 2016 |
| | | | | | | BROKEN IN TREE REMOVAL ACCIDENT 2018 | EXTENSIVE CONSERVATION REPAIRS. | 2020 |
| 629 | LYON | CHARLES MARCIA ANN | JUNE 18, 1837 MAY 7, 1842 | HEAD | MARBLE | BROKEN IN TREE REMOVAL ACCIDENT 2018 | CLEAN. EXTENSIVE CONSERVATION REPAIRS. | 2020 |
| 629 | LYON | DEACON EHPRAIM M. | MAY 15, 1871 | HEAD | MARBLE | | BRING TO LEVEL WITH CARE NOT TO DISTURB PREVIOUS REPAIR. CLEAN. EXTENSIVE CONSERVATION REPAIRS | 2016 2020 |
| 629 | LYON | EPHRAIM. M. | MAY 16, 1839 | HEAD | MARBLE | BROKEN IN TREE REMOVAL ACCIDENT 2018 | EXCAVATE. CLEAN. RESET. EXTENSIVE CONSERVATION REPAIRS. | 2 2020 |
| 629 | LYON | PAMELA JANE | NOV. 27, 1835 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2016 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------|----------------|-----------------|----------------------|-----------------------------------|---|---------|
| 629 | LYON | THOMAS | DEC. 29, 1858 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 629 | LYON | ACHSAH | FEB. 17, 1846 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 630 | SHUMWAY | ABIJAH | APR. 21, 1869 | DOUBLE | MARBLE | BROKEN/ FALLEN OFF BASE | EXCAVATE. NEW CUSTOM CONCRETE PAD. CLEAN. DRILL AND PIN STONE TO CONCRETE PAD. | 2020 |
| | | RUTH MOORE | MAR. 12, 1886 | HEAD | | | | |
| 630 | SHUMWAY | MISS NANCY | JUNE 28, 1835 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. BURY UNUSED FRAGMENTS. | 2021 |
| 630 | SHUMWAY | MARY CAROLINE | N/A | HEAD | MARBLE | TILTED/BASE MISSING | EXCAVATE. CLEAN. NEW IN- GROUND BASE. MORTAR INTO BASE. | 2016 |
| 632 | JOHNSON | DWIGHT P. | MAR. 18, 1883 | HEAD | MARBLE | TILTED/SLIGHTLY LOOSE IN BASE. | EXCAVATE. CLEAN. RESET. | 2016 |
| 632 | JOHNSON | ALVINA E. | MAR. 28, 1840 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2017 |
| 632 | JOHNSON | CAROLINE A. | APRIL 17, 1870 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2017 |
| 632 | REMINGTON | GEORGE | MAY 7, 1893 | HEAD | MARBLE/ SANDSTONE | TILTED/LOOSE IN BASE | EXCAVATE. CLEAN. RESET STONE AND BASE. STABILIZE STONE IN BASE. INFILL VOIDS IN SLOT. | 2017 |
| 633 | CARDER | DORAANTHA H.T. | MAY 6, 1840 | FOOT/ MARKER | MARBLE | BURIED | EXCAVATE. IDENTIFY. CLEAN. RESET NEAR FAMILY MONUMENT. | 2020 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------|------------|---------------|--------------|----------|---------------|--|---------|
| 634 | MARCY | FREDERICK | DEC. 14, 1856 | HEAD | MARBLE | TILTED/BROKEN | EXCAVATE. BOTTOM FRAGMENT MAY BE IN BASE. CLEAN. RESET BASE. DRILL AND PIN? MORTAR INTO BASE? INFILL. | 1 |
| 635 | CHICKERING | ELZAFIEN | MAY 22, 1849 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 635 | CHICKERING | ASENATH W. | FEB. 6, 1910 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 635 | CHICKERING | HENRY | AUG. 22, 1881 | HEAD | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |
| 636 | CLARK | FRANK E. | MAR. 16, 1897 | SMALL MON | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 636 | GEROULD | CHARLES | DEC. 31, 1900 | MARKER | GRANITE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 637 | PLYMPTON | MARY J. | FEB. 19, 1893 | SMALL MON | MARBLE | LOOSE ON PINS | SET DIE ASIDE. CLEAN. RE-PIN. | 1 |
| 637 | PLYMPTON | CHARLOTTE | NOV. 13, 1870 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 637 | UPHAM | LEWIS | JULY 4, 1892 | MON | GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |
| 637 | GUILFORD | CLARRISA | DEC. 23, 1889 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 639 | WILLIAMS | EMERLY | NOV. 14, 1843 | HEAD | MARBLE | TILTED/SUNKEN | CLEAN. RESET | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|----------------------|--------------------------------|-----------------|----------------------|--|---|---------|
| 639 | CONE | JULIA E. HELEN L. | AUG. 6, 1853 DEC. 20, 1854 | MON | MARBLE/ SANDSTONE | TILTED/ SLIPPED ON BASE | DISASSEMBLE. CLEAN. SET BASE. REASSEMBLE. | 1 |
| 640 | MERRICK | THOMAS MARY | FEB. 27, 1849 FEB. 11, 1847 | MON (COLUMN) | MARBLE/ MARBLE | TILTED/ELEMENT NOW OFFSET. | DISASSEMBLE. CLEAN. NEW FOUNDATION. REASSEMBLE (LIFTING EQUIPMENT) | 1 |
| 640 | MERRICK | LUCY | JUNE 25, 1897 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. RESET. (HAS FOUNDATION. NEEDS LIFTING EQUIPMENT) | 1 |
| 640 | SMITH | EMMA KATE MERRICK | JUNE 27, 1865 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. BRING TO LEVEL? RESET? CLEAN. FOUNDATION? (NEEDS LIFTING EQUIPMENT) | 1 |
| 640? | MACOMBER | MARY C. MERRICK | 1932 | MON | MARBLE/ MARBLE | TILTED | SET ASIDE MON. EXCAVATE. CLEAN. NEW FOUNDATION. SET MON ON NEW FOUNDATION. | 1 |
| 640 | BELKNAP | ADELINE | NOV. 21, 1844 | HEAD | MARBLE | TILTED/LOOSE IN BASE. CARVER: J.B. GRISWOLD | EXCAVATE. CLEAN. RESET BASE. MORTAR INTO BASE. | 1 |
| 641 | COREY | MARY HAYNES | DEC. 7, 1874 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 641 | COREY | DR. JACOB | OCT. 31, 1841 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 641 | COREY | CHARLOTTE F. | MAY 15, 1834 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|--------------------|-----------------------------------|--------------|----------------------|-----------------------------------|---|---------|
| 641 | COREY | ELIZA | JUNE 25, 1834 | HEAD | MARBLE | FALLEN/BROKEN (FOUR FRAGMENTS) | EXCAVATE. REMOVE CONCRETE. CLEAN. NEW BASE. MORTAR BOTTOM FRAGMENT INTO BASE. DRILL AND PIN FRAGMENTS. INFILL. | 1 |
| 641 | COREY | G. GORDON | MAR. 31, 1907 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 642 | DRAPER | GEORGE W. | MAR. 16, 1853 | SMALL MON | MARBLE/ SANDSTONE | TILTED/LOOSE ON BASE | DISASSEMBLE. EXCAVATE BASE. REMOVE PREVIOUS REPAIR. CLEAN. RESET. MORTAR INTO BASE. | 2020 |
| | | INFANT SON | NOV. 30, 1852 | | | | | |
| 643 | BURGESS | LUTHER | MAR. 25, 1871 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2021 |
| 643 | BURGESS | PRUDENCE EARL | FEB. 23, 1880 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE AND BRING TO LEVEL. CLEAN. (CAUTION ON PREVIOUS REPAIR) | 2021 |
| 643 | BURGESS | INFANT SAMANTHA | JAN. 12, 1831 MAR. 21, 1832 | HEAD | MARBLE | BROKEN | EXCAVATE. NEW BASE. SET BASE. PIN DIE TO BASE. LANDSCAPE. | 2018 |
| 643 | MACOMBER | MARY E. | SEPT. 15, 1870 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 643 | MACOMBER | WILLIAM HENRY | AUG. 16, 1850 | HEAD | MARBLE/ SANDSTONE | FALLEN/BASE BROKEN | EXCAVATE. CLEAN. DRILL AND PIN BASE. PIN DIE INTO RESET BASE. INFILL. | 2018 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|------------------------|--------------------|---------------|--------|----------------------|------------------------------|--|---------|
| 644 | CONGDON | MARY | FEB. 1, 1852 | HEAD | MARBLE | TILTED/LOOSE IN BASE | EXCAVATE. CLEAN. RESET BASE. MORTAR INTO BASE. STABILIZE DIE. | 2021 |
| 644 | SHELDON | MARY | FEB. 6, 1858 | HEAD | MARBLE/ SANDSTONE | BROKEN/FALLEN | EXCAVATE BASE AND BOTTOM FRAGMENT. REMOVE PREVIOUS REPAIR. CLEAN. RESET BASE. DRILL AND PIN ALL FRAGMENTS. INFILL. | 2021 |
| 645 | KEACH | NATHAN N. | MAY 29, 1879 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 645 | KEACH | LUCY L. | JUNE 7, 1905 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 646 | SMITH | EDWIN H. | JUNE 29, 1879 | HEAD | MARBLE | TILTED (MILITARY MARKER) | EXCAVATE. CLEAN. RESET. | 2 |
| 646 | SMITH | MARY A. | DEC. 12, 1893 | MON | MARBLE | ONLY A MARBLE BASE EXTANT | NO TREATMENT UNLESS DIE IS DISCOVERED. | N/A |
| 651 | JAMES | CAROLINE S. | AUG. 16, 1840 | HEAD | SLATE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 651 | JAMES | BETSEY | NOV. 30, 1853 | HEAD | MARBLE/? | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 653 | BUSHNELL/ HITCHCOCK | HOWARD A. (ETC) | 1843-1986 | MON | MARBLE | OUT OF ALIGNMENT | REALIGN MIDDLE BASE AND SHAFT ON MIDDLE BASE. | 1 |
| 653 | BRAMAN | J.M. | 1930 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 653 | BUSHNELL | IOLA | OCT. 20, 1955 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 653 | HITCHCOCK | EATON | MAR. 9, 1872 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---|--------------------------------|---------|-----------------------------|------------------------|--|---------|
| 653 | BUSHNELL | JANE W. | JAN. 11, 1917 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET | 1 |
| 654 | HARDING | STEPHEN | SEPT. 18, 1845 | HEAD | MARBLE | BROKEN | REMOVE PREVIOUS REPAIR. CLEAN. DRILL AND PIN. INFILL. | 1 |
| 654 | HARDING | AUGUSTA | AUG. 9, 1880 | HEAD | MARBLE/ GRANITE | TILTED/ SUNKEN | EXCAVATE. EVALUATE. NEW BASE. CLEAN. SET BASE. MORTAR INTO BASE. | 2020 |
| 655 | HOLBROOK | DEA. ELIAS | JAN. 17, 1870 | HEAD | MARBLE/ CONCRETE MASS | BROKEN/FALLEN | EXCAVATE, CLEAN, DRILL AND PIN, INFILL | 2020 |
| 657 | BACON | DIANTHA P. | JAN. 26, 1841 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2019 |
| 658 | SNELL | BATHSHEBA | NOV. 3, 1873 | MARKER | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 658 | SNELL | THOMAS BATHSHEBA (ETC.) | SEPT. 15, 1885 NOV. 3, 1873 | OBELISK | MARBLE/ SANDSTONE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. | 1 |
| 658 | SNELL | THOMAS OTIS CLARISSA CROWELL STONE | OCT. 22, 1859 OCT. 26, 1908 | MON | GRANITE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. (HEAVY). | 1 |
| 659 | JOHNSON | SALLY B. | FEB. 21, 1893 | MON | MARBLE | TILTED/PINS MISSING | DISASSEMBLE. EXCAVATE MARBLE BASES. CLEAN. RESET MARBLE BASES. RE-PIN DIE TO MIDDLE BASE. | 1 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---------------------------------|-------------------------------|---------------|----------------------|--|--|---------|
| 659 | JOHNSON | HENRY E. | JULY 21, 1847 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 659 | LADD | NOAH D. "FATHER" | JUNE 30, 1897 | MARKER | MARBLE | TILTED/LOOSE ON BASE | EXCAVATE. CLEAN. RESET BASE. RE-PIN. | 1 |
| 660 | LADD | FESTUS "FATHER" | JULY 13, 1874 | MARKER | SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 660 | LADD | LYDIA MARSH | FEB. 19, 1867 | MARKER | SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 660 | WIGHT | LYDIA | AUG. 27, 1847 | MARKER | SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 661 | ALLEN | LIBERTY ELIZABETH ALDRICH | MAY 24, 1901 FEB. 25, 1888 | DOUBLE MON | MARBLE | TILTED (A BOTTOM BASE BELOW GRADE) | EXCAVATE. IF POSSIBLE BRING ENTIRE MONUMENT UP TO LEVEL. CLEAN. (HEAVY). | 1 |
| 661 | CHENEY | LORINDA ALLEN | JULY 11, 1892 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 661 | ALLEN | BABY | DEC. 14, 1893 | HEAD | MARBLE | TILTED (WM. L. ALLEN FAMILY) | EXCAVATE. CLEAN. RESET. | 2 |
| 661 | CONVERSE | LEWIS PORTER | DEC. 30, 1928 | MARKER | MARBLE/ MARBLE | TILTED/ LOOSE ON PINS | DISASSEMBLE. EXCAVATE. CLEAN. RESET BASE. REPIN. | 1 |
| 663 | WELD | GEORGE "HUSBAND" | DEC. 12, 1878 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET HIGHER | 1 |
| 663 | WELD | LUCIA | SEPT. 30, 1898 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|------------------|---------------------------------|------|----------------------|-----------------------------------|---|---------|
| 663 | WELD | GEORGE LUCIA | DEC. 12, 1878 SEPT. 30, 1898 | MON | MARBLE/ GRANITE | URN IS LOOSE | CLEAN. REPIN URN | 1 |
| 665 | HITCHCOCK | ADALINE A. | MAR. 2, 1899 | MON | MARBLE/ GRANITE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET | 2 |
| 666 | WESTGATE | J. EARL | MAR. 26, 1843 | HEAD | MARBLE | FALLEN/BROKEN/ OUT OF LOCATION | FIND LOCATION. EXCAVATE BOTTOM FRAGMENT. CLEAN. DRILL AND PIN. INFILL. | 2019 |
| 666 | WESTGATE | LUCY "MOTHER" | DEC. 14, 1880 | MON | MARBLE | BROKEN MIDDLE BASE | CLEAN. INVESTIGATE BREAK. DRILL AND PIN BASE FRAGMENT. INFILL. | 1 |
| 667 | WESTGATE | MARIA LOUISA | OCT. 6, 1889 | MON | MARBLE | TILTED | EXCAVATE. BRING TO LEVEL. CLEAN. (HEAVY). | 2021 |
| 667 | WESTGATE | HANNAH N. | SEPT. 4, 1850 | HEAD | MARBLE/ SANDSTONE | TILTED/SLIGHTLY LOOSE IN BASE | EXCAVATE. CLEAN. RESET. | 2021 |
| 667 | WESTGATE | EARL | JULY 21, 1864 | HEAD | MARBLE/ CONCRETE | BROKEN/TILTED | EXCAVATE. REMOVE PREVIOUS REPAIR. RESET BASE? NEW BASE? MORTAR BOTTOM FRAGMENT INTO BASE. DRILL AND PIN TOP TO BOTTOM FRAGMENT. INFILL. | 1 |
| 667 | WESTGATE | MERIAM | SEPT. 17, 1852 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2019 |
| 668 | DUNTON | ZENAS | SEPT. 23, 1849 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|-------------|-----------|--------------|----------------|--------|----------------------|--------------------------|--|---------|
| 668 | ALLEN | ANNA B. | MAR. 30, 1861 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2021 |
| 668 | ALLEN | HANNAH K. | MAR. 22, 1853 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2019 |
| 670 | BENSON | PHINEAS | MAR. 15, 1835 | HEAD | MARBLE | SUNKEN/ DETERIORATING | EXCAVATE. CLEAN. NEW BASE. SET BASE. MORTAR INTO BASE. | 2 |
| 670 | BENSON | SOLAN | AUG. 16, 1848 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 670 | BENSON | LYDIA | NOV. 15, 1848 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 670 | BENSON | WILLIAM | JUNE 19, 1871 | HEAD | MARBLE | FALLEN/BROKEN | EXCAVATE AND EVALUATE BASE. NEW BASE? CLEAN. SET BASE. MORTAR INTO BASE. | 1 |
| 671/ 662 | GLAZIER | LOUISA PERRY | JULY 22, 1887 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 672 | BEMIS | ARTHUR F. | MAY 9, 1928 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 1 |
| 672 | HARBOCK | SOPHIA A. | SEPT. 28, 1870 | MON | MARBLE | TILTED | CLEAN. BRING TO LEVEL. INFILL. | 1 |
| 673 | ALLEN | ABBY B. | OCT. 22, 1854 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 673 | ALLEN | ELIZABETH H. | JAN. 9, 1859 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|---------------------------|--------------------------------|--------------|----------|---|---|---------|
| 679 | NICHOLS | DAMON MARY | OCT. 21, 1884 MAY 18, 1851 | MON | MARBLE | SHAFT LOOSE ON PLINTH (TOP ELEMENT MISSING) | DISASSEMBLE PLINTH AND SHAFT. CLEAN. REASSEMBLE. | 1 |
| 679 | NICHOLS | MARY ("MOTHER") | MAY 18, 1851 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET | 2 |
| 679 | NICHOLS | WILDER ("HUSBAND") | JAN. 7, 1886 | MARKER | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 683 | HOLBROOK | MRS. BETSEY | OCT. 11, 1883 | HEAD | MARBLE | CARVER: W.R. KINSMAN, RUTLAND, VT. | NO TREATMENT AT THIS TIME | N/A |
| 684 | SIKES | MINNIE A. | MAY 18, 1874 | SMALL MON | MARBLE | TILTED/PINS BROKEN | EXCAVATE. REMOVE OLD PINS. CLEAN. RESET LOWER BASE. REPIN MIDDLE TO LOWER BASE AND DIE TO MIDDLE BASE. | 1 |
| 685 | RUSSELL | MAGGIE J. NICHOLS | JAN. 9, 1889 | MON | MARBLE | TILTED/LOOSE ON PINS | DISASSEMBLE. EXCAVATE LOWER BASE AND BRING TO LEVEL. CLEAN. REASSEMBLE AND REPIN. | 1 |
| 685 | CURFEW | FREDERICK F. ELIZABETH | NOV. 21, 1907 MAR. 25, 1907 | MON | MARBLE | TILTED/LOOSE ON PINS | DISASSEMBLE. EXCAVATE LOWER BASE. CLEAN. RESET LOWER BASE. REASSEMBLE AND REPIN. | 1 |
| 689 | MORSE | SOPHIA A.C. ("MOTHER") | FEB. 22, 1890 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 689 | MORSE | LUCIUS F. | JUNE 8, 1847 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|-------------------------------|----------------|--------|----------------------|------------------------------------|---|---------|
| 689 | MORSE | GEORGE M. | SEPT. 30, 1855 | MARKER | MARBLE | TILTED/SUNKEN | EXCAVATE. CLEAN. RESET. | 2 |
| 690 | PROUTY | STANLEY W. | JAN. 22, 1857 | HEAD | MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 691 | SIKES | JONATHAN | | | | | | |
| 692 | STONE | CHESTER ("MY FATHER") | MAY 8, 1849 | MARKER | MARBLE/ GRANITE | SUNKEN/BROKEN PIN | SET DIE ASIDE. EXCAVATE BASE. REMOVE PARTIAL PIN FROM DIE. CLEAN. RESET BASE. PIN DIE TO BASE. | 1 |
| 692 | STONE | HENRY D. ("MY BROTHER") | OCT. 27, 1869 | MARKER | MARBLE/ GRANITE | SUNKEN | EXCAVATE. CLEAN. RESET. | 1 |
| 692 | STONE | BELA J. | OCT. 9, 1898 | MARKER | MARBLE/ GRANITE | SUNKEN/BROKEN PIN/TILTED | EXCAVATE. DRILL OUT OLD PINS. CLEAN. RESET BASE. PIN. | 1 |
| 692 | STONE | ALICE P. | AUG. 25, 1844 | MARKER | MARBLE/ GRANITE | TILTED/DIE LOOSE ON BASE | EXCAVATE. REMOVE OLD SETTING COMPOUND. CLEAN. RESET BASE. RESET DIE ON BASE. | 1 |
| 692 | ATHERTON | REBECA | FEB. 14, 1867 | HEAD | MARBLE | BROKEN/BOTTOM FRAGMENT MISSING? | EXCAVATE AND INVESTIGATE FOR BOTTOM FRAGMENT? BASE? FORM NEW BASE? DRILL AND PIN? INFILL? | 1 |
| 697 | JACKSON | ABRAM | N/A | HEAD | MARBLE | TILTED (MILITARY MARKER) | EXCAVATE. CLEAN. RESET. | 2 |
| 698 | JUDD | JULIA A. | AUG. 7, 1849 | HEAD | MARBLE/ SANDSTONE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |

**NORTH CEMETERY
STURBRIDGE MA**

**GRAVESTONE/MONUMENT
CONDITION ASSESSMENT/CONSERVATION**

**FANNIN•LEHNER
8/8/21**

| LOT NO | LAST NAME | FIRST NAME | D. OF DEATH | TYPE | MATERIAL | NOTES/CARVER | TREATMENT | PR/COMP |
|--------|-----------|--------------------|--------------------------------|---------------|--------------------|---|--|---------|
| 698 | JUDD | DAVID S. SOPHIA | MAR. 10, 1862 NOV. 10, 1885 | DOUBLE MON | MARBLE | TILTED/ELEMENTS MOVING OFF THEIR BASE | DISASSEMBLE AND PUT ELEMENTS ON BUNKS. CLEAN. RESET BASE. REASSEMBLE. (HEAVY). | 1 |
| 699 | SMITH | HANNAH | FEB. 10, 1876 | MON | MARBLE/ MARBLE | TILTED | EXCAVATE. CLEAN. RESET. | 2 |
| 731 | REIDEL | CLEMENS R. | JULY 15, 1894 | HEAD | MARBLE/ MARBLE/ | SUNKEN/TILTED/ PINS MISSING | EXCAVATE. CLEAN. RESET BASE. PIN. | 1 |
| 771 | HYDE | SARAH E. | MAY 3, 1920 | MARKER | MARBLE/ GRANITE | SUNKEN/LOOSE ON PINS | REMOVE DIE. EXCAVATE BASE. CLEAN. RESET BASE HIGHER. REPIN DIE TO BASE. | 1 |

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 3, 2020

Name: Bernard/Wiggin

Date of Death: 1948-1976

Marker Type: Monument Detail: _____

Stone Carver:

Material: Granite Other: _____

Carved Surfaces: Front/Back

Motif: Other Detail: Encircled "B"; masonic symbol on back

Border: Elaborate Detail: Stylized flowers and leaves at each bottom corner

Carving: Mint

Bases: Granite Other: _____

Before Photo



Ref / Sec: 193M

Orientation: W

No. of People Commemorated: 2

Dimensions: (In) W 35 (Die) H 3 (Total Height)
D 8 (Die)

Digital: Before Set: 1 Photo: DSC4-1207/8

Digital: After Set: 7 Photo: DSC4-0047/48/49/50/51

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details:

Previous Repair: None Evident

Detail:

Chipped:

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES: Monitor encroaching shrubs!

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Bernard/Wiggin

Date of Death: 1848-1976 Ref/Sec: 193M

Conservation Notes: 10/3/2020- 1) Cleaning began on the face of the monument and its base. 2) Monument thoroughly brushed, then treated with D2 Biological Solution to help remove heavy lichen and algae and retard future biological growth. The face of the monument as well as its base scrubbed, then rinsed with water. These procedures repeated until the face and base was as clean as possible. 10/24/2020- 3) Monument thoroughly brushed and loose lichen scraped off with a plastic scraper. 10/25/2020- 4) Monument treated once more with D2, especially the back and the rough-hewn top. Then with wooden sticks (to get in lichen-clogged letters), plastic or natural bristled brushes the monument scrubbed, then rinsed with water. These procedures repeated multiple times until monument as clean as possible.

After Photo:



Inscription:

Face:

B
BERNARD
WIGGIN

Back:

WIGGIN
ALLEN L.
NOV. 1909 (mason symbol)
HIS WIFE
MILDRED E.
JULY 1906 - MARCH 1976

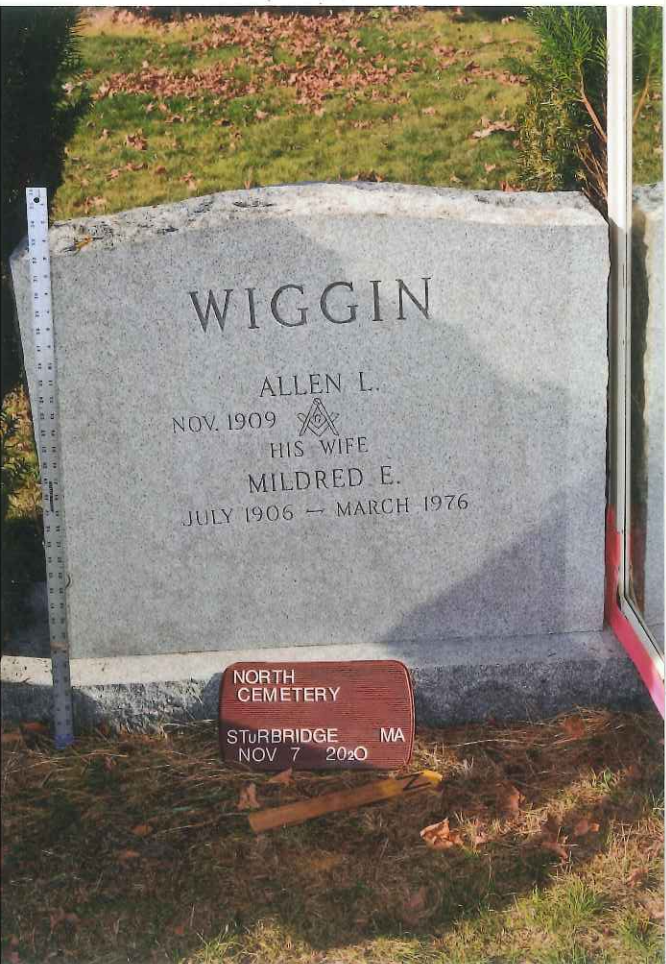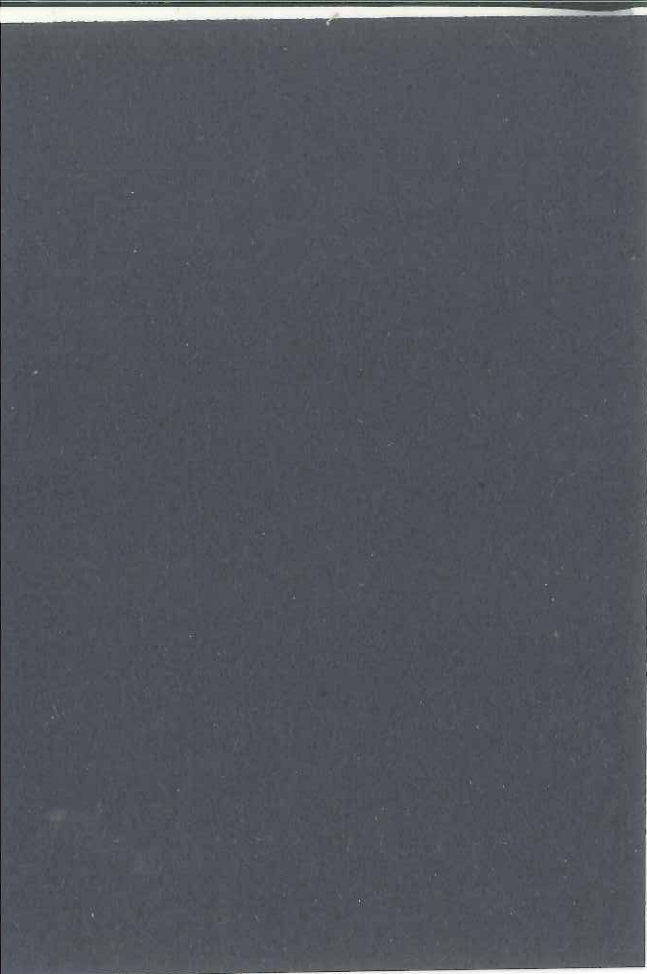

Fannin•Lehner
271 Lexington Road
Concord MA 01742
North Cemetery
Sturbridge MA October 2, 2020
Set: 1 Photo: DSC4-1208

Bernard Wiggin
d. 1948-1976
193
"before =
(back)

Fannin•Lehner
271 Lexington Road
Concord MA 01742
North Cemetery
Sturbridge MA Nov. 7-9, 2020
Set: 7 Photo: DSC4-0050

Bernard Wiggin Plot
d. 1948-1976
193
"after =

Fannin•Lehner
271 Lexington Road
Concord MA 01742
North Cemetery
Sturbridge MA Nov. 7-9, 2020
Set: 7 Photo: DSC4-0048

Bernard Wiggin
d. 1948-1976
193
(Front)
"after =

Fannin•Lehner
271 Lexington Road
Concord MA 01742
North Cemetery
Sturbridge MA Nov. 7-9, 2020
Set: 7 Photo: DSC4-0047

Bernard Wiggin
d. 1948-1976
193
"after =
(back)

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 2, 2020

Name: Bernard, Victor E.

Date of Death: 1948

Marker Type: Flat marker Detail: _____

Stone Carver:

Material: Granite Other: _____

Carved Surfaces: Top

Motif: None Detail:

Border: None Detail:

Carving: Mint

Bases: None Other:

Ref / Sec: 193M

Orientation:

No. of People Commemorated: 1

Dimensions: (In) W 10 H 20 D

Digital: Before Set: 1 Photo: DSC4-1209

Digital: After Set: 2 Photo: DSC4-1215

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details:

Previous Repair: None Evident

Detail:

Chipped:

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES:!

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Bernard, Victor E.

Date of Death: 1948

Ref/Sec: 193M

Conservation Notes: 10/3/2020- 1) The overgrowth had already been cut back from the marker. Marker now thoroughly brushed. 2) Marker treated with D2 Biological Solution to help remove heavy lichen and algae and retard future biological growth. Marker scrubbed and rinsed with water. These procedures repeated multiple times until the marker was as clean as possible.

After Photo:

Inscription:



VICTOR E. BERNARD
1889-1948

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 2, 2020

Name: Wiggin, Mildred E. Bernard

Date of Death: March 1976

Marker Type: Flat marker Detail: _____

Stone Carver:

Material: Granite Other: _____

Carved Surfaces: Top

Motif: None Detail:

Border: None Detail:

Carving: Mint

Bases: None Other:

Ref / Sec: 193M

Orientation:

No. of People Commemorated: 1

Dimensions: (In) W 10 H 20 D

Digital: Before Set: 1 Photo: DSC4-1210

Digital: After Set: 2 Photo: DSC4-1216

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details:

Previous Repair: None Evident

Detail:

Chipped:

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES:!

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Wiggin, Mildred E. Bernard

Date of Death: March 1976

Ref/Sec: 193M

Conservation Notes: 10/3/2020- 1) The overgrowth had already been cut back from the marker. Marker now thoroughly brushed. 2) Marker treated with D2 Biological Solution to help remove heavy lichen and algae and retard future biological growth. Marker scrubbed and rinsed with water. These procedures repeated multiple times until the marker was as clean as possible.

After Photo:

Inscription:

MILDRED E.
1906-1976



Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Sept. 11, 2020

Name: Jodrey, Wallace W./ Myrtle Blanchard/ Nancy A.

Date of Death: WWJ: 1999 MBJ: 1992 NAJ: 2000

Marker Type: Slant-Face Marker Detail: _____

Stone Carver:

Material: Granite Other: _____

Carved Surfaces: Front/Back

Motif: Other Detail: "JODREY" in rectangle with matte finish

Border: Simple Detail: Double lines

Carving: Mint

Bases: None Other:

Ref / Sec: 376A

Orientation: E

No. of People Commemorated: 3

Dimensions: (In) W 37 H 14 D 9 1/2

Digital: Before Set: 4 Photo: DSC4-1145/6/7

Digital: After Set: 4 Photo: DSC4-1150/1/2

CONDITIONS

Sound: Yes

Broken:

Tilted Details:

Previous Repair: None Evident

Detail:

Chipped:

Cracked:

Biological Activity: Extremely heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Jodrey, Wallace W. /Myrtle Blanchard/ Nancy A.
NAJ: 2000 **Ref/Sec:** 376A

Date of Death: WWJ: 1999 MBJ: 1992

Conservation Notes: 9/11/2020- 1) Slant-face marker was heavily impacted by lichen and algae, especially on "rough cut" areas. 2) Marker thoroughly brushed. There are also two ornaments, equally impacted by lichen and algae. One is a laminated wood figure of a nursemaid(?) and a young boy. The other is a round disk with a bird in flight. It was decided to clean the two ornaments as well as the stone. 3) Ornaments and stone treated with D2 Biological Solution to help remove the encrusted lichen and algae and retard future biological growth. Stone and ornaments scrubbed and rinsed with water. These procedures repeated until stone and ornaments as clean as possible.

After Photo:


Inscription:

FRONT:

JODREY


BACK:

1899 WALLACE W. 1999
HIS WIFE
1898 MYRTLE BLANCHARD 1992
DAU.
1929 NANCY A. 2000

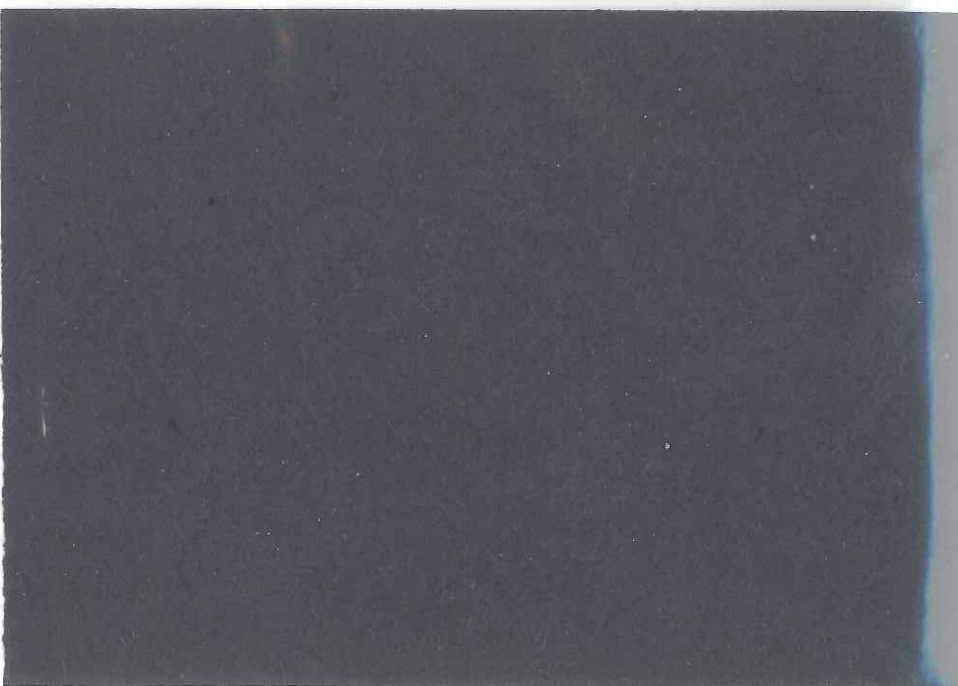

Fannin•Lehner Wallace W. Jodrey d.1999
271 Lexington Road Myrtle Blanchard Jodrey
Concord MA 01742 d.1992
North Cemetery Nancy A. Jodrey d.2000
Sturbridge MA September 11-12, 2020 (face)
Set: 4 Photo: DSC4-1151 "after="

DSC4-1151.JPG

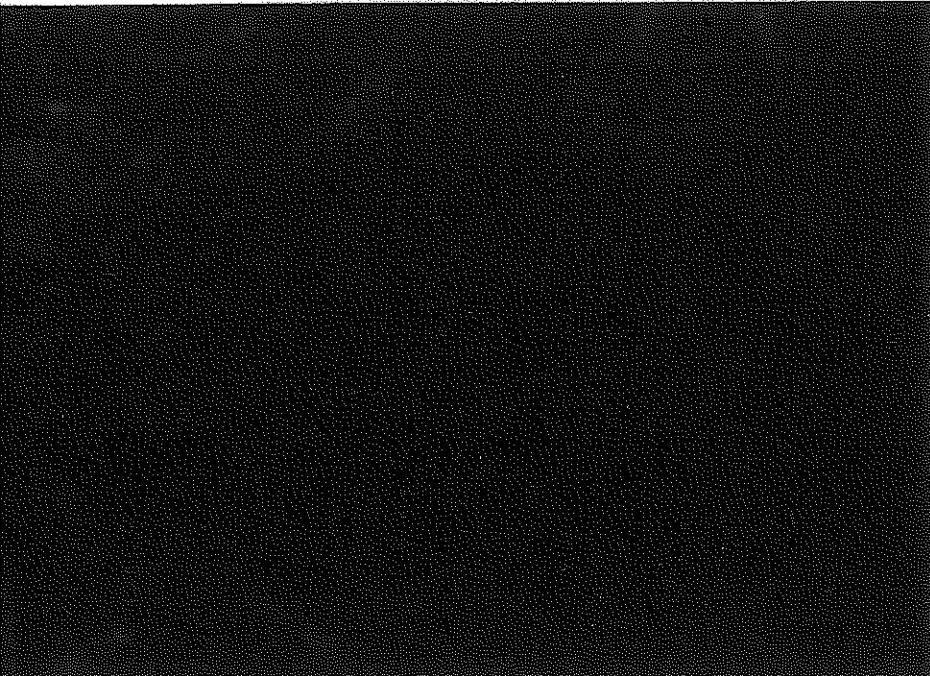

Fannin•Lehner Wallace W. Jodrey d.1999
271 Lexington Road Myrtle Blanchard Jodrey
Concord MA 01742 d.1992
North Cemetery Nancy A. Jodrey d.2000
Sturbridge MA September 11-12, 2020 (back)
Set: 4 Photo: DSC4-1152 "after="

DSC4-1152.JPG

Fannin•Lehner Wallace W. Jodrey d.1999
271 Lexington Road Myrtle Blanchard Jodrey
Concord MA 01742 d.1992
North Cemetery Nancy A. Jodrey d.2000
Sturbridge MA September 11-12, 2020 (face)
Set: 4 Photo: DSC4-1144 "before="

DSC4-1144.JPG

Fannin•Lehner Wallace W. Jodrey d.1999
271 Lexington Road Myrtle Blanchard Jodrey
Concord MA 01742 d.1992
North Cemetery Nancy A. Jodrey d.2000
Sturbridge MA September 11-12, 2020 (back)
Set: 4 Photo: DSC4-1147 "before="

DSC4-1147.JPG

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 28, 2021

Name: Freeman, Betsey H. Hyde

Date of Death: Feb. 28, 1873

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Name is raised on incised rectangular panel

Border: None Detail:

Carving: Clear but worn

Bases: Granite Other:

Ref / Sec: 558

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 1/4 H 35 1/2 D 2

Digital: Before Set: 7 Photo: DSC4-0064

Digital: After Set: 7 Photo: DSC5-0362

CONDITIONS

Sound:

Broken: Stone broken into three fragments

Fallen: Details: Yes

Previous Repair: Adhesive Repair/Other

Detail: Adhesive repair with unknown adhesive-failed. Other- Bottom had been re-inserted into base at some unknown period with some unknown material

Chipped: Along edges and breaks

Cracked:

Biological Activity: Small amount of lichen, algae

Soiling/Stains: Atmospheric, biological, some ferrous

Delamination:

Sugar Decay: Detail: Minimal


Flaking: Detail:

Fragments: Three

Losses: Along breaks

NOTES: Top and middle fragments completely out of location (Lot 678)

Before Photo

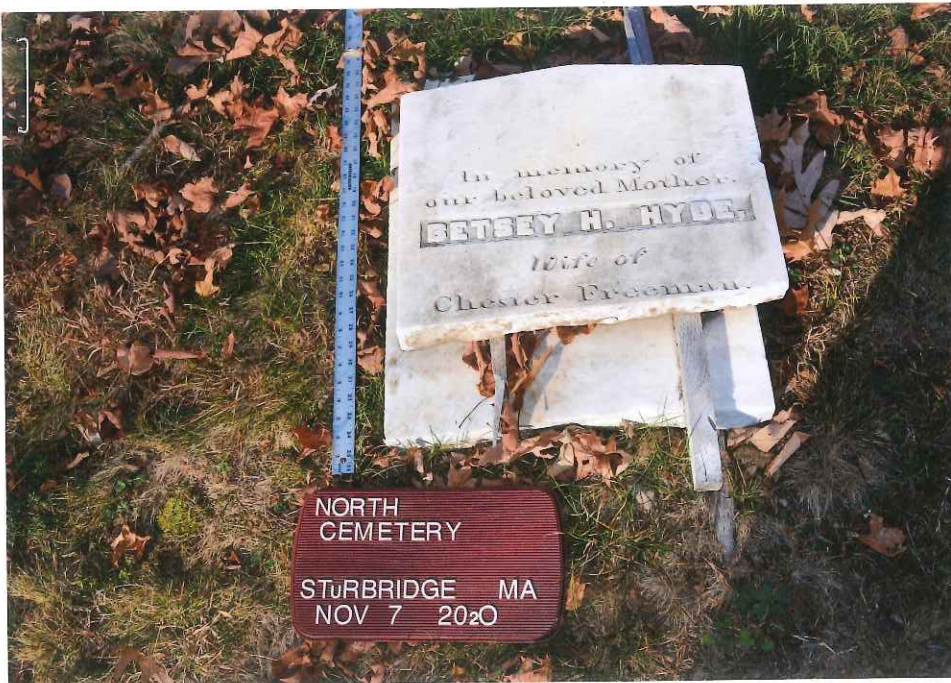

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Freeman, Betsey H. Hyde

Date of Death: Feb. 28, 1873

Ref/Sec: 558

Conservation Notes: 7/28/2021- 1) The top and middle fragment of Betsey H. Hyde Freeman had been placed in Lot #678 for some unknown reason. Her actual location is in Lot #558, next to her husband, Chester Freeman. 2) Investigating Lot #558, Betsey's bottom fragment, broken off at grade was located contained in a below-grade granite base. 3) Base, with the bottom fragment, excavated and set aside. The base is unfinished and meant to be below grade. 4) The two headstone fragments and the base and bottom fragment all thoroughly brushed and treated with D2 Biological Solution to help remove lichen and algae, and to retard future biological growth. All elements then scrubbed and rinsed with water. These procedures repeated until all were as clean as possible. 5) Base and bottom fragment reset level and plumb, in well-compacted sand and peastone, facing west. 6) Bottom and middle fragment drilled to receive two ½" fiberglass rods. The fragments were then pinned, the rods secured with Akemi Akepox 2010 Stone Epoxy. 7/29/2021- 7) Top fragment and middle fragment drilled to receive a ½" fiberglass rod. The top and middle fragment then were pinned, the rod secured by Akemi Akepox 2010 Stone Epoxy. 7/30/2021- 8) Infill along break between top and middle fragment using Limeworks St. Astier Repair Mortar "White Marble." 9) Area landscaped around headstone.

After Photo:



Inscription:

In memory of
our beloved Mother.
BETSEY H. HYDE,
Wife of
Chester Freeman
Died Feb. 28, 1873
Aged 75 years.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 6, 2018

Name: Fay, Mrs. Azubah

Date of Death: June 29, 1840

Marker Type: Headstone Detail: _____

Stone Carver: Tomlinson, (Sturbridge?)

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Entire inscription in raised letters on incised arches or rectangles

Border: Elaborate Detail: Beveled frame

Carving: Clear but worn

Bases: None Other: _____

Ref / Sec: 577

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 22 3/4 H 42 D 2 1/4

Digital: Before Set: 3 Photo: DSC3-0571

Digital: After Set: 4 Photo: DSC4-1148

CONDITIONS

Sound:

Broken: Broken

Tilted Details: Severely

Previous Repair: None Evident

Detail:

Chipped: Significantly chipped all edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses: Use of weak bottom fragment

NOTES:

Before Photo




Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Fay, Mrs. Azubah Date of Death: June 29, 1840 Ref/Sec: 577

Conservation Notes: 10/6/2018- 1) This heavily tilting stone excavated and placed on 2x4s. It is broken below grade. There was no immediate sign of a bottom fragment or base. The probable treatment for this stone is a new in-ground base. It was too late in the day for more exploration so stone was placed over the excavation. 10/8/2018- 2) The stone is large and heavy, with a low break. Even if the bottom fragment was found, drilling and pinning would be risky. The best solution is a new in-ground base. 7/14/2020- 3) Excavation began and in not too long the bottom fragment encountered. Drilling and pinning not an option as the repair would be weakened by frost action. It was decided to leave the bottom fragment in place. It is just west of the new in-ground base. 4) New in-ground base formed and poured. 5) Headstone treated with D2 Biological Solution to help remove lichen and algae and hopefully retard future growth. The stone was then scrubbed and rinsed with water. This set of procedures repeated until the stone was as clean as possible. 7/30/2020- 6) Stone mortared into its new slotted in-ground base using Limeworks Ecologic Mortar. 7/31/2020- 7) Area landscaped around stone. NOTE: The carver's name is now a bit below grade. However, if a bit of sod is slightly raised, the carver's name and town can easily be viewed.

After Photo:

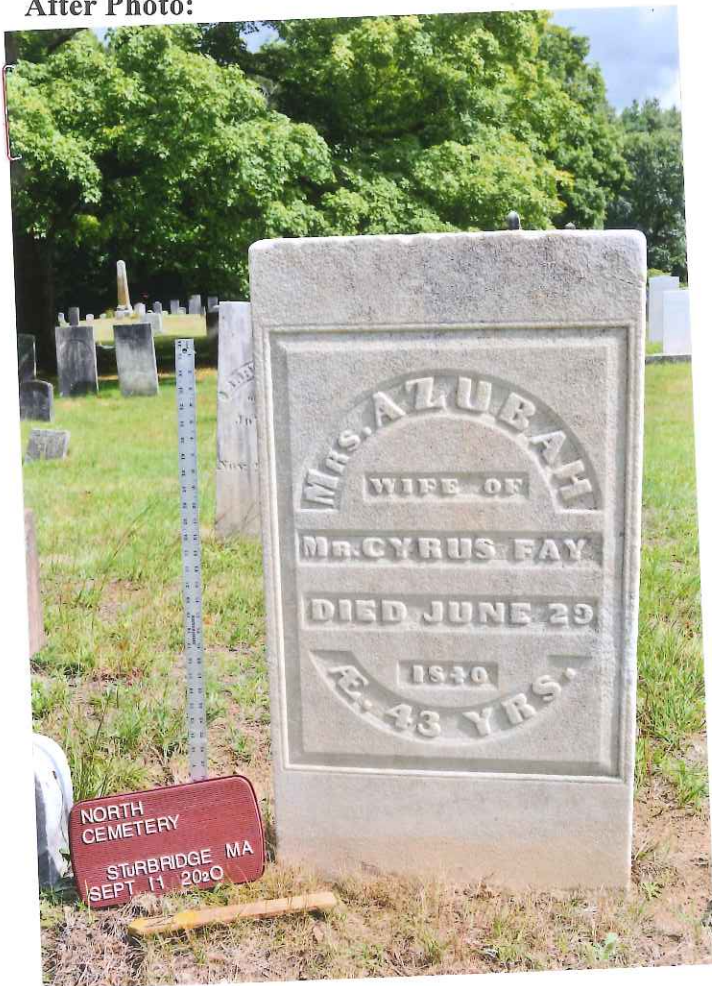

Inscription:

MRS. AZUBAH FAY
WIFE OF
MR. CYRUS FAY
DIED JUNE 29,
1840
AE. 43 YRS.

Tomlinson, (Sturbridge)?

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 6, 2018

Name: Lincoln, Emma C.

Date of Death: July 25, 1879

Marker Type: Monument Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Floral Detail: Broken bud on rosebush

Border: Elaborate Detail: Wide beveled line outlines tympanum, roping down sides

Carving: Clear but worn

Bases: Marble Other: _____

Before Photo



Ref / Sec: 578

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 (Die) H 34 (Entire monument) D 3 (Die)

Digital: Before Set: 3 Photo: DSC3-0573

Digital: After Set: 2 Photo: DSC4-0741

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Severely backward

Previous Repair: None Evident

Detail:

Chipped: Lowest marble base, especially at corners

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing

Flaking: Detail:

Fragments:

Losses:

NOTES:

Name: Lincoln, Emma C. Date of Death: July 25, 1879 Ref/Sec: 578

Conservation Notes: 10/14/2019- 1) Monument excavated. Monument raised and leveled on well-compacted sand and peastone. The monument remains firmly joined. 7/14/2020- 2) This monument will be a challenge to clean. It is deeply stained with atmospheric and biological growth. 3) Monument treated with D2 Biological Solution to help remove lichen and algae and hopefully retard future growth. The stone was then scrubbed and rinsed with water. This set of procedures repeated until the monument was as clean as possible. 7/15/2020- 4) Monument once again treated with D2, scrubbed, and rinsed with water. It is hoped the natural sunlight will work on the D2 to reduce some more of the staining. 7/23/2020- 5) The staining of the monument greatly reduced. The intense sunlight very helpful. 6) Area landscaped around monument.

After Photo:



Inscription:

EMMA C.
Dau. of Henry F. &
Maria A. Lincoln,
DIED
July 25, 1879.
AE 19 y's. 8 ms.
23 ds.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Nov. 9, 2020

Name: Roper, Charles William

Date of Death: Aug. 19, 1839

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Floral/Foliage Detail: Vine with four-petaled flowers

Border: Simple Detail: Stone is outlined in two sets of double lines

Carving: Clear but worn

Bases: None Other: _____

Ref / Sec: 594

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 13 H 26 D 1

Digital: Before Set: 7 Photo: DSC4-0055

Digital: After Set: 7 Photo: DSC4-0068

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Severely backward and to proper left

Previous Repair: None Evident

Detail:

Chipped: Slightly along edges, especially lower proper left front edge. Large chip off top edge and smaller chips of at grade

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Headstone has inclusions. Also atmospheric, biological stains.

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo



Fannin-Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Roper, Charles William Date of Death: Aug. 19, 1839 Ref/Sec: 594

Conservation Notes: 11/9/2020- 1) Headstone excavated. It has sufficient length to reset. 2) Headstone thoroughly brushed, then treated with D2 Biological Solution to help remove lichen and algae and hopefully retard future growth. The stone was then scrubbed and rinsed with water. 3) These three above procedures repeated until the stone was as clean as possible. 4) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 8) Area landscaped around stone.

After Photo:



Inscription:

Charles William
only child of
Samuel & Adaline
Roper: died Aug. 19
1839. ag. 19 mon. &
13 ds.

Sleep on dear child,
And take thy rest:
God call'd thee home
He saw it best.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Nov. 9, 2020

Name: Drake, Edmund A.

Date of Death: Sept. 15, 1837

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Mostly Deciph.

Bases: None Other:

Ref / Sec: 606

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 12 1/4 H 24 D 2 1/4

Digital: Before Set: 7 Photo: DSC4-0054

Digital: After Set: 1 Photo: DSC3-0081

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Tilted backward and to proper left

Previous Repair: None Evident

Detail:

Chipped: Along edges

Cracked: Diagonal crack below epitaph

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing

Flaking: Detail:

Fragments:

Losses:

NOTES: The quartz inclusions on the back are natural/part of the stone. They are not deterioration.

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Drake, Edmund A.

Date of Death: Sept. 15, 1837

Ref/Sec: 606

Conservation Notes: 10/6/2018- 1) This tilted headstone excavated. It has more than sufficient length to reset. 2) Stone thoroughly brushed, then treated with D2 Biological Solution to help lift heavy lichen and algae and retard future biological growth. The headstone then scrubbed and rinsed with water. 3) The above three procedures repeated until the stone was as clean as possible. 4) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 5) Area landscaped around stone.

After Photo:



Inscription:

EDMUND A.
son of
Horatio N. &
Prudence Drake
died
Sept. 15, 1837
Aet. 2 Y & 3 ½ M.

Hope looks beyond the bounds of time
When what we now deplore
Shall rise in full immortal prime
And bloom to fade no more.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Sept. 24, 2020

Name: Drake, Sylvia O.

Date of Death: Sept. 15, 1841

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 606

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 11 1/2 H 16 D 1 1/2

Digital: Before Set: 1 Photo: DSC4-00716

Digital: After Set: 2 Photo: DSC4-1217

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Forward

Previous Repair: None Evident

Detail:

Chipped: Lower edges, especially proper right

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological stains.

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo




Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Drake, Sylvia O. Date of Death: Sept. 15, 1841 Ref/Sec: 606

Conservation Notes: 9/24/2020- 1) Headstone excavated and thoroughly brushed. The stone has sufficient length to reset. 2) Headstone treated with D2 Biological Solution to help remove lichen and algae and hopefully retard future growth. The stone was then scrubbed and rinsed with water. 3) Stone treated again with D2, scrubbed, and rinsed. 4) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 5) Treated once again with D2 before leaving. 5) Area landscaped around stone.

After Photo:

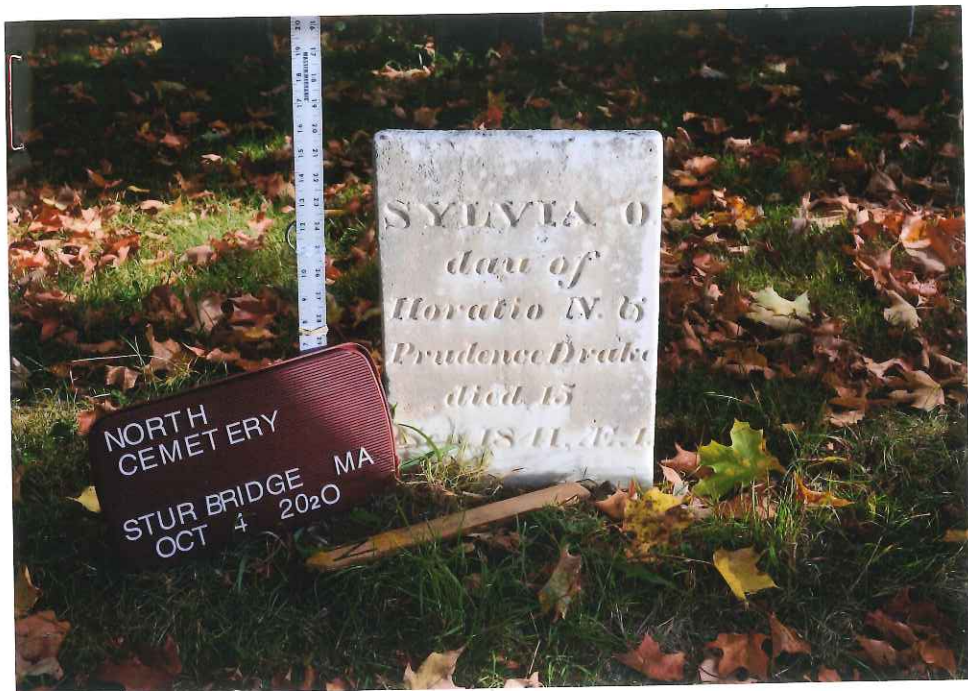

Inscription:

SYLVIA O.
dau of
Horatio N. &
Prudence Drake
died 15
Sept., 1841, AE. 1.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Sept. 24, 2020

Name: Drake, Mary Eunice

Date of Death: Sept. 21, 1837

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Mostly Deciph.

Bases: None Other:

Ref / Sec: 606

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 11 3/4 H 24 D 2

Digital: Before Set: 1 Photo: DSC4-00717

Digital: After Set: 2 Photo: DSC4-1218

CONDITIONS

Sound: Yes

Broken:

Tilted Details: Backward and to proper left

Previous Repair: None Evident

Detail:

Chipped: Slightly along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing


Flaking: Detail:

Fragments:

Losses: Losing some surface and legibility of stone

NOTES:

Before Photo

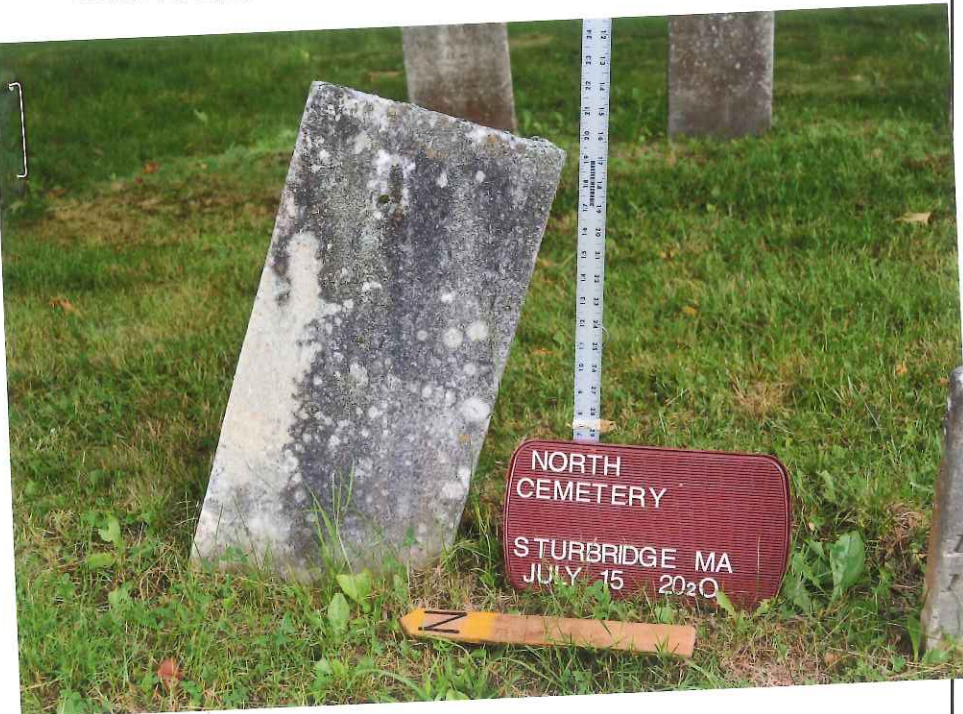

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Drake, Mary Eunice

Date of Death: Sept. 21, 1837

Ref/Sec: 606

Conservation Notes: 9/24/2020- 1) Headstone excavated and thoroughly brushed. The stone has sufficient length to reset. 2) Headstone treated with D2 Biological Solution to help remove lichen and algae and hopefully retard future growth. The stone was then scrubbed and rinsed with water. 3) Stone treated again with D2, scrubbed, and rinsed. 4) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 5) Treated once again with D2 before leaving. 6) Area landscaped around stone.

After Photo:



Inscription:

MARY EUNICE
daughter of
Horatio N. &
Prudence Drake
died
Sept. 21, 1837
AE 1 Y'r & 9 D's.

So lovely blooming flower
Fades and withers in an hour
So our transient comforts fly
Pleasure only blooms to die

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Nov. 7, 2020

Name: Brooks, Georgie (etc.)

Date of Death: Dec. 22, 1860 (etc.)

Marker Type: Obelisk Detail: Small

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front/Back/Top/End Panels

Motif: Floral/Foliage Detail: Rose stem with leaves and broken bud

Border: None Detail:

Carving: Clear but worn

Bases: Marble Other: Sandstone

Ref / Sec: 607

Orientation: W

No. of People Commemorated: 4

Dimensions: (In) W 6 (Obelisk) H 23 3/4 D 6 (Obelisk)

Digital: Before Set: 6 Photo: DSC4-0027

Digital: After Set: 7 Photo: DSC4-0067/9

CONDITIONS

Sound: Yes

Broken:

Tilted Details: Tilted to proper right

Previous Repair: None Evident

Detail:

Chipped: Corners of both sandstone and marble bases

Cracked: Multiple cracks on marble base

Biological Activity: Heavy lichen, algae, moss

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing

Flaking: Detail:

Fragments:

Losses: Losing legibility

NOTES:

Before Photo



Fannin-Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Brooks, Georgie (etc.)

Date of Death: Dec. 22, 1860 (etc.)

Ref/Sec: 607

Conservation Notes: 11/7/2020- 1) This charming small obelisk excavated. It is firmly together. 2) Obelisk thoroughly brushed, then treated with D2 Biological Solution to help remove lichen and algae and hopefully retard future growth. The stone was then scrubbed and rinsed with water. 11/8/2020- 3) Cleaning continued. After many cycles of D2, scrubbing, and rinsing, the little obelisk is as clean as was possible. 11/9/2020- 4) This small obelisk with the obelisk and bases still firmly joined, reset level and plumb, in well-compacted sand and peastone, facing west. 8) Area landscaped around obelisk.

After Photo:



Inscription:

WEST FACE:

GEORGIE,
Infant son of
Eli T. &
Anna E.
Brooks
DIED
Dec. 22, 1860.
Aged 5 mos.
& 7 days.

NORTH FACE:

HENRY C.
(died Aug. 28, 1864)

EAST FACE:

Lydia M.
(died July 4, 1863)

SOUTH FACE:

HERBERT M.
(died Aug. 15, 1865)

NOTE: Dates in brackets from research material. Only full inscription is for "Georgie."

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Sept. 24, 2020

Name: Brooks, Benjamin

Date of Death: April 22, 1852

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Name in raised letters on incised banner

Border: None Detail:

Carving: Clear but worn

Bases: Other: Concrete

Ref / Sec: 607

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 H 41 D 1 3/4

Digital: Before Set: 1 Photo: DSC4-00718

Digital: After Set: 2 Photo: DSC4-1219

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Backward and to proper left

Previous Repair: Other

Detail: The concrete found firmly attached to the stone below grade was probably of a concrete "skirt."

Chipped: Slightly along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Black staining at top and many black spots on stone

Delamination:

Sugar Decay: Detail: Moderate


Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo

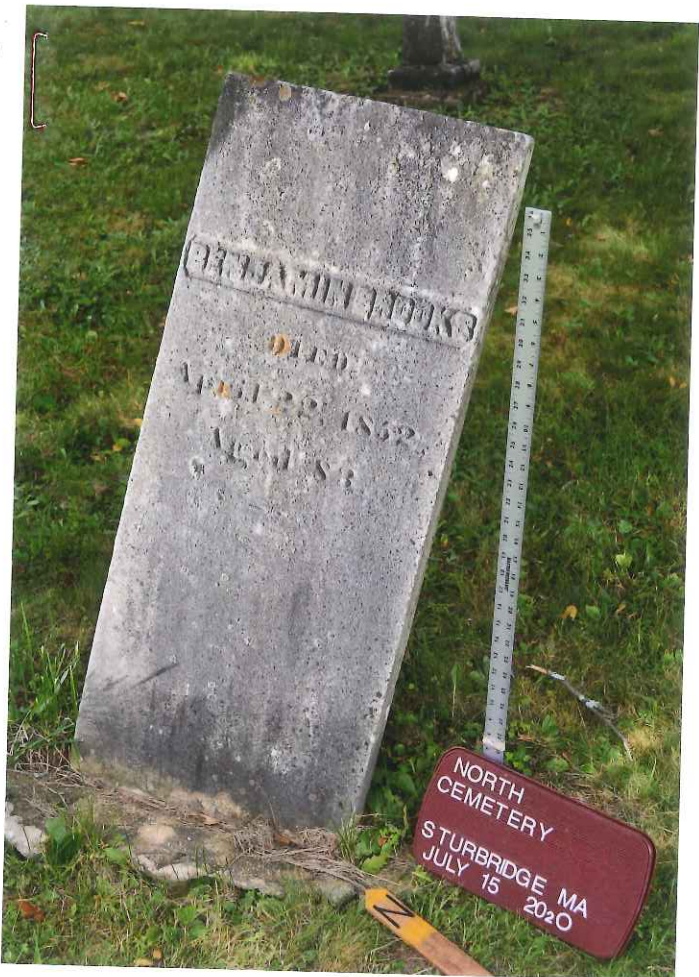

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Brooks, Benjamin Date of Death: April 22, 1852 Ref/Sec: 607

Conservation Notes: 9/24/2020- 1) Headstone excavated. There is sufficient length to reset. Levelled in sand and peastone. There was a still concrete firmly attached to the front of the stone. Left in place. 2) Headstone reset level and plumb in well-compacted sand and peastone. 3) Headstone treated with D2 Biological Solution to help remove heavy lichen, algae, and biological staining, and hopefully retard future growth. The stone was then scrubbed and rinsed with water. 4) This set of procedures repeated until the headstone was as clean as possible. 5) Final treatment of D2 before leaving. 6) Area landscaped around stone. NOTE: 10/26/2020: There is still black staining at the bottom edge of the headstone.

After Photo:



Inscription:

BENJAMIN BROOKS
DIED
April 22, 1852
Aged 83

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 26, 2020

Name: Brooks, Dorcus C.

Date of Death: Feb. 1, 1846

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Name in raised letters on incised banner

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 607

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 H 41 3/4 D 1 3/4

Digital: Before Set: 1 Photo: DSC4-00719

Digital: After Set: 7 Photo: DSC4-0053

CONDITIONS

Sound: Yes

Broken:

Tilted Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Slightly, especially proper left back edge

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological, black spots

Delamination:

Sugar Decay: Detail: Moderate


Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo

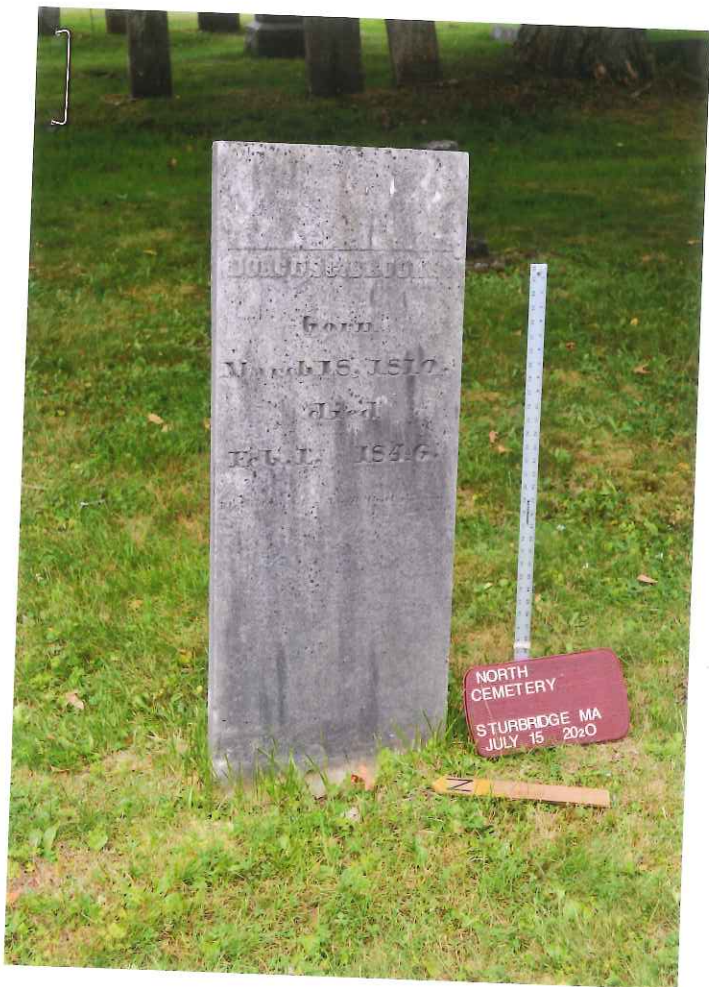


Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Brooks, Dorcus C. Date of Death: Feb. 1, 1846 Ref/Sec: 607

Conservation Notes: 10/26/2020- 1) Headstone excavated. There is sufficient length to reset. 2) Headstone thoroughly brushed, then treated with D2 Biological Solution to help remove lichen, algae, and black spots, and also to retard future growth. The stone was then scrubbed and rinsed with water. These set of procedures repeated until the headstone was as clean was possible. Remnants of the black spots remain. 3) Headstone reset level and plumb, in well-compacted sand and peastone, facing west. 4) Area landscaped around stone.

After Photo:

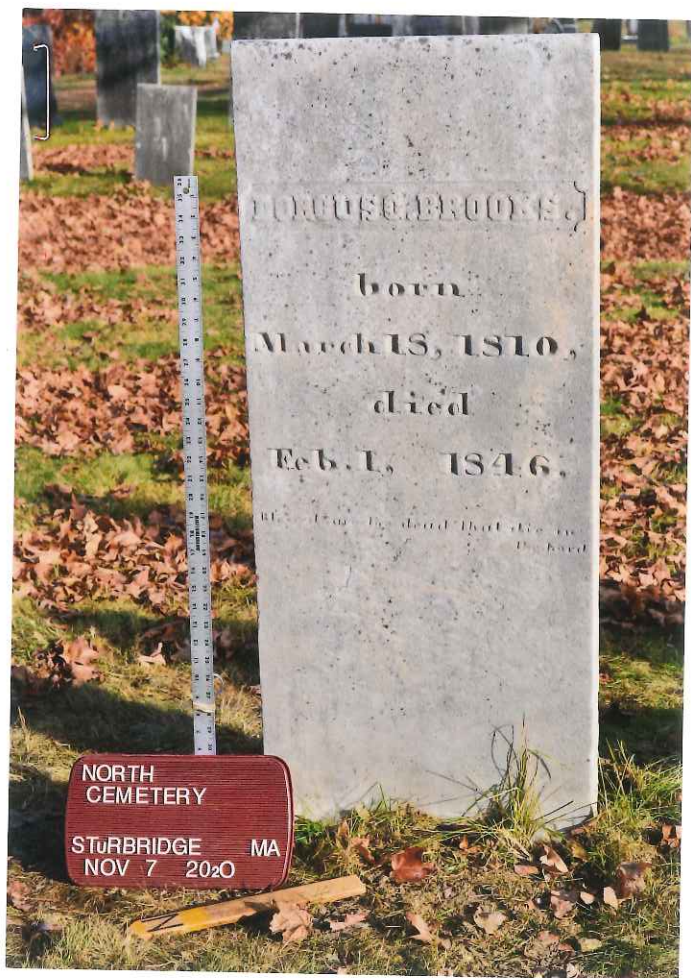

Inscription:

DORCUS C. BROOKS
born
March 18, 1810,
died
Feb. 1, 1846.

Blessed are the dead that die
in the Lord.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 26, 2020

Name: Brooks, Esther

Date of Death: June 16, 1863

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Beautifully proportioned Gothic shape

Border: None Detail:

Carving: Clear but worn

Bases: Granite Other:

Ref / Sec: 607

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 21 1/2 H 55 D 3

Digital: Before Set: 6 Photo: DSC4-0026

Digital: After Set: 7 Photo: DSC4-0052

CONDITIONS _____

Sound: Yes

Broken:

Tilted Details: Backward

Previous Repair: None Evident

Detail:

Chipped: Minor- lower edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA


Name: Brooks, Esther

Date of Death: June 16, 1863

Ref/Sec: 607

Conservation Notes: 10/26/2020- 1) This tilting stone excavated. It has a large granite base (15") commensurate with the size and depth of the headstone. The die is firmly in the granite base. 2) The granite base was finally exposed and the die and base painstakingly brought to level. All the soil around it removed and replaced with well-compacted sand and peastone. 3) Several rounds of cleaning commenced. The die and base first thoroughly brushed, then treated with D2 Biological Solution to help remove heavy lichen and algae and also to retard future growth. The die and base then scrubbed and rinsed with water. The die remains deeply stained. 4) The resetting was completed with more compacted sand and peastone. Area landscaped around the base.

After Photo:

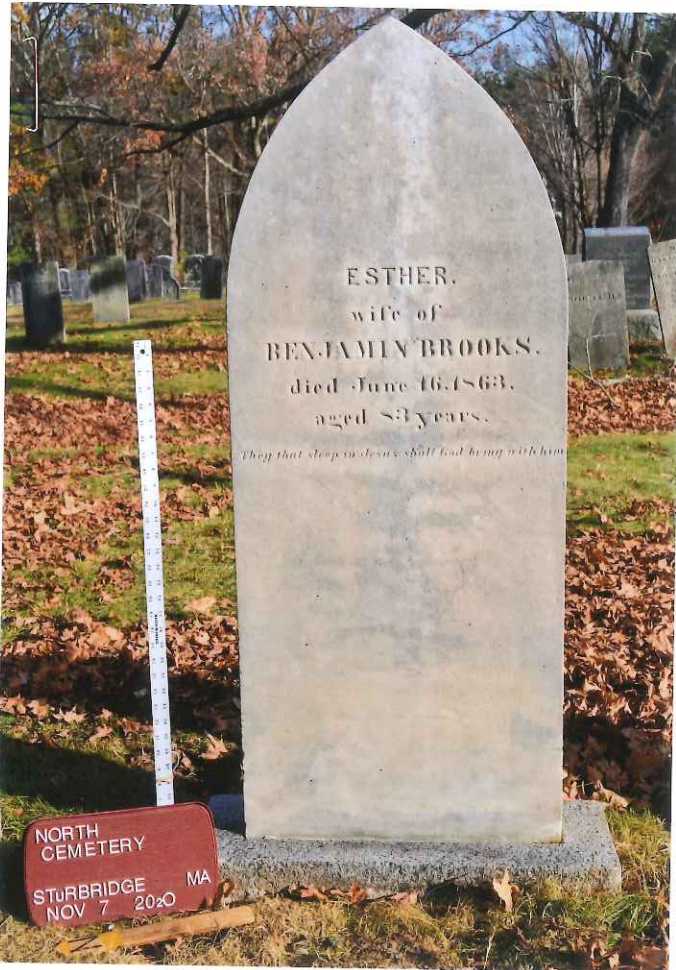

Inscription:

ESTHER
wife of
BENJAMIN BROOKS.
died June 16, 1863.
aged 83 years.

They that sleep in Jesus shall God
bring with him.

Record Date: June 18, 2019

Name: Lyon, Pamela

Date of Death: June 13, 1834

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: "PAMELA" in raised letters on recessed banner

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Ref / Sec: 629

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 20 H 38 D 2

Digital: Before Set: 5 Photo: DSC3-0817

Digital: After Set: 2 Photo: DSC4-0753

CONDITIONS

Sound:

Broken: Broken in tree removal accident- 2018

Fallen: Details: Yes

Previous Repair: Other

Detail: 2016: Stone broken. Fannin/Lehner removed two failed previous repairs. Cleaned, drilled and pinned, infilled.

Chipped: Along edges, heavily along breaks

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological, substances from previous repairs.

Delamination:

Sugar Decay: Detail: Moderate


Flaking: Detail:

Fragments: Three

Losses: Large loss between breaks.

NOTES: Damaged in Tree Removal Project- 2018.

Before Photo

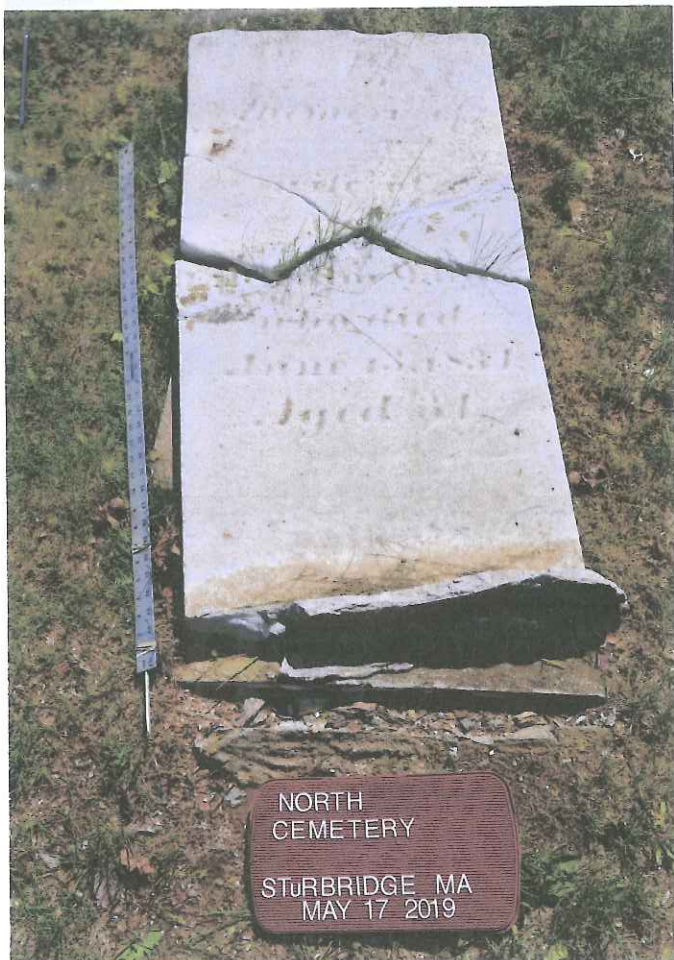

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Lyon, Pamela

Date of Death: June 13, 1834

Ref/Sec: 629

Conservation Notes: 6/18/2019- 1) Investigation revealed the original sandstone base had previous concrete repairs which failed. It needs a new base. 6/24/2019- 2) New concrete slotted base formed and poured off-site. 7/23/2019- 3) Bottom fragment: concrete and other failed repair materials removed from bottom of fragment. 4) Bottom fragment treated multiple times with D2 Biological Solution to help remove lichen and algae and retard future biological growth. With more scrubbing and water rinses the fragment is now cleaned. 7/24/2019- 5) The other two fragments treated with D2, scrubbed, and rinsed with water. 6) The new base, which was brought to the site, was set level and plumb, just below grade. This was not a simple endeavor because this whole area is plagued by large below-grade roots. 7) Bottom fragment mortared into its new base with Limeworks Ecologic Mortar. 7/31/2019- 8) There are now two fragments that must reunite with the bottom fragment. The small fragment drilled to receive a ¼” pin that will join with the bottom fragment. The top fragment drilled for a ½” pin and the ¼” pin connecting to the smaller fragment and the bottom one. 9) Entire stone pinned together, the fiberglass pins secured with Akepox 2010 Stone Epoxy. Repairs clamped. 7/13/2020- 10) Infill along all breaks using St. Astier Lithomex Repair Mortar “White Marble.”

After Photo:



Inscription:

IN
Memory of
PAMELA
wife of
Ephraim M. Lyon
who died
June 13, 1834
Aged 34.

Record Date: July 18, 2019

Name: Lyon, Charles/Marcia Ann

Date of Death: CL: 6/18/1837 MAL: 3/7/1842

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Names in raised letters on incised banners

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 629

Orientation: W

No. of People Commemorated: 2

Dimensions: (In) W 18 1/4 H 29 1/4 D 1 7/8

Digital: Before Set: 5 Photo: DSC3-0816

Digital: After Set: 1 Photo: DSC4-0664

CONDITIONS

Sound:

Broken: Broken in Tree Removal Project-2018

Fallen: Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Light atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments: Originally five

Losses: Use of bottom fragments

NOTES: Damaged in Tree Removal Project-2018

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Lyon, Charles/ Marcia Ann


Date of Death: CL: 6/18/1837 MAL: 3/7/1842

Ref/Sec: 629

Conservation Notes: 6/18/2019- 1) Investigation of lower quadrant of stone revealed the breaks are so low and with such difficult angles, it will have to have a new concrete slotted base. 7/23/2019- 2) Two small triangular loose fragments from lower midsection of stone treated multiple times with D2 Biological Solution and then scrubbed and rinsed with water. The D2 helped remove lichen and algae and will deter future biological growth. 4) New concrete slotted base formed and poured off site. 5) There were five fragments, unfortunately four are unuseable. 6) The bottom of the headstone reduced so it will sit level and plumb in its new base. 7) New slotted base set level and plumb, just below grade. 7/31/2019- 9) Headstone brushed then treated with D2 Biological Solution to help lift lichen and algæ and retard future biological growth. The cleaning was completed with more D2, copious water rinses, and much scrubbing. 10) Stone mortared into its new base with Limeworks Ecologic Mortar. 6/18/2020- 11) Area landscaped around headstone.

After Photo:

Inscription:

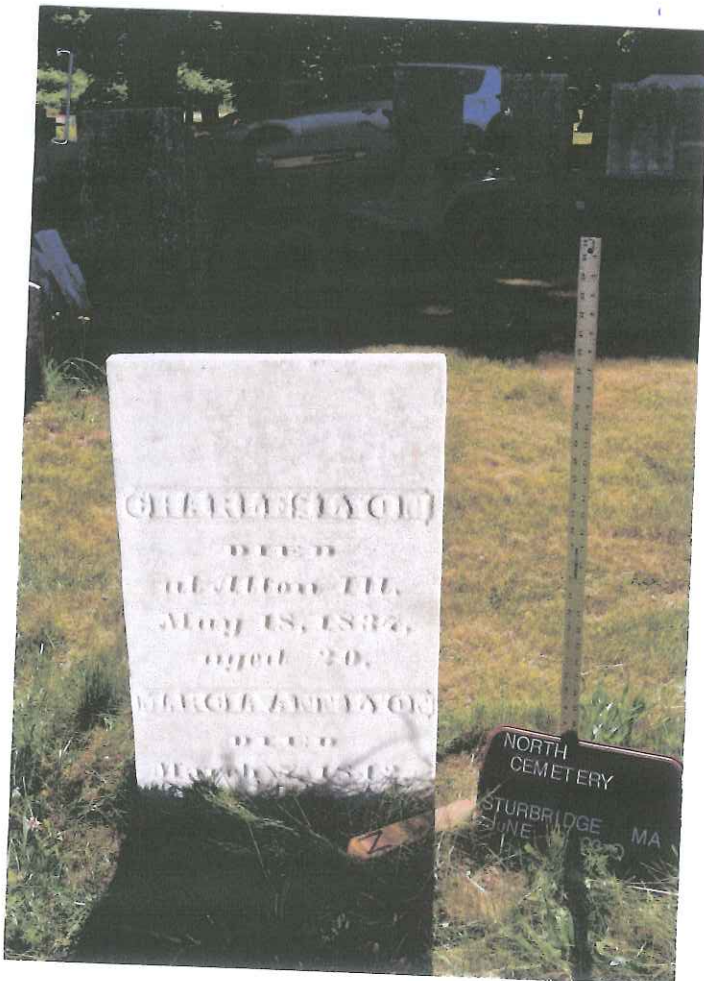

CHARLES LYON
DIED
at Alton Ill.
May 18, 1837
MARCIA ANN LYON
DIED
March 7, 1842
aged 20.

Record Date: June 18, 2019

Name: Lyon, Deacon Ephraim M.

Date of Death: May 15, 1871

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Name in raised letters on incised banner

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other: Slate backer

Ref / Sec: 629

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 20 H 34 D 2

Digital: Before Set: 5 Photo: DSC3-0814

Digital: After Set: 2 Photo: DSC4-0743

CONDITIONS

Sound:

Broken: Yes

Fallen: Details: Yes

Previous Repair: Adhesive Repair/Other

Detail: Adhesive repair: At least two failed repairs of unknown materials at unknown times; Other: 2016: Brought to level by Fannin/Lehner. Cleaned. (There was an earlier unsightly repair-but left undisturbed by F/L- still holding)

Chipped: All edges and heavily at breaks

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing


Flaking: Detail:

Fragments: Six

Losses: Large losses mid-section break; smaller loss below capitalized name.

NOTES: Damaged in tree removal project: 2018.

Before Photo

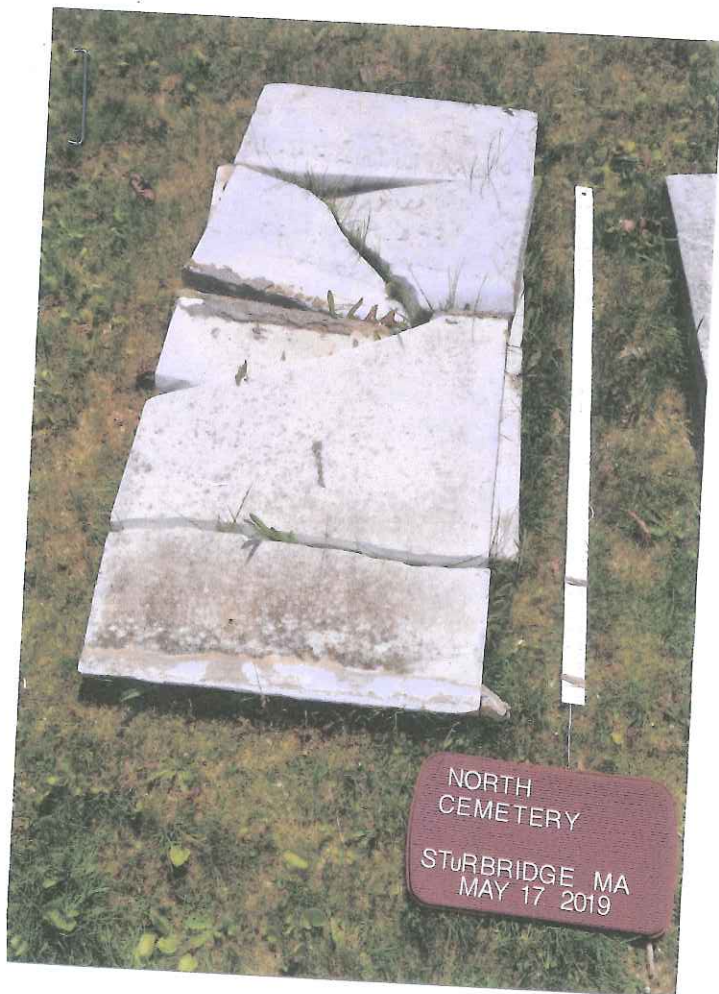

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Lyon, Deacon Ephraim M.

Date of Death: May 15, 1871

Ref/Sec: 629

Conservation Notes: NOTE: Disfiguring concrete repair at mid-section left on surface of stone as removing it would take part of the stone's surface with it. 6/18/2019- 1) It was decided this multi-fragmented stone would need a new in-ground base. 7/23/2019- 2) Failed previous repair removed from bottom of bottom fragment. 3) Bottom fragment treated with D2 Biological Solution to help lift lichen and algae and to retard future biological growth. Cleaning completed with more scrubbing and water rinses. 7/31/2019- 4) Excavation dug and prepared for a new in-ground base. The slot will be quite large as it has to accommodate both the stone and a backer (3/4") and leave room for mortar (1/2")- total: 3 1/4." 5) In-ground concrete slotted base formed and poured. This was a difficult preparation to pour the base because the area was impacted by large roots from the departed tree. 6/18/2020- 6) A slate backer, 20" x 24" x 3/4," was brought to the site. This is because this multi-fragmented stone with at least two failed repairs, will never have the structural integrity to stand on its own. This is with all fragments pinned together. 7) When all the fragments were test-fitted with the backer, it was discovered the backer ended just before the mid-section break, therefore giving no support to the fragments above it. The difficult decision was made not to use the lowest fragment, instead to bury it, in front of the headstone. Now the backer will support the entire stone. 8) All fragments treated once again with D2, scrubbed and rinsed with water. 9) As much of unsightly, failed previous repairs removed as possible. Removing the old repairs completely would damage more of the surface of the stone. 10) Fragments drilled to receive four 1/4" fiberglass pins. 6/19/2020- 11) Form boards removed from around the stones new in-ground base. 12) Bottom fragment (7" x 20" x 2") buried directly below grade, in front of the in-ground base. 13) Although several of the fragments (three) were going to be adhered to the backer, they were still drilled and pinned together with four 1/4" pins. 14) The three fragments were then adhered to the baker using Akepox 2010 Stone Epoxy. 15) The backer, with its fragments, had been placed on 2x4s, waiting to be inserted into the new in-ground base. 6/20/2020- 16) Backer and fragments mortared into its new in-ground base using Limeworks Ecologic Mortar. 7/14/2020- 17) Top fragment and top of middle fragment drilled to receive two 1/4" fiberglass pins. 18) Top and middle fragment pinned, the 1/4" pins secured with Akemi Akepox 2010 Stone Epoxy. 7/15/2020- 19) The two major losses on the stone partially infilled with Limeworks Ecologic Mortar. 20) Infill along all breaks with St. Astier Lithomex Repair Mortar "White Marble" including a skim coat on Ecologic Mortar infill. 21) Area landscaped around stone.


Fannin•Lehner Gravestone Conservation Form - Page 3
Cemetery: North Cemetery, Sturbridge, MA

Name: Lyon, Deacon Ephraim M.

Date of Death: May 15, 1871

Ref/Sec: 629

After Photo:

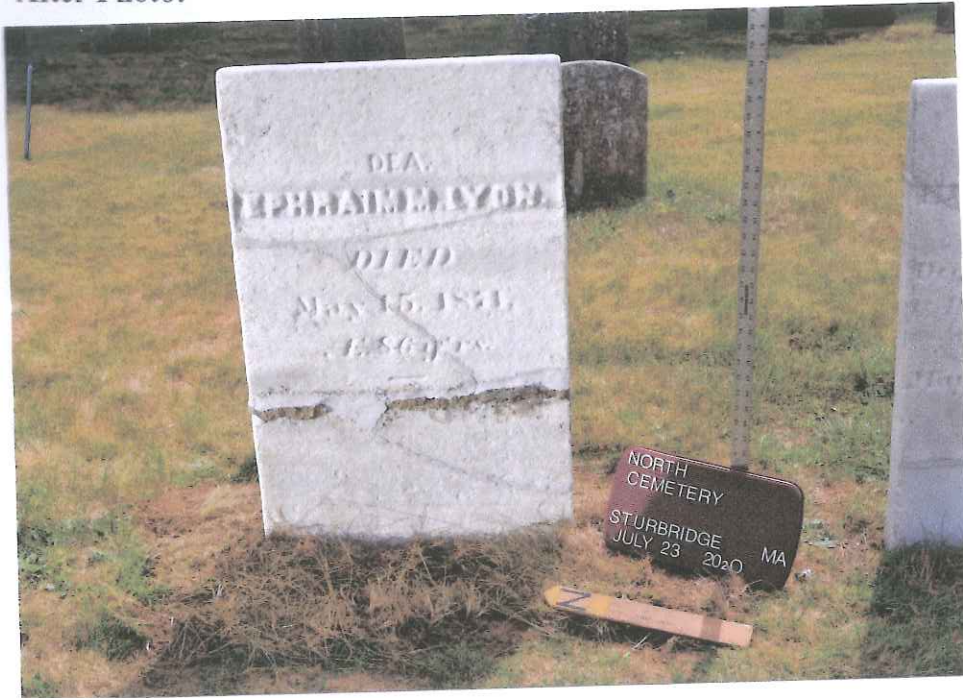

Inscription:

DEA.
EPHRAIM M. LYON,
DIED
May 15, 1871,
AE. 86 y'rs.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 23, 2019

Name: Lyon, Ephraim M.

Date of Death: May 16, 1839

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 629

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 15 H 32 1/4 D 1 3/4

Digital: Before Set: 5 Photo: DSC3-0815

Digital: After Set: 1 Photo: DSC4-00715

CONDITIONS _____

Sound:

Broken: Broken in Tree Removal Project- 2018

Fallen: Details: Yes

Previous Repair: Adhesive Repair

Detail: Failed repair material, of unknown origin, removed from bottom of bottom fragment.

Chipped: Along edges and breaks

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing


Flaking: Detail:

Fragments: Four

Losses: Along breaks

NOTES:

Before Photo

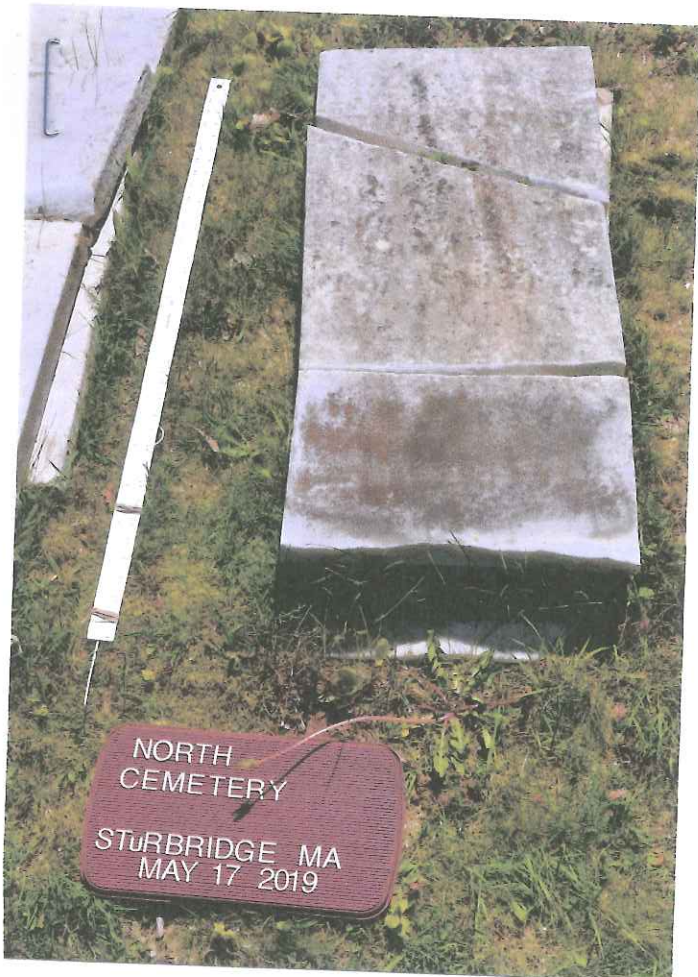

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Lyon, Ephraim M. Date of Death: May 16, 1839 Ref/Sec: 629

Conservation Notes: 7/23/2019- 1) Previous repair removed from bottom of bottom fragment. 2) Lower fragment treated multiple times with D2 Biological Solution to help remove lichen and algae and retard future biological growth. Cleaning completed with more scrubbing and water rinses. 7/24/2019- 3) Top two fragments treated with D2, scrubbed and rinsed. 7/31/2019- 4) Area explored to see if there was a bottom fragment/ and/ or base below grade. A bottom fragment (useable) was discovered but no base. 5) Bottom fragment treated with D2, water rinses, and scrubbing until clean. 6/18/2019- 6) All four fragments cleaned with D2, scrubbing, and rinsing. 7) Bottom two fragments drilled to receive two ½” fiberglass pins. 6/18/2020- 8) Bottom two fragments pinned, the pins secured by Akepox 2010 Stone Epoxy. 6/19/2020- 9) Bottom two fragments, now firmly re-attached, set level and plumb in well-compacted sand and peastone. 10) Middle fragment drilled to receive a ½” fiberglass pin between it and the next lower fragment. Top fragment drilled for a ½” and ¼” pins to go between top and middle fragment. 11) Top and middle fragment pinned to next lower fragment, the pins secured by Akepox 2010 Stone Epoxy. 7/12/2020- 12) Infill along all breaks using St. Astier Lithomex Repair Mortar “White Marble.” 7/13/2020- 13) Area landscaped around stone.

After Photo:



Inscription:

EPHRAIM M.
son of
Dea. Ephraim M.
& Pamela Lyon
died 16
May, 1839. AE. 15.

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 14, 2020

Name: Shumway, Abijah "Father"/ Ruth Moore "Mother"

Date of Death: AS: 4/21/1869 RMS: 3/2/1886

Marker Type: Double headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Finger pointing to heaven

Border: Elaborate Detail: Each of the two inscriptions outlines in single deeply grooved line

Carving: Clear but worn

Bases: Marble Other: Original: Sandstone?

Before Photo



Ref / Sec: 630

Orientation: W

No. of People Commemorated: 2

Dimensions: (In) W 29 1/2 H 30 D 2 3/4

Digital: Before Set: 5 Photo: DSC3-081

Digital: In Process Set: 3 Photo: DSC4-1043/6

Digital: After Set: 4 Photo: DSC4-1144

CONDITIONS

Sound:

Broken: Off base

Fallen: Details: Yes

Previous Repair: Other

Detail: Original base, which may have been sandstone, must have broken. A sort of concrete "skirt" had been fashioned and failed.

Chipped: Especially bottom edge of die

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing

Flaking: Detail:

Fragments:

Losses:

NOTES: The white marble monument base once had been pinned. The pins, still in the base, were out of level with the bottom

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Shumway, Abijah "Father"/ Ruth Moore "Mother" **Date of Death:** AS: 4/21/1869 RMS: 3/2/1886
Ref/Sec: 630

Conservation Notes: 7/14/2020- 1) This double headstone excavated and evaluated. There is a line of concrete previous repair on the face of the narrow marble base. It is conjectured the original base (below the existing narrow marble base), perhaps sandstone, had broken and a repair was cobbled together with concrete and loose stones combined as a "skirt," which failed. 2) It was decided to cast a concrete pad, which would be below grade and then pin the marble base and die to it. 3) Further excavation was done to create enough space for the concrete pad. Preceding this excavation, extensive probing of area, looking in vain for the lower base. 7/15/2020- 4) New in-ground concrete pad formed and poured. The back of the pad is sharply graded to accommodate the downward slope of the ground. 7/30/2020- 5) Double headstone thoroughly brushed then treated with D2 Biological Solution to help loosen heavy lichen and algae and also to retard future growth. The stone then scrubbed and rinsed with water. These procedures repeated until the stone was as clean as possible. 7/30/2020- 6) Form boards removed from base. Well-compacted sand and peastone placed around base. 7) Bottom of marble base (still firmly attached to die) and top of concrete base drilled to receive two 1/2" fiberglass pins. 8) Marble base and concrete base were pinned, the pins secured by Akepox 2010 Stone Epoxy. The repair was further strengthened by a gasket of setting compound all around 1/4" setting cushions at each corner. 9) Area landscaped around stone and base covered in sod at same angle as surrounding ground.

After Photo:

Inscription:

| | |
|-----------------|---------------|
| FATHER | MOTHER |
| ABIJAH SHUMWAY | RUTH MOORE |
| DIED | His Wife |
| April 21, 1869. | DIED |
| AE. 85 | Mar. 2, 1886. |
| | AE. 94. |



NORTH
CEMETERY
STURBRIDGE MA
JULY 29 2020




NORTH
CEMETERY
STURBRIDGE MA
JULY 29 2020



NORTH
CEMETERY
STURBRIDGE MA
SEPT 11 2020

Fannin•Lehner Abijah Shumway
271 Lexington Road d. 4/21/1869
Concord MA 01742 Ruth Shumway
North Cemetery d. 3/2/1886
Sturbridge MA July 29, 2020 630
Set: 3 Photo: DSC4-1043 "in process =

DSC4-1043-116

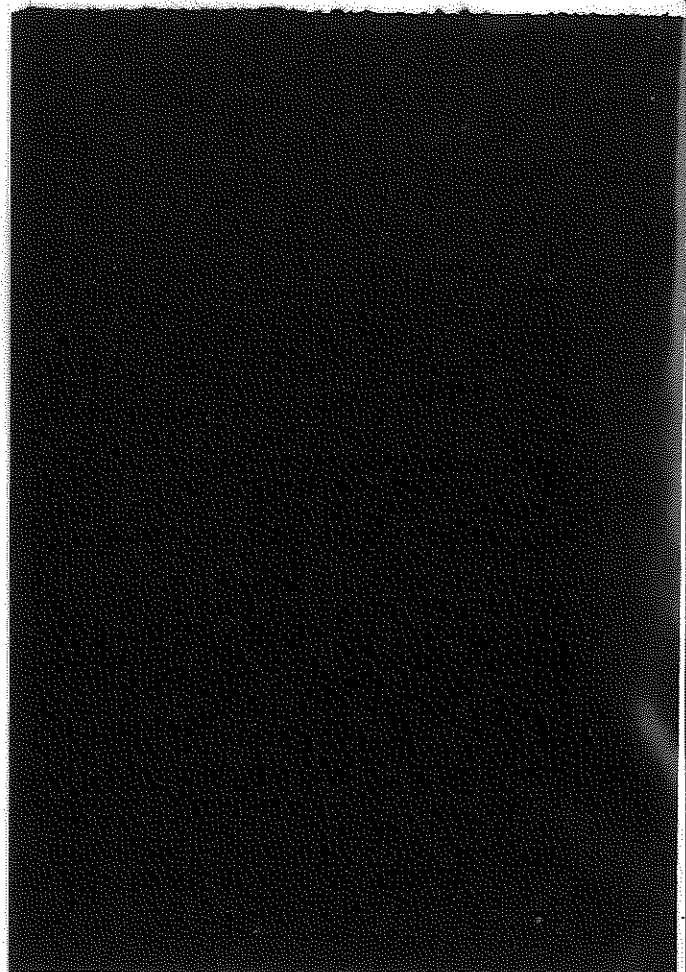

Fannin•Lehner Abijah Shumway d. 4/21/1869
271 Lexington Road Ruth Shumway d. 3/2/1886
Concord MA 01742 630
North Cemetery "in process =
Sturbridge MA July 29, 2020
Set: 3 Photo: DSC4-1046

DSC4-1046-116



Fannin•Lehner Abijah Shumway
271 Lexington Road d. 4/21/1869
Concord MA 01742 Ruth Moore Shumway
North Cemetery d. 3/2/1886 630
Sturbridge MA September 11-12, 2020 "after =
Set: 4 Photo: DSC4-1144

DSC4-1144-116

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 30, 2020

Name: Wright, Alpheus

Date of Death: Sept. 27, 1859

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front


Motif: Other Detail: Capitalized name in raised letters on incised banner

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Before Photo

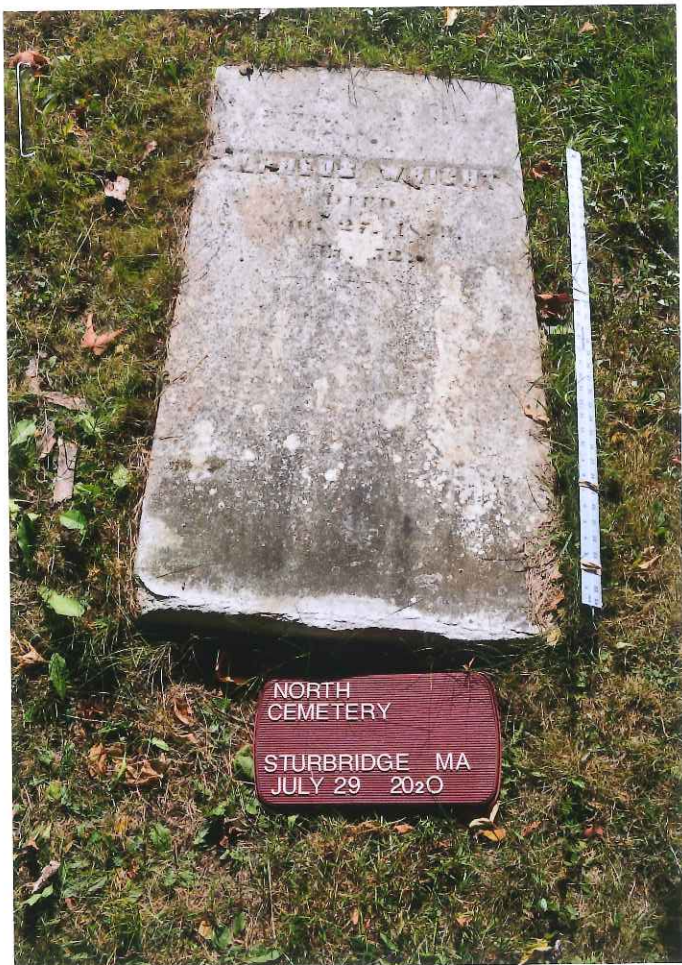

Ref / Sec: 621

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 22 H 46 D 2

Digital: Before Set: 3 Photo: DSC4-1044

Digital: After Set: 4 Photo: DSC5-0269

CONDITIONS _____

Sound:

Broken: Yes

Fallen: Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Along edges and break

Cracked: Light diagonal crack on face

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing

Flaking: Detail:

Fragments:

Losses: Along break; face losing surface

NOTES:

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA


Name: Wright, Alpheus

Date of Death: Sept. 27, 1859

Ref/Sec: 621

Conservation Notes: 7/30/2020- 1) Headstone lifted off ground and placed on 2x4s. It has clearly been in a base. The stone itself is weak at the bottom and the entire stone is experiencing serious sugar decay. 2) Stone treated with D2 Biological Solution to help lift the heavy lichen and algae and retard future biological growth. This was followed by scrubbing and water rinses. These procedures repeated until the stone was as clean as possible. The stone remains badly stained. 3) A below grade rough-cut sandstone base, with low bottom fragment firmly in slot, excavated. 4) A test fit of the two fragments was promising. It was decided to clean and reset base and low fragment with about 3" of low fragment above grade. 9/12/2020- 5) Base and low bottom fragment, firmly joined, thoroughly brushed. Then they were treated with D2, scrubbed, and rinsed until as clean as possible. 6) In the course of excavating to reset the base two marble footstones were discovered. One was broken off before the initials. The other footstone is for Doraanthea H. T. Carder, which will be returned to its proper lot (#633). 9/12/2020- 7) Base and low bottom fragment reset level and plumb, in well-compacted sand and peastone, facing west. Base was set a few inches below grade to give the tall, heavy top fragment more stability. 5/12/2021- 8) Top and bottom fragment treated with D2 Biological Solution, scrubbed one last time, and rinsed. 9) Top and bottom fragments drilled to receive two ½" fiberglass pins. 5/13/2021- 10) With the assistance of Andrew McDermott, Tyler Gustofson, and Dan Gervasi of the Sturbridge DPW, the heavy top fragment was lifted and pinned to the bottom fragment (there had been a prior test fit). The pins were secured with Akepox 2010 Stone Epoxy. 11) The stone has a permanent slight bend backward- this is because the stone is a bit warped in its lower section. 12) Infill along break with Limeworks St. Astier Lithomex Repair Mortar "White Marble." 13) Area around headstone landscaped.

After Photo:

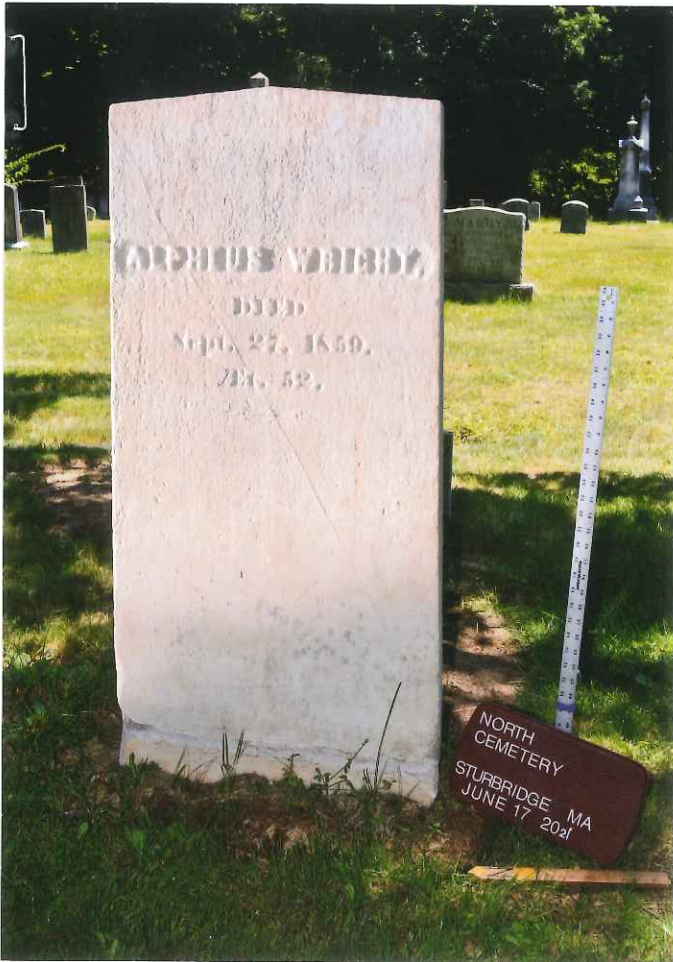

Inscription:

ALPHEUS WRIGHT
DIED
Sept. 27, 1859
AET. 52.

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 30, 2020

Name: Wright, Alpheus

Date of Death: Sept. 27, 1859

Marker Type: Footstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Traces

Bases: None Other:

Ref / Sec: 621F

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 6 1/4 H 11 1/2 D 1 1/2

Digital: Before Set: 3 Photo: DSC4-0154

Digital: After Set: 4 Photo: DSC5-0268

CONDITIONS

Sound:

Broken: Yes

Fallen: Details: Fallen and sunken

Previous Repair: None Evident

Detail:

Chipped: Along edges, especially at break

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate


Flaking: Detail:

Fragments: Three

Losses: Along breaks

NOTES: Footstone had received a heavy blow near its top

Before Photo

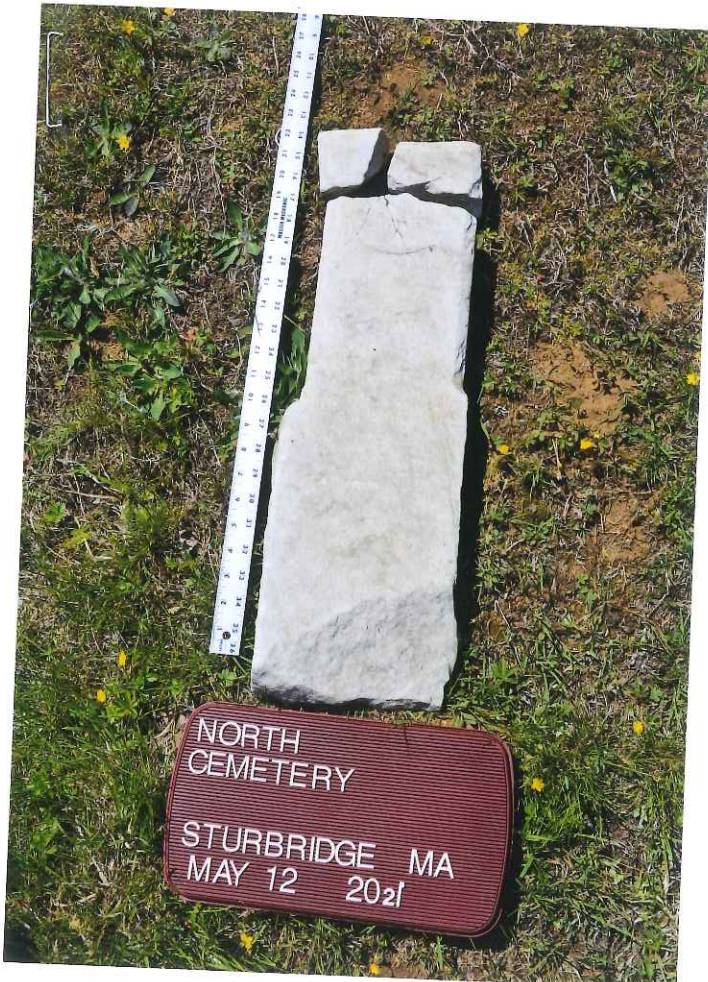

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Wright, Alpheus

Date of Death: Sept. 27, 1859

Ref/Sec: 621F

Conservation Notes: 5/12/2021- 1) In the process of excavating to reset the base of the Alpheus Wright headstone, two marble footstones, one with no inscription, the other for Doraanthea H. T. Carder, which was returned to its proper lot, #633, were found. The other footstone (in three fragments) is assumed to be marking the other end of Alpheus Wright's grave. 2) Footstone and top two fragments brushed, then treated with D2 Biological Solution and rinsed. These procedures repeated until the footstone and fragments were as clean as possible. 3) Footstone and two fragments drilled to receive three ¼" fiberglass rods. 4) Footstone and its two fragments pinned, the three rods secured with Akepox 2020 Stone Epoxy. Repair clamped. 5/14/2021- 5) Footstone reset level and plumb, in well-compacted sand and peastone, facing east. It has a vestigial part of a letter, "A"?, on its face. 6) Area landscaped around footstone. 7) Large infill, due to losses. The infill is composed of Limeworks St. Astier Lithomex Repair Mortar in a mixture of "White Marble," "Non-Pigmented," and "Slate."

After Photo:

Inscription:

(None)



Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 21, 2021

Name: Wright, Phebe

Date of Death: Oct. 18, 1857

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: Sandstone

Carved Surfaces: Front

Motif: Other Detail: "PHEBE" in raised letters on incised rectangular panel

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Ref / Sec: 621

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 10 3/4 H 25 D 2

Digital: Before Set: 3 Photo: DSC5-0156

Digital: After Set: Photo: 7 Photo: DSC5-0358

CONDITIONS

Sound:

Broken:

Tilted: Details: Forward and out of base

Previous Repair: Other

Detail: Stone had been secured in its base with an unknown material- failed

Chipped: Slightly along edges

Cracked:

Biological Activity: Lichen, algae

Soiling/Stains: Atmospheric, biological, soil

Delamination: On upper proper right shoulder and a circular one on top edge of headstone

Sugar Decay: Detail: Advancing

Flaking: Detail: Areas of delamination

Fragments:

Losses:

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Wright, Phebe

Date of Death: Oct. 18, 1857

Ref/Sec: 621

Conservation Notes: 7/21/2021- 1) This severely leaning stone excavated. It was immediately clear it had once been in a base. 2) The excavation continued. Probing had indicated a lot was going on below grade! Eventually, an intact sandstone base was discovered. Lying flat in back of the base was the headstone's marble footstone, with the clear initials of "P.W." Both base and footstone removed for cleaning. 3) Base thoroughly brushed, then treated with D2 Biological Solution to help prevent future biological growth. The base was then scrubbed and rinsed with water. These procedures were repeated until base was as clean as possible. 7/28/2021- 4) Previous repair removed from slot. It was discovered that the headstone was missing a bottom corner. 5) Headstone received a final cleaning of D2, scrubbing, and rinsing with water. 6) Sandstone base set with top just above grade, in well-compacted sand and peastone. 7) Headstone mortared into its base with Limeworks Ecologic Mortar. 8) Area landscaped around sandstone base.

After Photo:



Inscription:

PHEBE
Dau. of Alpheus
& Lucy Wright
DIED
Oct. 18, 1857
Aged 1 y'r
11 days.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 21, 2021

Name: Wright, Phebe

Date of Death: Oct. 18, 1857

Marker Type: Footstone Detail: _____

Stone Carver:

Material: Marble Other:

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 621F

Orientation: E

No. of People Commemorated: 1

Dimensions: (In) W 6 H 10 D 2

Digital: In Process Set: 5 Photo: DSC5-0337

Digital: After Set: 7 Photo: DSC5-0360

CONDITIONS _____

Sound: Yes

Broken:

Fallen: Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Slightly along edges

Cracked:

Biological Activity: Soil

Soiling/Stains: Soil

Delamination:

Sugar Decay: Detail: Minor

Flaking: Detail:

Fragments:

Losses:

NOTES: Found buried with sandstone base of headstone

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Wright, Phebe

Date of Death: Oct. 18, 1857

Ref/Sec: 621F

Conservation Notes: 7/21/2021- 1) This footstone discovered when excavating the below grade base of the headstone. It was buried flat behind the base. 2) Footstone excavated, thoroughly brushed, then treated with D2 Biological Solution to help prevent future biological growth. The base was then scrubbed and rinsed with water. These procedures were repeated until footstone was as clean as possible. 3) Although this is a child's stone, it was decided to set it in line with the Alpheus Wright footstone, which is 6' in back of its headstone. 4) Footstone reset level and plumb, in well-compacted sand and peastone, facing east. 5) Area landscaped around footstone.

After Photo:

Inscription:

P.W.



Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 21, 2021

Name: Wright, Luman/Lyman

Date of Death: Aug. 26, 1858 (both)

Marker Type: Footstone Detail: _____

Stone Carver:

Material: Marble Other:

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Before Photo



Ref / Sec: 621F

Orientation: E

No. of People Commemorated: 2

Dimensions: (In) W 6 H 10 D 2

Digital: Before Set: 3 Photo: DSC5-0157

Digital: After Set: Photo: 7 Photo: DSC5-0361

CONDITIONS

Sound:

Broken:

Fallen: Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses: Losing some surface due to sugar decay

NOTES: Found placed flat behind headstone

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Wright, Luman/ Lyman

Date of Death: Aug. 26, 1858 (both)

Ref/Sec: 621F

Conservation Notes: 7/21/2021- 1) This fallen footstone evaluated. It has plenty of length to reset. It was easily identified as it had been placed behind headstone. 2) Footstone thoroughly brushed, then treated with D2 Biological Solution to help prevent future biological growth. The base was then scrubbed and rinsed with water. These procedures were repeated until footstone was as clean as possible. 3) Although the footstone memorializes children, the footstone was to set it in line with the Alpheus Wright footstone, which is 6' in back of its headstone. 4) Footstone reset level and plumb, in well-compacted sand and peastone, facing east. 5) Area landscaped around footstone.

After Photo:

Inscription:

L.W.
L.W.



Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: May 12, 2021

Name: Shumway, Miss Nancy

Date of Death: June 28, 1835

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Slate Other: _____

Carved Surfaces: Front

Motif: Other Detail: Elaborately draped stylized urn on stippled background

Border: Elaborate Detail: Ball-topped columns

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 630

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 19 3/4 H 38 1/2 D 1 1/2

Digital: Before Set: 2 Photo: DSC5-0097

Digital: After Set: 3 Photo: DSC5-0155

CONDITIONS _____

Sound: Yes

Broken:

Tilted: Details: Severely backward

Previous Repair: None Evident

Detail:

Chipped:

Cracked: Has a natural diagonal seam at mid-section

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological, ferrous

Delamination: Several small incipient delaminations on back

Sugar Decay: Detail:

Flaking: Detail: Some mild flaking near ferrous

Fragments:

Losses: Part of back of proper left shoulder due to ferrous

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Shumway, Miss Nancy

Date of Death: June 18, 1835

Ref/Sec: 630

Conservation Notes: 5/12/2021- 1) Headstone excavated. It is a bit broken at the bottom but there is still plenty of length to reset. 2) In the course of the excavation, three bottom fragments, none very large were discovered. It was then decided to clean, then bury these fragments in the same hole in which the stone will be reset. 3) Headstone and fragments thoroughly brushed, then treated with D2 Biological Solution to help lift the heavier sections of lichen and algae and to reduce future biological growth. The stone and fragments then scrubbed and rinsed. These procedures repeated until the stone and fragments were as clean as possible. 4) Stone reset level and plumb in well-compacted sand and peastone, facing west. 5) Area around headstone landscaped.

After Photo:



Inscription:

Miss
Nancy Shumway
died
18 June, 1835, AEt.
36.

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Sept. 12, 2020

Name: Carder, Doraantha H. T.

Date of Death: 1840

Marker Type: Footstone/Marker Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: None Detail:

Border: None Detail:

Carving: Clear but worn

Bases: None Other:

Ref / Sec: 633

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 5 1/2 H 9 1/2 D 2

Digital: Before Set: 4 Photo: DSC4-1154

Digital: After Set: 6 Photo: DSC4-0023

CONDITIONS _____

Sound: Yes

Broken:

Fallen: Details: Fallen and sunken

Previous Repair: Other

Detail: Had been buried beneath Alpheus Wright, Lot 621

Chipped: Along edges

Cracked:

Biological Activity:

Soiling/Stains: From soil

Delamination:

Sugar Decay: Detail:

Flaking: Detail:

Fragments:

Losses: Original context in cemetery

NOTES:

Before Photo



Fannin-Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Carder, Doraantha H. T. Date of Death: 1840 Ref/Sec: 633

Conservation Notes: 9/12/2020- 1) When excavating prior to resetting the base for Alpheus Wright, d. Sept. 27, 1859, Lot 621, this intact footstone was discovered. The name, matching the four initials, was found on a nearby granite monument. It is surmised the family decided to update their family lot from marble to granite and this marble footstone was deemed superfluous. It was decided to clean the footstone and reset it next to the "SISTER" granite marker in the Carder lot #633. 10/24/2020- 2) Total length of footstone, now marker, was 15 1/2." It was decided to reset it 9 1/2" so it would be similar in height to the newer "SISTER" marker. 3) Marker thoroughly brushed and treated with D2 Biological Solution to help soil staining and to retard future growth. The marker was then scrubbed and rinsed with water. 4) Marker reset level and plumb, in well-compacted sand and peastone, next to its granite "SISTER" marker. 5) Area landscaped around marker.

After Photo:

Inscription:

D.H.T.C



Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 14, 2020

Name: Draper, George W. /Infant son

Date of Death: GWD: 3/16/1853 Infant Son: 11/30/1852

Marker Type: Small monument Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Shaft is tapered

Border: Simple Detail:

Carving: Clear but worn

Bases: Marble Other: Sandstone

Ref / Sec: 642

Orientation: W

No. of People Commemorated: 2

Dimensions: (In) W 10 1/2 - 12 (Die) H 35 (Entire monument) D 2 4/5 - 5 1/2 (Die)

Digital: Before Set: 5 Photo: DSC3-0818

Digital: After Set: 4 Photo: DSC4-1149

CONDITIONS

Sound: Loose on base

Broken:

Tilted: Details: Tilted and fallen

Previous Repair: Other

Detail: Shaft had been readhered to marble base with an extremely hard material (probably concrete) -failed.

Chipped: Sandstone base heavily chipped; marble base chipped at corners; die at base.

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing


Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo

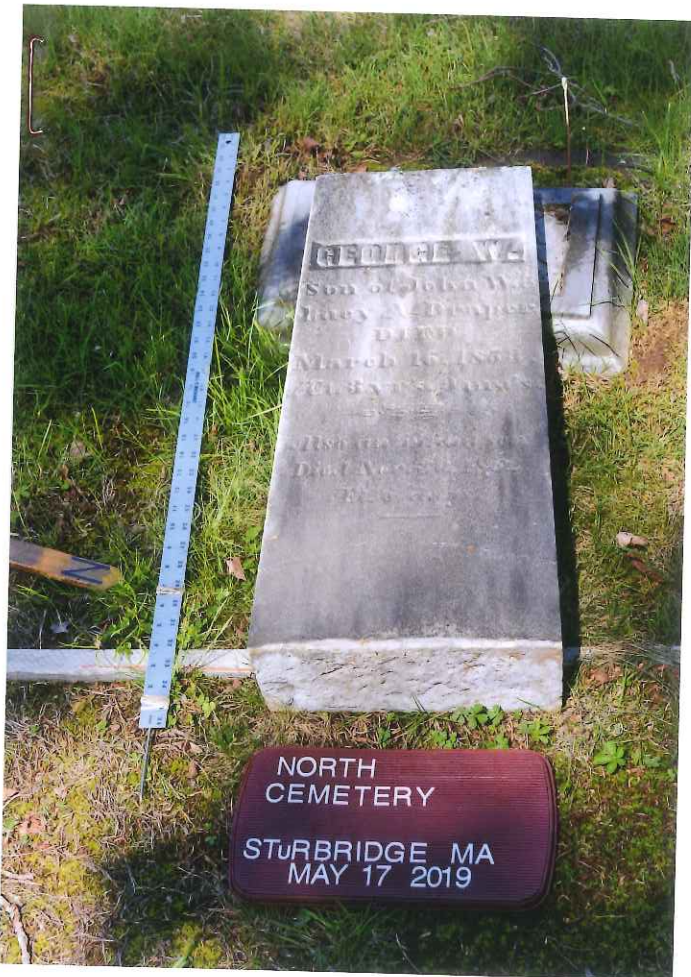


Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Draper, George W./ Infant Son
Ref/Sec: 642

Date of Death: GWD: 3/16/1853 Infant Son: 11/30/1852

Conservation Notes: 10/14/2020- 1) Removed marble plinth from sandstone base. 2) Monument excavated, raised (roughly to about 1" above grade), and sandstone base levelled on a bed of well-compacted sand and peastone. 3) Sandstone base treated with D2 Biological Solution to help lift lichen and algae and retard future biological growth. Base then scrubbed and rinsed with water. These procedures repeated until the base was as clean as possible. 7/13/2020- 4) Sandstone base, which developed some biological growth since last October, retreated with D2, scrubbed, and rinsed. 5) Marble base treated with D2, scrubbed, and rinsed. Procedures repeated until the marble base was as clean as possible. 7/14/2020- 6) Old previous repair removed from "slot" of marble base and bottom of shaft. 7/29/2020- 7) Shaft treated with D2, scrubbed, and rinsed with water. 8) Marble base set on sandstone base. It was secured by setting compound with an 1/8" setting cushion on each corner. 9) Shaft mortared into its wide slot on the marble base with Limeworks Ecologic Mortar. 10) Area landscaped around small monument.

After Photo:

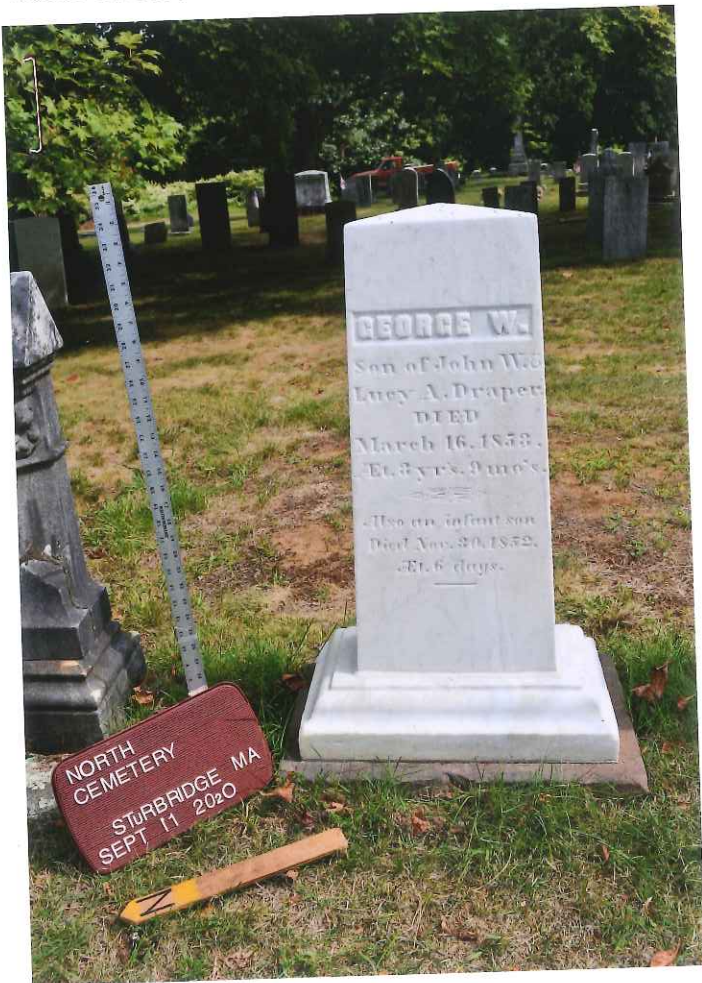

Inscription:

GEORGE W.
Son of John W. &
Lucy A. Draper,
DIED
March 16, 1853,
AEt. 3 yr's 9 mo's.

Also an infant son
Died Nov. 30, 1852.
AEt. 6 days.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: May 13, 2021

Name: Burgess, Luther

Date of Death: March 25, 1871

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Raised capitalized name on arched banner

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Ref / Sec: 643

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 17 3/4 H 43 D 1 7/8

Digital: Before Set: 7 Photo: DSC4-0057

Digital: After Set: 4 Photo: DSC5-0267

CONDITIONS

Sound: Stone still firmly in its base

Broken:

Tilted: Details: Severely backward

Previous Repair: Other

Detail: Stone had been re-inserted into base at unknown period with unknown material

Chipped: Along edges and corners

Cracked:

Biological Activity: Extremely heavy lichen, algae, moss

Soiling/Stains: Atmospheric, biological – deeply stained

Delamination:

Sugar Decay: Detail: Moderate- parts of face appear pitted


Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo

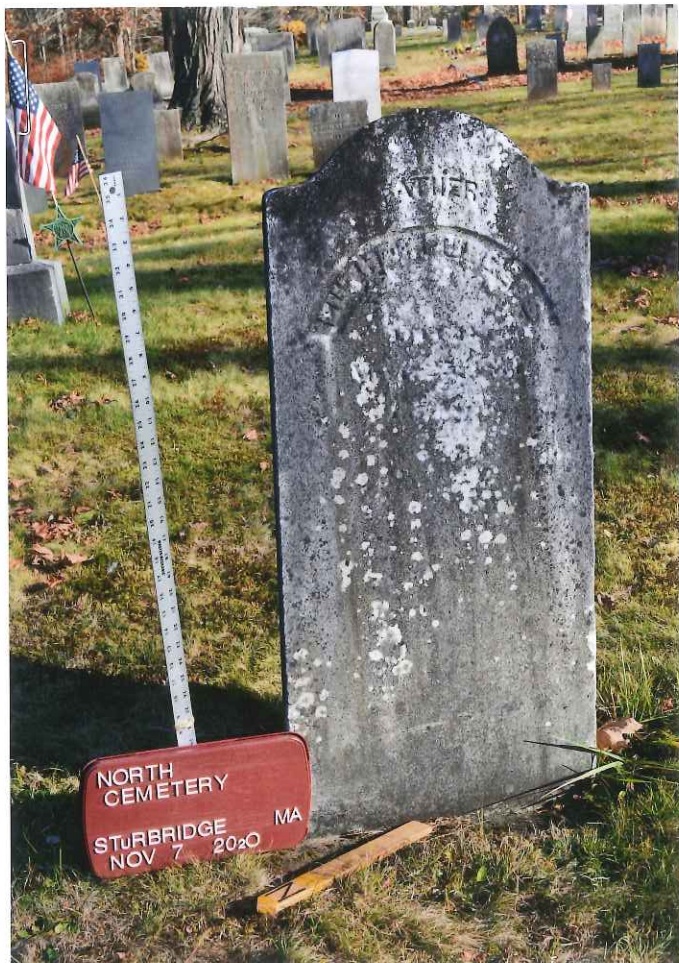

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Burgess, Luther

Date of Death: March 25, 1871

Ref/Sec: 643

Conservation Notes: 5/13/2021- 1) This solid headstone, firm in its base, is in good condition except for being severely tilted and deeply soiled by biological growth. 2) Excavation process began. The idea is to loosen the base, remove the old soil and raise it at least four inches so it is more obviously above grade. 5/14/2021 – 3) Excavation continued, soil removed. The headstone and its base are now free and were reset, in well-compacted sand and peastone, so the base is above grade. 4) The stone and base thoroughly brushed, then treated with D2 Biological Solution to help lift lichen and algae and to reduce future biological growth. The stone and fragments then scrubbed and rinsed. These procedures repeated several times but the stone is deeply stained. 5) Area around headstone landscaped.

After Photo:



Inscription:

FATHER
LUTHER BURGESS
DIED
MAR. 23, 1871
AEt. 72 yrs.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: June 19, 2021

Name: Burgess, Prudence Earle

Date of Death: Feb. 23, 1880

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: Sandstone

Carved Surfaces: Front

Motif: Other Detail: "PRUDENCE EARLE" in raised letters on incised arched banner

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Ref / Sec: 643

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 H 40 D 1 3/4

Digital: Before Set: 7 Photo: DSC4-0058

Digital: After Set: Photo: 7 Photo: DSC5-0359

CONDITIONS

Sound:

Broken:

Tilted: Details: Severely tilted backward

Previous Repair: Adhesive Repair

Detail: Between top and bottom fragment at unknown period and with unknown material - holding

Chipped: Slightly along edges

Cracked:

Biological Activity: Extremely heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing

Flaking: Detail:

Fragments:

Losses: Small loss along break with previous repair

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Burgess, Prudence Earle

Date of Death: Feb. 23, 1880

Ref/Sec: 643

Conservation Notes: 6/19/2021- 1) Headstone treated with D2 Biological Solution in advance of conservation planned for next site visit. 7/28/2021- 2) The headstone is securely inserted into a fine sandstone base. 3) Headstone and base sufficiently excavated to raise and reset. All old soil removed. Headstone and base set higher, level and plumb, in well-compacted sand and peastone, facing west. 4) Headstone thoroughly brushed, then treated with D2 Biological Solution to help prevent future biological growth. The base was then scrubbed and rinsed with water. These procedures were repeated until headstone was as clean as possible- although still heavily stained. 7/29/2021- 5) All cleaning steps repeated and headstone is considerably less stained. 6) Area around headstone landscaped.

After Photo:



Inscription:

MOTHER
PRUDENCE EARLE
wife of
Luther Burgess
DIED
Feb. 23, 1880.
AE. 83.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 29, 2020

Name: Sheldon, Mary E.

Date of Death: Feb. 6, 1858

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: "MARY E." in rained letters on small incised rectangular panel

Border: None Detail:

Carving: Mostly Deciph.

Bases: Sandstone Other:

Ref / Sec: 644

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 18 H 39 D 2

Digital: Before Set: 3 Photo: DSC4-1045

Digital: After Set: 5 Photo: DSC5-0328

CONDITIONS

Sound:

Broken: Yes

Fallen: Details: Yes

Previous Repair: Adhesive Repair/Other

Detail: At least two attempts at adhesive repair. Both failed. Other- Die had been inserted into sandstone base with unknown material- holding.

Chipped: Heavily along all breaks, also chipped lower edges

Cracked: Sandstone base

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing


Flaking: Detail:

Fragments:

Losses: Along breaks

NOTES:

Before Photo

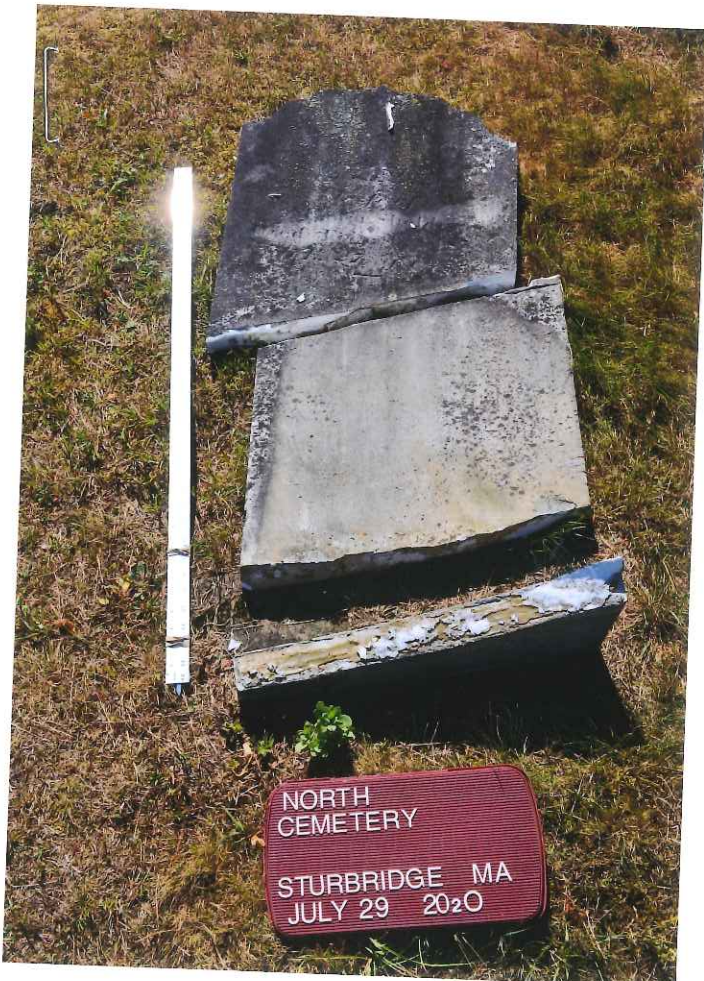

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA


Name: Sheldon, Mary E.

Date of Death: Feb. 6, 1858

Ref/Sec: 644

Conservation Notes: 7/29/2020- 1) Base and low bottom fragment excavated and placed on 2x4s. 9/12/2020- 2) Base and low bottom fragment thoroughly brushed and treated with D2 Biological Solution to help with the removal of lichen, moss, and algae and to retard future biological growth. They were then scrubbed and rinsed. They have been partially cleaned. 10/24/2020- 3) Failed repairs removed from top of bottom fragment and bottom of middle fragment. This was extremely arduous. 4) Bottom fragment, still firmly in sandstone base, reset level and plumb, in well-compacted sand and peastone. 5) Middle fragment thoroughly brushed, scrubbed, and rinsed. Several of these cycles repeated until fragment was clean. 5/15/2021- 6) More previous repair removed from middle fragment. 6/17/2021- 7) Arduous task of removing previous repair from all fragments completed. 8) Top fragment brushed, then treated with D2, scrubbed, and rinsed. Despite repeating these procedures, this fragment remains deeply stained. 9) All fragments drilled and pinned to receive four 4" long 1/4" fiberglass pins. 10) Middle fragment pinned to bottom fragment and top fragment pinned to middle fragment. All pins secured with Akemi 2010 Stone Epoxy. All repairs clamped. 6/19/2021- 11) Infill along all breaks using Limeworks St. Astier Lithomex Repair Mortar; "White Marble." 12) Area landscaped around headstone. Note: Some previous repair material- especially on the lower break- left on non-bearing surfaces. Removing this material would result in removing some of the marble face.

After Photo:

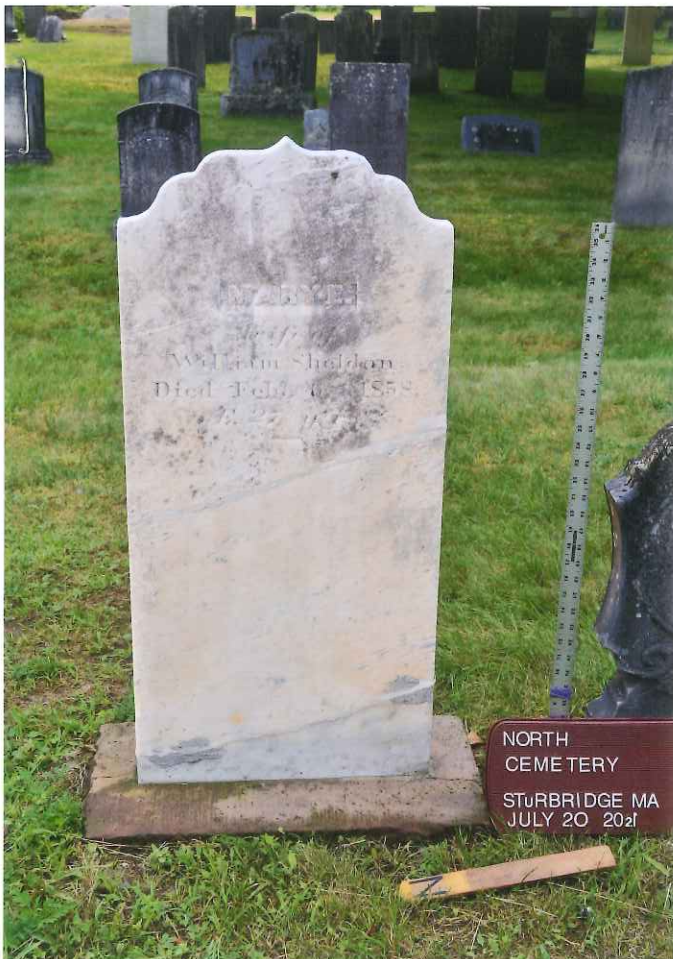

Inscription:

MARY E.
wife of
William Sheldon
Died Febr. 6, 1858,
AE 27 y'rs.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: May 14, 2021

Name: Congdon, Mary

Date of Death: Feb. 1, 1852

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: "MARY" in capitalized letters on incised panel

Border: None Detail:

Carving: Mostly Deciph.

Bases: Sandstone Other:

Ref / Sec: 644

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 22 H 44 D 2

Digital: Before Set: 7 Photo: DSC4-0059

Digital: After Set: 5 Photo: DSC5-0329

CONDITIONS _____

Sound: Slightly loose in base

Broken:

Tilted: Details: Yes

Previous Repair: None Evident

Detail:

Chipped: Slightly along edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Advancing- especially evident in fading epitaph

Flaking: Detail:

Fragments:

Losses:

NOTES: Stone moves slightly in its slot but is secure

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Congdon, Mary

Date of Death: Feb. 1, 1852

Ref/Sec: 644

Conservation Notes: 5/14/2021- 1) Headstone and base excavated. The base was found to be too small to support the stone above grade. After cleaning, the base, with the stone still attached, will be reset about 4” below grade. 2) Sandstone base, with headstone still quite firmly in it, set level and plumb, in well-compacted sand and peastone. The headstone is still a bit loose. 6/17/2021- 3) The severely black headstone thoroughly brushed, then treated with D2 Biological Solution to help lift lichen and algae as well as to retard future biological growth. The headstone was then scrubbed and rinsed with water. These procedures repeated until the headstone was as clean as possible. 6/19/2021- 4) Another round of cleaning, including D2, scrub, and rinse procedures. Headstone still deeply stained. 5) The headstone is still a bit unsteady, so a Lincoln Penny was inserted in the mortar between the die and base at the back of the stone. Headstone now stable. 6) Area landscaped around stone.

After Photo:



Inscription:

MARY
Wife of
John Congdon
died Feb. 1, 1852
Aged 81.

Go, peaceful spirit- rest
Secure from earth's alarms
Go sleep with the savior's breast
Encircled by his arms.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: Oct. 24, 2020

Name: Harding, Augusta

Date of Death: August. 9, 1880

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: "AUGUSTA" in raised letters on an incised rectangular banner

Border: None Detail:

Carving: Clear but worn

Bases: Granite Other:

Ref / Sec: 654

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 20 H 36 D 2

Digital: Before Set: 3 Photo: DSC3-0579

Digital: After Set: 7 Photo: DSC4-0066

CONDITIONS _____

Sound:

Broken: Yes

Tilted: Details: Severely forward, sunken

Previous Repair: Other

Detail: Headstone received a major impact- maybe from a tree branch. It broken the base. Unsuccessful attempts made to repair the base, prop the stone- all failed.

Chipped: Along edges, especially proper left edge

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological, large splatter-type stain on face (possibly from an egg).

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses: Use of original granite base.

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Harding, Augusta

Date of Death: Aug. 9, 1880

Ref/Sec: 654

Conservation Notes: 9/24/2020- 1) Exploration. Upon excavation, broken granite base discovered. Attempt has been made to repair the base- failed. Finally, the granite base was used to prop up the stone. This also failed. 2) The partial broken granite base removed and set aside. It was decided the stone needed a new base. 3) Headstone thoroughly brushed and treated with D2 Biological Solution to help remove heavy lichen, algae, and biological staining, and to retard future growth. 4) Headstone was then scrubbed and rinsed with water. These three procedures- D2, scrub, rinse- repeated several times until the stone was as clean as possible. The splatter/egg stain resisted all cleaning efforts. 10/29/2020- 5) New concrete slotted base formed and poured off site. 11/7/2020- 6) New concrete slotted base reset level and plumb, in well-compacted sand and peastone, just below grade. 7) Headstone mortared into its new base with Limeworks Ecologic Mortar. 11/9/2020- 8) Area landscaped around stone.

After Photo:



Inscription:

AUGUSTA
wife of
STEPHEN HARDING
DIED
Aug. 9, 1880.
AE. 86 ys. 11 ms.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: June 19, 2020

Name: Holbrook, Dea. Elias

Date of Death: Jan. 17, 1870

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: Name in capitalized raised letters on incised narrow rectangle

Border: None Detail:

Carving: Clear but worn

Bases: Other: Concrete mass

Ref / Sec: 655

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 19 3/4 H 40 D 2

Digital: Before Set: 5 Photo: DSC3-0819

Digital: After Set: 4 Photo: DSC4-1153

CONDITIONS

Sound:

Broken: Yes

Fallen: Details: Yes

Previous Repair: Other

Detail: Broken stone had been stuck in a concrete puddle instead of locating the bottom fragment

Chipped: Some chipping along edges and along break

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate to advancing


Flaking: Detail:

Fragments:

Losses: Along break

NOTES:

Before Photo

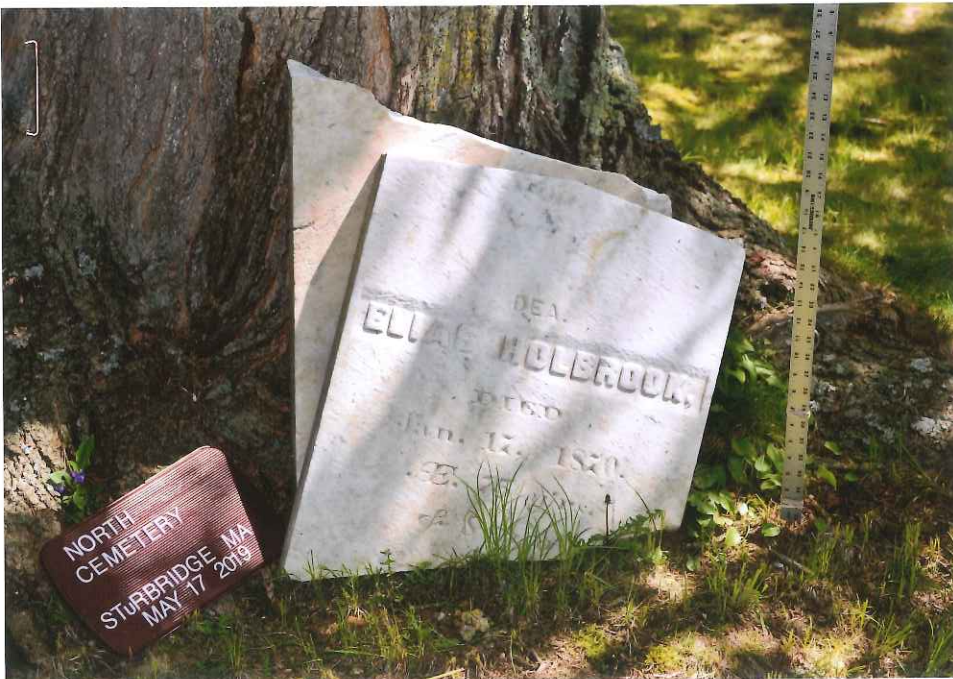

Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA


Name: Holbrook, Dea. Elias

Date of Death: Jan. 17, 1870

Ref/Sec: 655

Conservation Notes: 9/19/2020- 1) Both fragments thoroughly brushed. 2) Both treated with D2 Biological Solution to help lift lichen and algae and retard future biological growth. Fragments then scrubbed and rinsed with water. These procedures repeated until both fragments were as clean as possible. Some staining remains. 7/12/2020- 3) The lot number for the stone found in research materials. Investigating Lot #655, an at-grade bottom fragment was found next to the Deacon's wife, Charlotte Holbrook. Comparing measurement of the two fragments, leaning against a nearby tree, and the bottom fragment, still in the ground, there is a definite match. 7/13/2020- 4) Bottom fragment (in ground) investigated. It is very close to level (1/8" off) so it was decided not to excavate and reset it- the resetting would be complicated by the bottom fragment being adhered in a concrete mass. 5) Above grade portion of bottom fragment brushed, then treated with D2, scrubbed, and rinsed. 7/30/2020- 6) Top of bottom fragment and bottom of middle fragment drilled to receive two 1/2" fiberglass rods. 7) Middle and bottom fragment pinned, the 1/2" rods secured by Akepox 2010 Stone Epoxy. 8) Top of middle fragment and bottom of the top fragment drilled to receive two 1/2" fiberglass rods. 9) Top and middle fragment pinned, the pins secured by Akepox 2010 Stone Epoxy. 10) Infill around both repairs using Limeworks St. Astier Lithomex Repair Mortar "White Marble" mortar.

After Photo:

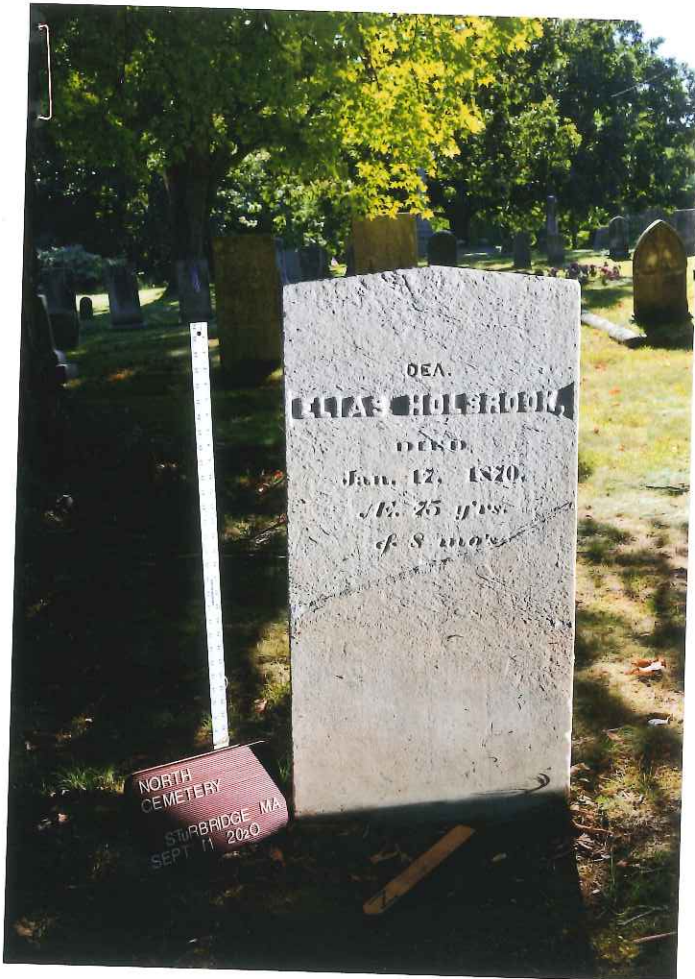

Inscription:

DEA.
ELIAS HOLBROOK,
DIED
Jan. 17, 1870.
AEt. 75 yrs.
& 8 mo's.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 29, 2021

Name: Westgate, Hannah N.

Date of Death: Sept. 24, 1850

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: Sandstone

Carved Surfaces: Front

Motif: Other Detail: "HANNAH N." in raised letters on incised banner

Border: None Detail:

Carving: Clear but worn

Bases: Sandstone Other:

Ref / Sec: 667

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 15-16 3/4 H 24 D 1 1/2

Digital: Before Set: 7 Photo: DSC4-0352

Digital: After Set: Photo: 7 Photo: DSC5-0364

CONDITIONS _____

Sound: Yes

Broken:

Tilted: Details: Backward

Previous Repair: None Evident

Detail:

Chipped: Slightly, lower edges and headstone and base

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses:

NOTES: Headstone is tapered

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA

Name: Westgate, Hannah N.


Date of Death: Sept. 24, 1850

Ref/Sec: 667

Conservation Notes: 7/29/2021- 1) Headstone evaluated. It is firmly in its base but tilted backward. A decision was made to excavate around the base, remove from ground, and replace the soil with well-compacted sand and peastone. 2) Headstone, with attached sandstone base excavated, and removed from excavation. Soil removed from excavation and stone and base set level and plumb on well-compacted sand and peastone. 3) Headstone thoroughly brushed, then treated with D2 Biological Solution to remove heavy lichen and algae and retard future biological growth. The stone was then scrubbed and rinsed. 7/30/2021- 4) All above cleaning procedures repeated until the stone was as clean as possible. 5) Area landscaped around stone.

After Photo:

Inscription:

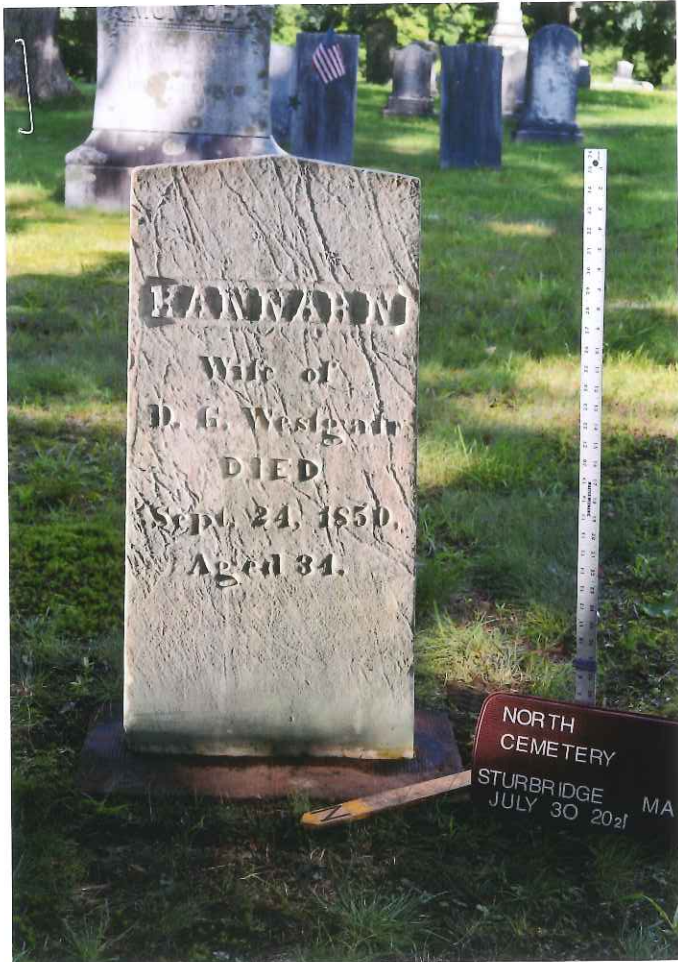

HANNAH N.
Wife of
D. G. Westgate
DIED
Sept. 24, 1850
Aged 34.

Fannin-Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 28, 2021

Name: Westgate, Maria Louisa

Date of Death: Oct. 7, 1889

Marker Type: Monument Detail: _____

Stone Carver:

Material: Marble Other: Sandstone

Carved Surfaces: Front

Motif: Other Detail: "MARIA LOUISA" in raised letters on stylized banner

Border: Elaborate Detail: Beveled with decorative edges

Carving: Clear but worn

Bases: Marble Other:

Ref / Sec: 667

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 20 1/4 H 40 D 6

Digital: Before Set: 7 Photo: DSC4-0060

Digital: After Set: Photo: 7 Photo: DSC5-0365

CONDITIONS _____

Sound: Yes

Broken:

Tilted: Details: Backward and to proper right

Previous Repair: None Evident

Detail:

Chipped: Only the lowest base has slight chipping

Cracked:

Biological Activity: Extremely heavy lichen, algae

Soiling/Stains: Atmospheric, biological, ferrous?

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo



Fannin•Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA


Name: Westgate, Maria Louisa

Date of Death: Oct. 7, 1889

Ref/Sec: 667

Conservation Notes: 7/28/2021- 1) This monument is heavily soiled and tilted backward. It is also firmly attached. A decision was made to dig out all around it, ease it to level and replace the soil with sand and peastone. 2) Process started with excavating out the monument and attempting to bring it to level. 7/29/2021- 3) Excavation continued and monument finally brought to level, supported by well-compacted sand and peastone. 4) Monument thoroughly brushed, then treated with D2 Biological Solution. It was then scrubbed and rinsed. It was extremely difficult to get clean. 7/30/2021- 5) Monument treated with D2 multiple times, then scrubbed and rinsed. Finally, it appears to be as clean as possible. 6) Area landscaped around monument.

After Photo:

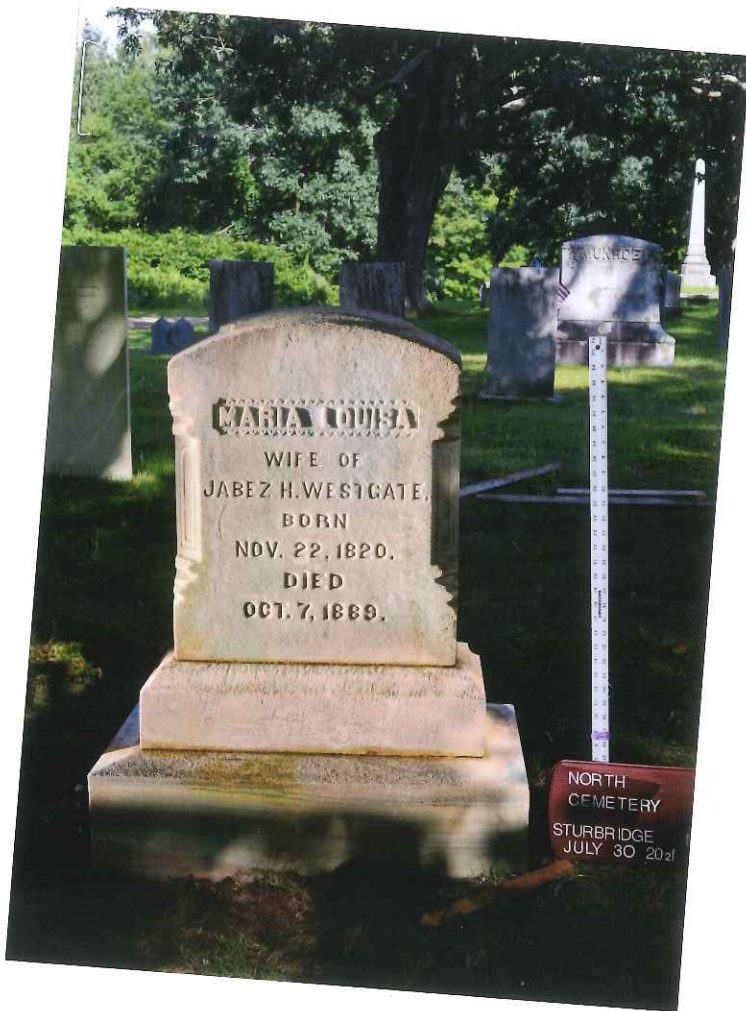

Inscription:

MARIA LOUISA
WIFE OF
JABEZ H. WESTGATE
BORN
NOV. 22, 1820:
DIED
OCT. 7, 1889.

Fannin•Lehner Gravestone Conservation Form - Page 1
Cemetery: North Cemetery, Sturbridge, MA

Record Date: July 29, 2021

Name: Allen, Anna B.

Date of Death: Aug. 30, 1861

Marker Type: Headstone Detail: _____

Stone Carver:

Material: Marble Other: _____

Carved Surfaces: Front

Motif: Other Detail: "ANNA B." in raised letters on incised decorative rectangle

Border: Simple Detail: Beveling creates a frame around the inscription panel

Carving: Clear but worn

Bases: Sandstone Other: _____

Ref / Sec: 668

Orientation: W

No. of People Commemorated: 1

Dimensions: (In) W 22 H 45 1/2 D 2

Digital: Before Set: 6 Photo: DSC5-0351

Digital: After Set: 7 Photo: DSC5-0363

CONDITIONS _____

Sound: Yes

Broken:

Tilted: Details: Backward

Previous Repair: None Evident

Detail:

Chipped: Very slightly, lower edges

Cracked:

Biological Activity: Heavy lichen, algae

Soiling/Stains: Atmospheric, biological

Delamination:

Sugar Decay: Detail: Moderate

Flaking: Detail:

Fragments:

Losses:

NOTES:

Before Photo



Fannin-Lehner Gravestone Conservation Form - Page 2
Cemetery: North Cemetery, Sturbridge, MA


Name: Allen, Anna B.

Date of Death: Aug. 30, 1861

Ref/Sec: 668

Conservation Notes: 7/29/2021- 1) Headstone evaluated. It is firm in its base but tilted backward. A decision was made to excavate around the base and bring it to level. 2) Excavation process began around sandstone base. The base and headstone slowly brought to level. The excavated soil replaced by heavily compacted sand and peastone. 3) Headstone and base thoroughly brushed, then treated with D2 Biological Solution to help lift lichen and algae and retard future biological growth. The stone and base then scrubbed and rinsed with water. 7/30/2021- 4) The above cleaning procedures repeated until the stone was as clean as possible. 5) Area landscaped around headstone and base.

After Photo:

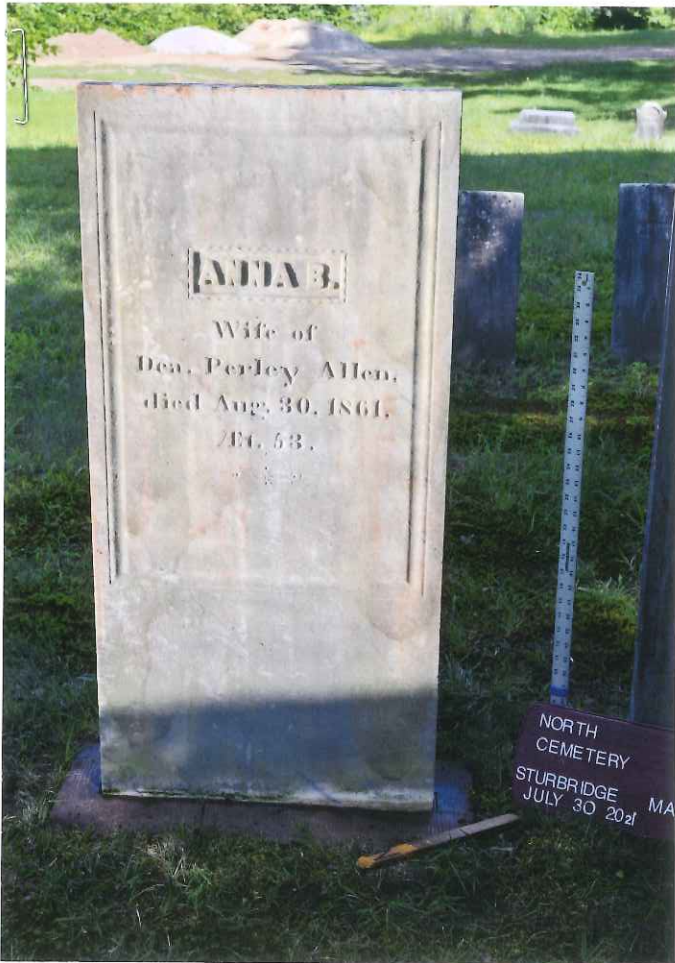

Inscription:

ANNA B.
Wife of
Dea. Perley Allen,
died Aug. 30, 1861.
AEt. 53.